

## PIC16(L)F18855/18875 Family Silicon Errata and Data Sheet Clarification

The PIC16(L)F18855/18875 family devices that you have received conform functionally to the current Device Data Sheet (DS40001802G), except for the anomalies described in this document.

The silicon issues discussed in the following pages are for silicon revisions with the Device and Revision IDs listed in [Table 1](#). The silicon issues are summarized in [Table 2](#).

The errata described in this document will be addressed in future revisions of the PIC16(L)F18855/18875 silicon.

**Note:** This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated in the last column of [Table 2](#) apply to the current silicon revision (A2).

Data Sheet clarifications and corrections start on [page 6](#), following the discussion of silicon issues.

The silicon revision level can be identified using the current version of MPLAB® IDE and Microchip's programmers, debuggers, and emulation tools, which are available at the Microchip corporate website ([www.microchip.com](http://www.microchip.com)).

**TABLE 1: SILICON DEVREV VALUES**

Part Number	Device ID <sup>(1)</sup>	Revision ID (Silicon Revision) <sup>(2)</sup>	
		A2	A5
PIC16F18855	306Ch	2002h	2005h
PIC16LF18855	306Eh	2002h	2005h
PIC16F18875	306Dh	2002h	2005h
PIC16LF18875	306Fh	2002h	2005h

**Note 1:** The Revision ID and Device ID are located in the Configuration memory at addresses 8005h and 8006h, respectively.

**2:** Refer to the "PIC16(L)F188XX Memory Programming Specification" (DS40001753) for detailed information on Device and Revision IDs for your specific device.

For example, to identify the silicon revision level using MPLAB IDE in conjunction with a hardware debugger:

1. Using the appropriate interface, connect the device to the hardware debugger.
2. Open an MPLAB IDE project.
3. Configure the MPLAB IDE project for the appropriate device and hardware debugger.
4. For MPLAB X IDE, select *Window > Dashboard* and click the **Refresh Debug Tool Status** icon (  ).
5. Depending on the development tool used, the part number and Device Revision ID value appear in the **Output** window.

**Note:** If you are unable to extract the silicon revision level, please contact your local Microchip sales office for assistance.

The DEVREV values for the various PIC16(L)F18855/18875 silicon revisions are shown in [Table 1](#).

**TABLE 2: SILICON ISSUE SUMMARY**

Module	Feature	Item No.	Issue Summary	Affected Revision <sup>(1)</sup>	
				A2	A5
Oscillator	Fail-Safe Clock Monitor (FSCM)	1.1	FSCM may fail to trigger with 4xPLL enabled.	X	
Analog-to-Digital Converter with Computation (ADC2)	ADC Conversion	2.1	Delay of one instruction cycle required prior to setting the ADGO bit when using ADCRC as the ADCC clock source.	X	
Analog-to-Digital Converter with Computation (ADC2)	Computation Overflow Bit	2.2	The Computation Overflow bit may be erroneously set by the ADFLTR.	X	
Analog-to-Digital Converter with Computation (ADC2)	Positive Voltage Reference	2.3	Using the FVR as the ADC positive voltage reference can cause missing codes.	X	X
Nonvolatile Memory Control	NVMREG Access	3.1	Self-writes on LF devices below 2.2V at -40°C may not work.	X	
EEPROM	Indirect read	4.1	Indirect read of EEPROM with FSR returns unexpected value.	X	
ECCP	Compare mode	5.1	Compare Toggle mode may output multiple pulses when source clock has a prescaler other than 1:1.	X	
MSSP	I <sup>2</sup> C Communication	6.1	Acknowledge failure on LF devices only.	X	
Electrical Specifications	Fixed Voltage Reference (FVR) Accuracy	7.1	Fixed Voltage Reference (FVR) output tolerance may be higher than specified at temperatures below -20°C.	X	
Secondary Oscillator (Sosc)	Low-Power mode	8.1	SOSC does not properly run in Low-Power mode at low temperatures.	X	
Comparators	Offset Voltage	9.1	Comparator Input Offset value is higher than specified.	X	X

**Note 1:** Only those issues indicated in the last column apply to the current silicon revision.

## Silicon Errata Issues

**Note:** This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated by the shaded column in the following tables apply to the current silicon revision (**A2**).

### 1. Module: Oscillator

#### 1.1 Fail-Safe Clock Monitor

The Fail-Safe Clock Monitor may fail to trigger with the loss of the external clock signal when the 4x PLL is enabled. This includes all external clock modes, LP, XT, HS, ECL, ECM, ECH.

##### Work around

None.

##### Affected Silicon Revisions

A2	A5						
X							

### 2. Module: Analog-to-Digital Converter with Computation (ADC2)

#### 2.1 ADC Conversion

When using ADCRC as the clock source for ADCC, there is a delay of one instruction cycle between the user setting the ADGO bit and being able to read it set. This can lead to a false conversion complete scenario (i.e., ADGO being cleared), depending if the user code has a bit clear test (BTFSC) instruction on the ADGO bit, immediately after setting the ADGO bit. See code example below.

e.g.

```
BSF ADCON0, ADGO      ; Start conversion
BTSFC ADCON0, ADGO    ; Is conversion done?
GOTO $-1                ; No, test again
```

The BTFSC will pass the very first time in this situation.

##### Work around

Add a NOP instruction after setting the ADGO bit and before testing the bit for completion of conversion. See code example below.

e.g.

```
BSF ADCON0, ADGO      ; Start conversion
NOP
BTSFC ADCON0, ADGO    ; Is conversion done?
GOTO $-1                ; No, test again
```

##### Affected Silicon Revisions

A2	A5						
X							

#### 2.2 Computation Overflow Bit

If the sign bit of ADFLTR (bit 7 of ADFLTRH) is set, the Computation Overflow bit will also be set, even though this is not a legitimate case of an overflow event.

##### Work around

None.

##### Affected Silicon Revisions

A2	A5						
X							

## 2.3 Positive Voltage Reference

Using the FVR as the positive voltage reference for the ADC can cause an increase in missing codes.

### Work around

Increase the bit conversion time (TAD) to 8 us or higher.

### Affected Silicon Revisions

A2	A5					
X						

## 3. Module: Nonvolatile Memory Control

### 3.1 NVMREG Access

When performing self-writes through NVMREG access on PIC16LF18855/75 devices with VDD below 2.2V and temperature of -40°C, the write operation may not work. This applies to both PFM and EEPROM writes.

### Work around

None.

### Affected Silicon Revisions

A2	A5					
X						

## 4. Module: EEPROM

### 4.1 Using FSR and INDF to Read EEPROM Returns Unexpected Values

Performing FSR reads of data EEPROM from addresses other than the lowest address (FSR = 7000h) will return unexpected values.

### Work around

Set NVMDRH:L to the desired address (F000h through F0FFh) and retrieve the EEPROM value from the NVMDATL register by setting the NVMREGS and RD bits in the NVMCON1 register.

### Affected Silicon Revisions

A2	A5					
X						

## 5. Module: ECCP

### 5.1 Compare Mode

The ECCP Compare Toggle modes (CCPxCON<3:0> bits = 0010 or 0001) output multiple pulses instead of a single toggle pulse when its source clock has a prescaler other than 1:1.

### Work around

Use CCP Compare mode with pulse output (CCPxCON<3:0> bits = 1011) to clock a CLC configured as a J-K flip-flop in Toggle mode.

### Affected Silicon Revisions

A2	A5					
X						

## 6. Module: MSSP

### 6.1 I<sup>2</sup>C Communication

When using the MSSP to perform I<sup>2</sup>C communication on LF devices and the voltage for VDD is above 3V, the Acknowledge signal (ACK) does not always occur after the second address byte is received, as expected. This issue exhibits itself when the MSSP is configured either for 7-bit or 10-bit addressing and in either Master or Slave mode.

The issue occurs more frequently when using 10-bit addressing in Slave mode and the lower address bits (A7-A0) are transmitted by the Master on the SDA line.

### Work around

Do not exceed 3V on VDD when using an LF device in this manner.

### Affected Silicon Revisions

A2	A5					
X						

## 7. Module: Electrical Specifications

### 7.1 Fixed Voltage Reference (FVR) Accuracy

At temperatures below -20°C, the output voltage for the FVR may be greater than the levels specified in the data sheet. This will apply to all three gain amplifier settings (1X, 2X, 4X). The affected parameter numbers found in the data sheet are: FVR01, (1X gain setting), FVR02 (2X gain setting), and FVR03 (4X gain setting).

#### Work around

At temperatures above -20°C, the stated tolerances in the data sheet remain in effect. Operate the FVR only at temperatures above -20°C.

#### Affected Silicon Revisions

A2	A5						
X							

## 8. Module: Secondary Oscillator (Sosc)

### 8.1 Low-Power Mode

While operating the device at low temperatures and using the Sosc in Low-Power mode (OSCCON3<6> = 0), the Sosc might fail to operate as expected.

#### Work around

If Sosc functionality is required at low temperatures, configure the Sosc for high-power operation (OSCCON3<6> = 1).

#### Affected Silicon Revisions

A2	A5						
X							

## 9. Module: Comparators

### 9.1 Offset Voltage

The maximum value of the input offset voltage for the comparators is increasing from  $\pm 30$  mV to  $\pm 60$  mV.

The parameter in the data sheet is CM01, also known as VIOFF.

#### Work around

None.

#### Affected Silicon Revisions

A2	A5						
X	X						

## Data Sheet Clarifications

The following typographic corrections and clarifications are to be noted for the latest version of the device data sheet (DS40001802G):

**Note:** Corrections are shown in **bold**. Where possible, the original bold text formatting has been removed for clarity.

None.

## APPENDIX A: DOCUMENT REVISION HISTORY

### **Rev F Document (3/2020)**

Added Module 9 (Comparators).

### **Rev E Document (3/2018)**

Added Module 7 (Secondary Oscillator) and a row in Table 2;

Added silicon revision A5 and associated issues.

### **Rev D Document (4/2017)**

Added Modules 2.3 (PVR), 6 (MSSP) and 7 (Electrical Specifications).

#### **Data Sheet Clarifications:**

Removed all modules, data sheet updated.

### **Rev C Document (8/2016)**

Added Modules 2.1, 4 and 5 to the Silicon Errata Issues section. Added Modules 1 to 15 to the Data Sheet Clarifications section. Other minor corrections.

### **Rev B Document (12/2015)**

Added Module 3. Other minor corrections.

### **Rev A Document (11/2015)**

Initial release of this document.

---

**Note the following details of the code protection feature on Microchip devices:**

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as "unbreakable."

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

---

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. **MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE.** Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

### Trademarks

The Microchip name and logo, the Microchip logo, Adaptec, AnyRate, AVR, AVR logo, AVR Freaks, BesTime, BitCloud, chipKIT, chipKIT logo, CryptoMemory, CryptoRF, dsPIC, FlashFlex, flexPWR, HELDO, IGLOO, JukeBlox, KeeLoq, Kleer, LANCheck, LinkMD, maXStylus, maXTouch, MediaLB, megaAVR, Microsemi, Microsemi logo, MOST, MOST logo, MPLAB, OptoLyzers, PackeTime, PIC, picoPower, PICSTART, PIC32 logo, PolarFire, Prochip Designer, QTouch, SAM-BA, SenGenuity, SpyNIC, SST, SST Logo, SuperFlash, Symmetricom, SyncServer, Tachyon, TempTrackr, TimeSource, tinyAVR, UNI/O, Vectron, and XMEGA are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

APT, ClockWorks, The Embedded Control Solutions Company, EtherSynch, FlashTec, Hyper Speed Control, HyperLight Load, IntelliMOS, Libero, motorBench, mTouch, Powermite 3, Precision Edge, ProASIC, ProASIC Plus, ProASIC Plus logo, Quiet-Wire, SmartFusion, SyncWorld, Temux, TimeCesium, TimeHub, TimePictra, TimeProvider, Vite, WinPath, and ZL are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Adjacent Key Suppression, AKS, Analog-for-the-Digital Age, Any Capacitor, AnyIn, AnyOut, BlueSky, BodyCom, CodeGuard, CryptoAuthentication, CryptoAutomotive, CryptoCompanion, CryptoController, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, EtherGREEN, In-Circuit Serial Programming, ICSP, INICnet, Inter-Chip Connectivity, JitterBlocker, KleerNet, KleerNet logo, memBrain, Mindi, MiWi, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, Omniscient Code Generation, PICDEM, PICDEM.net, PICkit, PICtail, PowerSmart, PureSilicon, QMatrix, REAL ICE, Ripple Blocker, SAM-ICE, Serial Quad I/O, SMART-I.S., SQL, SuperSwitcher, SuperSwitcher II, Total Endurance, TSHARC, USBCheck, VariSense, ViewSpan, WiperLock, Wireless DNA, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

The Adaptec logo, Frequency on Demand, Silicon Storage Technology, and Symmcom are registered trademarks of Microchip Technology Inc. in other countries.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2015-2020, Microchip Technology Incorporated, All Rights Reserved.

ISBN: 978-1-5224-5870-8

For information regarding Microchip's Quality Management Systems, please visit [www.microchip.com/quality](http://www.microchip.com/quality).



# MICROCHIP

## Worldwide Sales and Service

### AMERICAS

**Corporate Office**  
2355 West Chandler Blvd.  
Chandler, AZ 85224-6199  
Tel: 480-792-7200  
Fax: 480-792-7277  
Technical Support:  
<http://www.microchip.com/support>  
Web Address:  
[www.microchip.com](http://www.microchip.com)

**Atlanta**

Duluth, GA  
Tel: 678-957-9614  
Fax: 678-957-1455

**Austin, TX**

Tel: 512-257-3370

**Boston**

Westborough, MA  
Tel: 774-760-0087  
Fax: 774-760-0088

**Chicago**

Itasca, IL  
Tel: 630-285-0071  
Fax: 630-285-0075

**Dallas**

Addison, TX  
Tel: 972-818-7423  
Fax: 972-818-2924

**Detroit**

Novi, MI  
Tel: 248-848-4000

**Houston, TX**

Tel: 281-894-5983

**Indianapolis**

Noblesville, IN  
Tel: 317-773-8323  
Fax: 317-773-5453  
Tel: 317-536-2380

**Los Angeles**

Mission Viejo, CA  
Tel: 949-462-9523  
Fax: 949-462-9608  
Tel: 951-273-7800

**Raleigh, NC**

Tel: 919-844-7510

**New York, NY**

Tel: 631-435-6000

**San Jose, CA**

Tel: 408-735-9110  
Tel: 408-436-4270

**Canada - Toronto**

Tel: 905-695-1980  
Fax: 905-695-2078

### ASIA/PACIFIC

**Australia - Sydney**  
Tel: 61-2-9868-6733  
**China - Beijing**  
Tel: 86-10-8569-7000  
**China - Chengdu**  
Tel: 86-28-8665-5511  
**China - Chongqing**  
Tel: 86-23-8980-9588  
**China - Dongguan**  
Tel: 86-769-8702-9880  
**China - Guangzhou**  
Tel: 86-20-8755-8029  
**China - Hangzhou**  
Tel: 86-571-8792-8115  
**China - Hong Kong SAR**  
Tel: 852-2943-5100  
**China - Nanjing**  
Tel: 86-25-8473-2460  
**China - Qingdao**  
Tel: 86-532-8502-7355  
**China - Shanghai**  
Tel: 86-21-3326-8000  
**China - Shenyang**  
Tel: 86-24-2334-2829  
**China - Shenzhen**  
Tel: 86-755-8864-2200  
**China - Suzhou**  
Tel: 86-186-6233-1526  
**China - Wuhan**  
Tel: 86-27-5980-5300  
**China - Xian**  
Tel: 86-29-8833-7252  
**China - Xiamen**  
Tel: 86-592-2388138  
**China - Zhuhai**  
Tel: 86-756-3210040

### ASIA/PACIFIC

**India - Bangalore**  
Tel: 91-80-3090-4444  
**India - New Delhi**  
Tel: 91-11-4160-8631  
**India - Pune**  
Tel: 91-20-4121-0141  
**Japan - Osaka**  
Tel: 81-6-6152-7160  
**Japan - Tokyo**  
Tel: 81-3-6880- 3770  
**Korea - Daegu**  
Tel: 82-53-744-4301  
**Korea - Seoul**  
Tel: 82-2-554-7200  
**Malaysia - Kuala Lumpur**  
Tel: 60-3-7651-7906  
**Malaysia - Penang**  
Tel: 60-4-227-8870  
**Philippines - Manila**  
Tel: 63-2-634-9065  
**Singapore**  
Tel: 65-6334-8870  
**Taiwan - Hsin Chu**  
Tel: 886-3-577-8366  
**Taiwan - Kaohsiung**  
Tel: 886-7-213-7830  
**Taiwan - Taipei**  
Tel: 886-2-2508-8600  
**Thailand - Bangkok**  
Tel: 66-2-694-1351  
**Vietnam - Ho Chi Minh**  
Tel: 84-28-5448-2100

### EUROPE

**Austria - Wels**  
Tel: 43-7242-2244-39  
Fax: 43-7242-2244-393  
**Denmark - Copenhagen**  
Tel: 45-4485-5910  
Fax: 45-4485-2829  
**Finland - Espoo**  
Tel: 358-9-4520-820  
**France - Paris**  
Tel: 33-1-69-53-63-20  
Fax: 33-1-69-30-90-79  
**Germany - Garching**  
Tel: 49-8931-9700  
**Germany - Haan**  
Tel: 49-2129-3766400  
**Germany - Heilbronn**  
Tel: 49-7131-72400  
**Germany - Karlsruhe**  
Tel: 49-721-625370  
**Germany - Munich**  
Tel: 49-89-627-144-0  
Fax: 49-89-627-144-44  
**Germany - Rosenheim**  
Tel: 49-8031-354-560  
**Israel - Ra'anana**  
Tel: 972-9-744-7705  
**Italy - Milan**  
Tel: 39-0331-742611  
Fax: 39-0331-466781  
**Italy - Padova**  
Tel: 39-049-7625286  
**Netherlands - Drunen**  
Tel: 31-416-690399  
Fax: 31-416-690340  
**Norway - Trondheim**  
Tel: 47-7288-4388  
**Poland - Warsaw**  
Tel: 48-22-3325737  
**Romania - Bucharest**  
Tel: 40-21-407-87-50  
**Spain - Madrid**  
Tel: 34-91-708-08-90  
Fax: 34-91-708-08-91  
**Sweden - Gothenberg**  
Tel: 46-31-704-60-40  
**Sweden - Stockholm**  
Tel: 46-8-5090-4654  
**UK - Wokingham**  
Tel: 44-118-921-5800  
Fax: 44-118-921-5820