



TN_120 FT232R Errata Technical Note

Document Reference No.: FT_000255

Version 1.0

Issue Date: 2010-11-05

The intention of this errata technical note is to give a detailed description of any known functional or electrical issues with the FTDI FT232R devices.

The current revision of the FT232R is **revision B, released May 2007**. At the time of releasing this Technical Note there are no known issues with this silicon revision.

Future Technology Devices International Limited (FTDI)

Unit1, 2 Seaward Place, Centurion Business Park, Glasgow G41 1HH United Kingdom

Tel.: +44 (0) 141 429 2777 Fax: + 44 (0) 141 429 2758

E-Mail (Support): support1@ftdichip.com Web: <http://www.ftdichip.com>

Copyright © 2010 Future Technology Devices International Limited

TABLE OF CONTENTS

1	FT232R Revision.....	2
2	Errata History Table – Functional Problems.....	3
2.1	Errata History Table – Electrical and Timing Specification Deviations.	3
3	Functional Problems of FT232R	4
3.1	Revision A.....	4
3.1.1	PWREN# pulses during enumeration.....	4
3.1.2	BitBang Mode variable Pulse Width	4
3.1	Revision B.....	5
4	Electrical and Timing specification deviations of FT232R	6
4.1	Revision A.....	6
4.1.1	VCCIO cannot be set below 2.6V	6
4.1	Revision B.....	6
5	FT232R Package Markings.....	7
6	Contact Information.....	8
	Appendix C – Revision History.....	10

1 FT232R Revision

FT232R part numbers are listed in **Table 1**. The letter at the end of date code identifies the device revision.

The current revision of the FT232R is **revision B, released May 2007**. At the time of releasing this Technical Note there are no known issues with this silicon revision.

Part Number	Package
FT232RL	28 Pin SSOP
FT232RQ	32 Pin QFN

Table 1 FT232R Part Numbers

This errata technical note covers the revisions of FT232 listed in **Table 2**.

Revision	Notes
A	First device revision
B	Second Device revision

Table 2 FT232R Revisions

2 Errata History Table – Functional Problems

Functional Problem	Short description	Errata occurs in device revision
FT232R	PWREN# signal will not be stable during enumeration – 3 pulses.	A

2.1 Errata History Table – Electrical and Timming Specification Deviations.

Deviations	Short description	Errata occurs in device revision
FT232R	Cannot set VCCIO below 2.6V due to internal RESET# pullup	A

3 Functional Problems of FT232R

3.1 Revision A

3.1.1 PWREN# pulses during enumeration

Introduction:

PWREN# is an output to signal if the device is enumerated and awake (logic 0) or if it is in reset/suspend (logic 1)

Problem:

During enumeration the pins were configured as outputs and as a consequence of the 3 resets required during enumeration the device toggled 3 times giving a false indication that the device was ready to use.

Workaround:

There are no known workarounds available. This issue is corrected at silicon revision B.

Package specific:

The effected packages are listed in **Table 3**.

Package	Applicable (Yes/No)
FT232RL	Y
FT232RQ	Y

Table 3

3.1.2 BitBang Mode variable Pulse Width

Introduction:

BitBang is a mode the device may be put into to allow free running data to be clocked in/out of the device without any control bits.

Problem:

The output may be clocked out at different speeds to allow for different pulse widths. However this clocking stage is not synchronized with the incoming data and can result in the pulse widths varying unexpectedly on the output.

Workaround:

Set the clock divisor to 1 (baud rate = 3,000,000) and pad the data field with extra 1's or 0's to achieve the required pulse width for each bit.

Package specific:

The effected packages are listed in Table 4

Package	Applicable (Yes/No)
FT232RL	Y
FT232RQ	Y

Table 4

3.1 Revision B

There are no known new functional issues specific to revision B.

4 Electrical and Timing specification deviations of FT232R

4.1 Revision A

4.1.1 VCCIO cannot be set below 2.6V

Introduction:

The FT232R device is specified to handle IO down to 1.8V.

Problem:

The FT232R device contains an internal pullup (200k) on RESET#. This is wired to VCCIO and not VCC. If VCCIO is below 2.6V the device will not come out of reset.

Workaround:

There are no known workarounds available. This issue is corrected at silicon revision B.

Package specific:

The effected packages are listed in Table 5.

Package	Applicable (Yes/No)
FT232RL	Y
FT232RQ	Y

Table 5

4.1 Revision B

There are no known functional problems with revision B.

5 FT232R Package Markings

FT232R is available in two RoHS Compliant packages, 32 pin QFN and 28 pin SSOP. An example of the markings on each package is shown in

Figure 5-1..

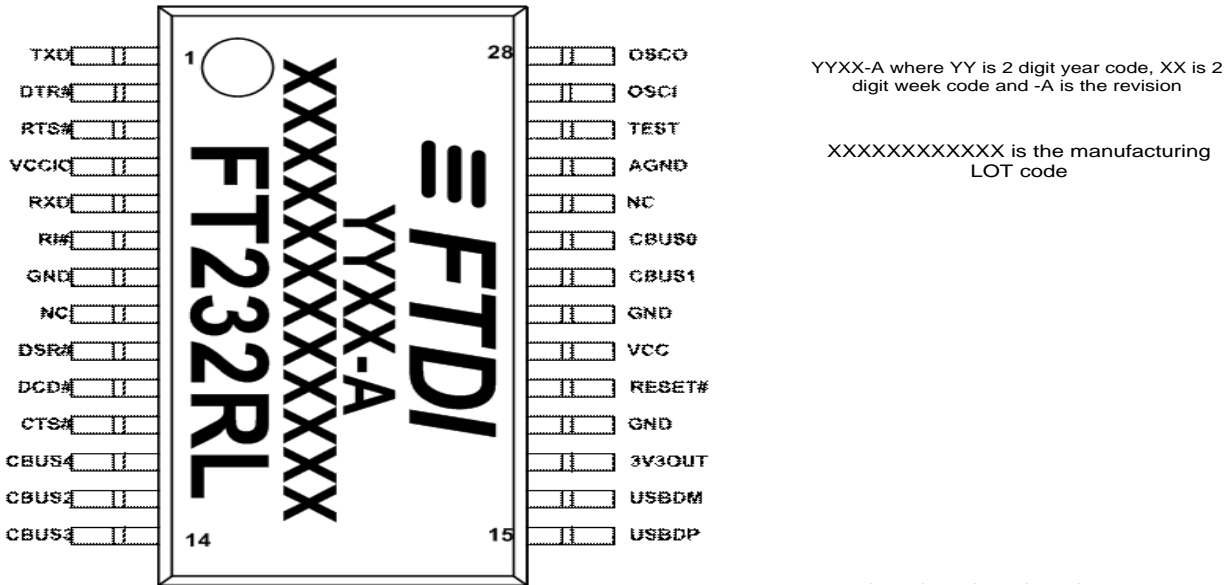


Figure 5-1 Package Markings – 28 SSOP

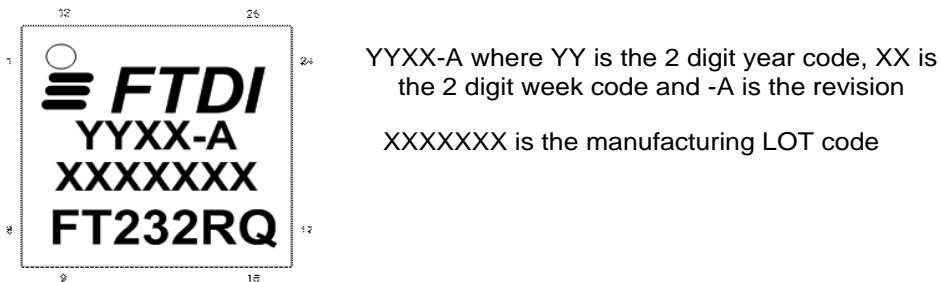


Figure 5-2 Markings – 32 QFN

6 Contact Information

Head Office – Glasgow, UK

Future Technology Devices International Limited
Unit 1, 2 Seaward Place, Centurion Business Park
Glasgow G41 1HH
United Kingdom

Tel: +44 (0) 141 429 2777
Fax: +44 (0) 141 429 2758

E-mail (Sales) sales1@ftdichip.com
E-mail (Support) support1@ftdichip.com
E-mail (General Enquiries) admin1@ftdichip.com
Web Site URL <http://www.ftdichip.com>
Web Shop URL <http://www.ftdichip.com>

Branch Office – Taipei, Taiwan

Future Technology Devices International Limited (Taiwan)
2F, No 516, Sec. 1 NeiHu Road
Taipei 114
Taiwan, R.O.C.
Tel: +886 (0) 2 8797 1330
Fax: +886 (0) 2 8751 9737

E-mail (Sales) tw.sales1@ftdichip.com
E-mail (Support) tw.support1@ftdichip.com
E-mail (General Enquiries) tw.admin1@ftdichip.com
Web Site URL <http://www.ftdichip.com>

Branch Office – Hillsboro, Oregon, USA

Future Technology Devices International Limited (USA)
7235 NW Evergreen Parkway, Suite 600
Hillsboro, OR 97123-5803
USA
Tel: +1 (503) 547 0988
Fax: +1 (503) 547 0987

E-Mail (Sales) us.sales@ftdichip.com
E-Mail (Support) us.support@ftdichip.com
E-Mail (General Enquiries) us.admin@ftdichip.com
Web Site URL <http://www.ftdichip.com>

Branch Office – Shanghai, China

Future Technology Devices International Limited (China)
Room 408, 317 Xianxia Road,
ChangNing District,
ShangHai, China

Tel: +86 (21) 62351596
Fax: +86(21) 62351595

E-Mail (Sales): cn.sales@ftdichip.com
E-Mail (Support): cn.support@ftdichip.com
E-Mail (General Enquiries): cn.admin1@ftdichip.com
Web Site URL: <http://www.ftdichip.com>

Distributor and Sales Representatives

Please visit the Sales Network page of the FTDI Web site for the contact details of our distributor(s) and sales representative(s) in your country.

Neither the whole nor any part of the information contained in, or the product described in this manual, may be adapted or reproduced in any material or electronic form without the prior written consent of the copyright holder. This product and its documentation are supplied on an as-is basis and no warranty as to their suitability for any particular purpose is either made or implied. Future Technology Devices International Ltd will not accept any claim for damages howsoever arising as a result of use or failure of this product. Your statutory rights are not affected. This product or any variant of it is not intended for use in any medical appliance, device or system in which the failure of the product might reasonably be expected to result in personal injury. This document provides preliminary information that may be subject to change without notice. No freedom to use patents or other intellectual property rights is implied by the publication of this document. Future Technology Devices International Ltd, Unit 1, 2 Seaward Place, Centurion Business Park, Glasgow G41 1HH United Kingdom. Scotland Registered Number: SC136640

Appendix C – Revision History

Version 1.0 First Release

05/11/2010

Mouser Electronics

Authorized Distributor

Click to View Pricing, Inventory, Delivery & Lifecycle Information:

[FTDI:](#)

[UB232R](#) [USB-RS485-WE-1800-BT](#) [FT232RL-REEL](#) [FT232RQ-REEL](#) [FT232BL-REEL](#) [FT232BQ-REEL](#) [TTL-232R-3V3-WE](#)