


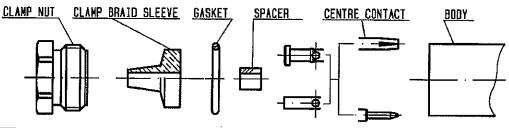


R161.321.000



1

Slide clamp nut onto cable . Strip the cable . Cut the jacket (2 slots)

 appart if necessary .



Stripping	а	b	С	d	8
inch	0.157	0.079	0.315	0.079	0.157
MM	4	2	8	2	4

 
2

Slide the clamp braid sleeve between cable dielectric and braid .

Cut the braid flush with the clamp braid sleeve .

Slide the spacer .

_




3

Solder the cable inner conductor into centre contact .

Slide the back nut over the clamp assembly .

 
_



4

Mount the gasket into the connector . Screw sub-assembly into the connector

(recommended coupling torque 13.27 in.1b)

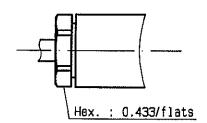

The information given here is subject to change without notice. Design changes may be in order to improve the product.

Mouser Electronics

Authorized Distributor

Click to View Pricing, Inventory, Delivery & Lifecycle Information:

Radiall:

R161321000 R161321000W