



Assembly Instructions

1) Strip the cable to the dimensions shown. Take care not to nick the centre conductor or braid.
Twist center conductor clockwise before inserting into connector.


A = 11.0mm
B = 6.0mm
C = 5.0mm

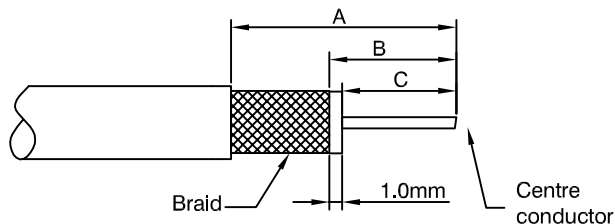


2) Twist the braid in a clockwise direction so that a minimum of 1.0mm dielectric is shown. Make sure to avoid loose or stray strands that could cause short circuits.

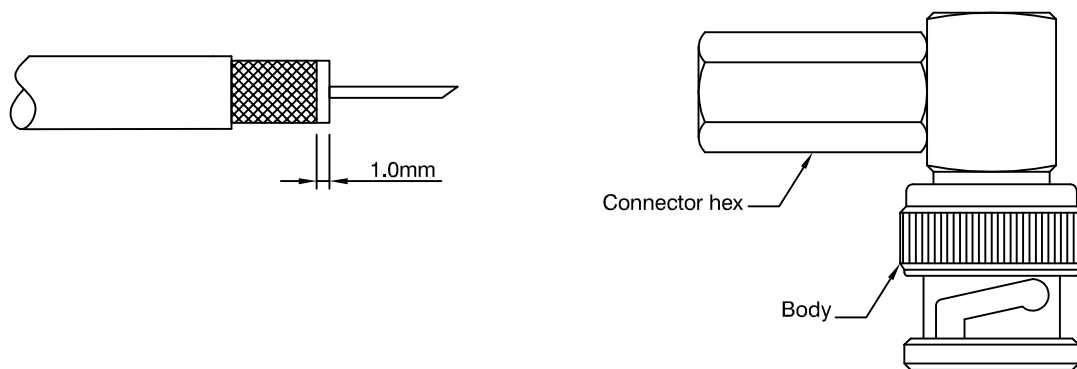

3) Insert the centre conductor into the guide hole in the rear insulator of the connector.

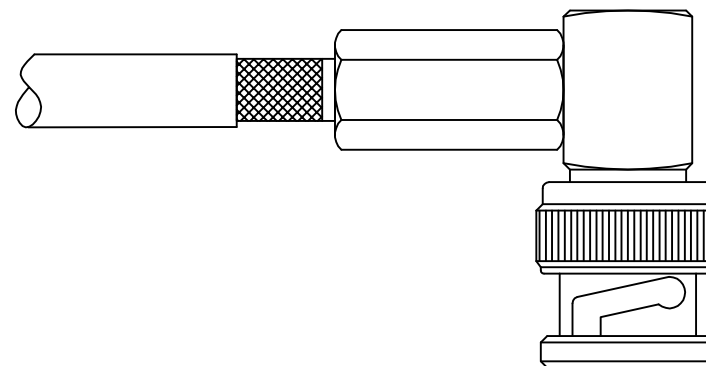

4) Firmly push the cable as far forward as possible and screw the connector hex back end onto the cable in a clockwise direction until it stops.

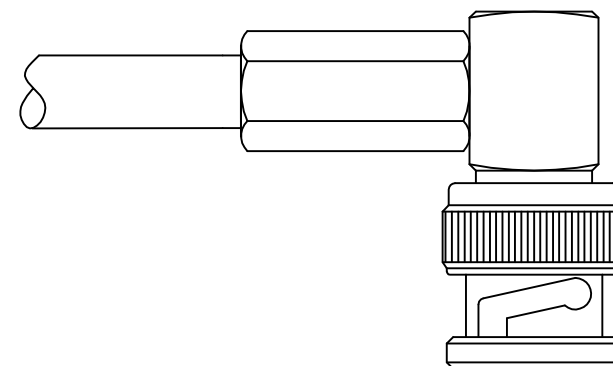

CAD Issue	SN	2	01 Nov 01
First Issue	CBB	1	23 Jan 98
DESCRIPTION OF REVISION	APPVD	ISS	DATE



Cinch Connectivity Solutions, Ltd
11 Bilton Road
Chelmsford
Essex CM1 2UP, England
T: +44 (0) 1245 342060
F: +44 124 535 8938

SCALE: Not To Scale

DIMENSIONS: mm

TOLERANCES:

DRAWN BY:

S Nash

CHECKED BY:

P Couzens

APPROVED BY:

M Nielsen

DATE:

01 Nov 01

DESCRIPTION:

Stripping and Assembly
Instructions for BNC Twist On
Right angle Plug

DRAWING NUMBER:

VAIB2301

PAGE: 1 OF 1

Mouser Electronics

Authorized Distributor

Click to View Pricing, Inventory, Delivery & Lifecycle Information:

[Cinch Connectivity Solutions:](#)

[TOBNC20-58](#)