
## **Assembly Instructions**

1) Slide the ferrule onto the cable. Strip the cable to the dimensions shown. Take care not to nick the centre conductor or braid.


A = 8mm

B = 6.5 mm


C = 3mm

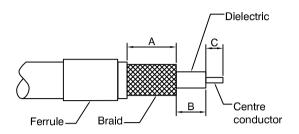

2) Crimp the contact onto the centre conductor.

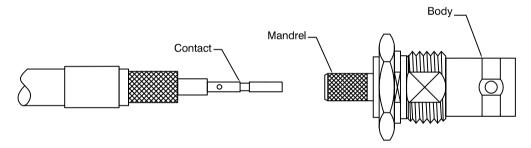

3) Insert the contact into the body and ensure that the contact captivates. Make sure that the braid is on the outside of the mandrel. Slide the ferrule over the braid until the ferrule butts up against the body. Crimp the ferrule using the correct tool for the connector.

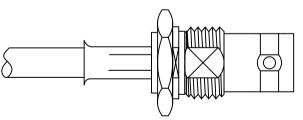

CAD Issue	PDC	2	08 Aug 01
First Issue	AT	1	21 July 00
DESCRIPTION OF REVISION	APPVD	ISS	DATE

Titel eas	Cinch Connectivity Solutions, Ltd 11 Bilton Road	
VIIELEC	Chelmsford	
ELECTRONICS	Essex CM1 2UP, England	
	T: +44 (0) 1245 342060	
	F: +44 124 535 8938	

SCALE: Not To Scale	DRAWN BY:	P D Couzens
DIMENSIONS: mm	CHECKED BY:	S Nash
TOLERANCES:	APPROVED BY:	P D Couzens
	DATE:	08 Aug 02

DESCRIPTION:

Stripping and Assembly Instructions for BNC Crimp Bulkhead Jack

Connector

**Part Number** 

VB40-2075

VB40-2077

DRAWING NUMBER:

Crimp Tool

Part Number

DCC1113

DCC0908

Stripping Tool

**Part Number** 

N/A

N/A

Hex Size

Pin

1.72

1.69

Ferrule

5.41

4.52

**VAIB4102** 

PAGE: 1 OF 1

## **Mouser Electronics**

**Authorized Distributor** 

Click to View Pricing, Inventory, Delivery & Lifecycle Information:

Cinch Connectivity Solutions: VB40-2077