
Assembly Instructions

1) Slide the ferrule onto the cable. Strip the cable to the dimensions shown. Take care not to nick the centre conductor or braid.

 
A = 7.5mm


B = 5mm

C = 4mm

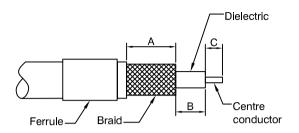


2) Crimp the contact onto the centre conductor.



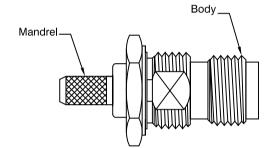

3) Insert the contact into the body and ensure that the contact captivates. Make sure that the braid is on the outside of the mandrel. Slide the ferrule over the braid until the ferrule butts up against the body. Crimp the ferrule using the correct tool for the connector.

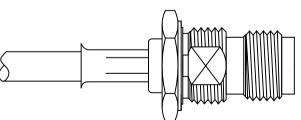

Cinch Connectivity Solutions, Ltd

Essex CM1 2UP, England T: +44 (0) 1245 342060

F: +44 124 535 8938

11 Bilton Road

SCALE: Not To Scale	DRAWN BY:	S Nash	
DIMENSIONS: mm	CHECKED BY:	P Couzens	
TOLERANCES:	APPROVED BY:	M Nielsen	
	DATE:	26 Oct 01	

Connector	Stripping Tool	Crimp Tool	Hex	Hex Size	
Part Number	Part Number	Part Number	Pin	Ferrule	
VT40-2031	VX1305	DCC1113	1.72	6.48	
VT40-2050	VX1305	DCC1113	1.72	5.41	
VT40-2051	VX1305	DCC1113	1.72	5.41	
VT40-2061	VX1305	DCC0908	1.69	4.52	
VT40-2071	VX1305	DCC0908	1.69	4.52	

First Issue	SN	1	26 Oct 01
DESCRIPTION OF REVISION	APPVD	ISS	DATE

DESCRIPTION:

Stripping and Assembly Instructions for TNC crimp bulkhead jack DRAWING NUMBER:

VAIT4101

PAGE: 1 OF 1

© 2017 Cinch Connectivity Solutions, Ltd.

THIS DRAWING MAY NOT BE REPRODUCED IN WHOLE OR IN PART WITHOUT OUR WRITTEN PERMISSION

Mouser Electronics

Authorized Distributor

Click to View Pricing, Inventory, Delivery & Lifecycle Information:

Cinch Connectivity Solutions: VT40-2061