






Notes

2:UL(File no.E52653)
C-UL(File no.E52653)





3:PER PACK:100PIECES

Part No.	Code No.	Number of contact	A	B	C
DF22A-2P-7.92DS(53)	CL680-1018-9-53	2	19.80	15.00	7.92
DF22A-3P-7.92DS(53)	CL680-1019-1-53	3	27.72	22.92	15.84
DF22A-4P-7.92DS(53)	CL680-1020-0-53	4	35.64	30.84	23.76
DF22A-5P-7.92DS(53)	CL680-1021-3-53	5	43.56	38.76	31.68

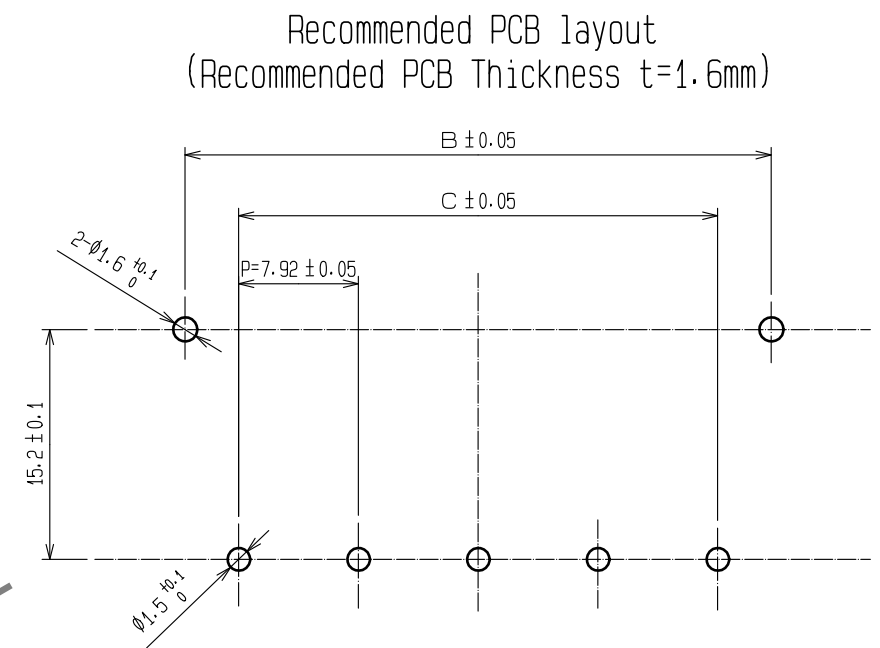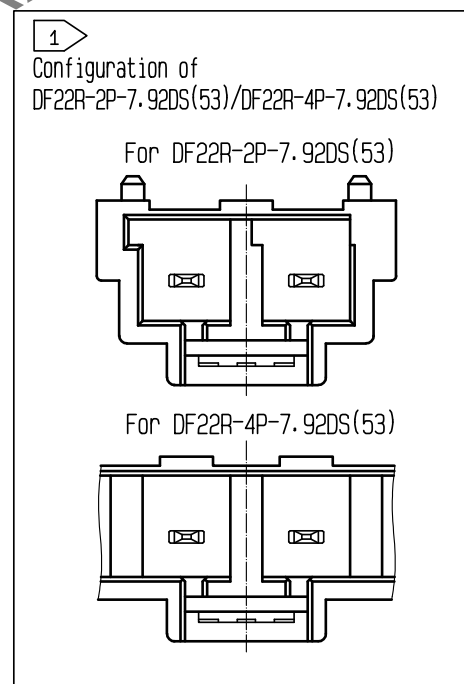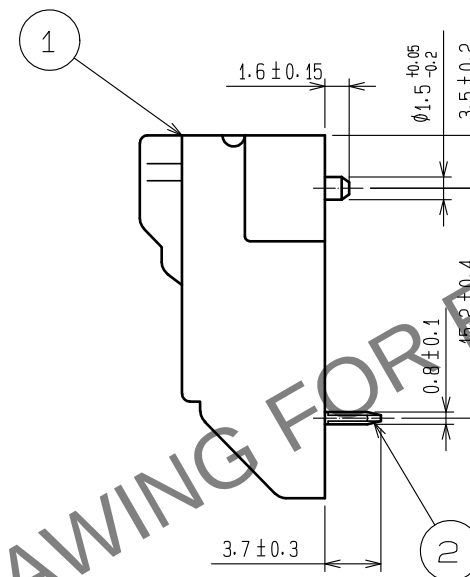

Application diagram

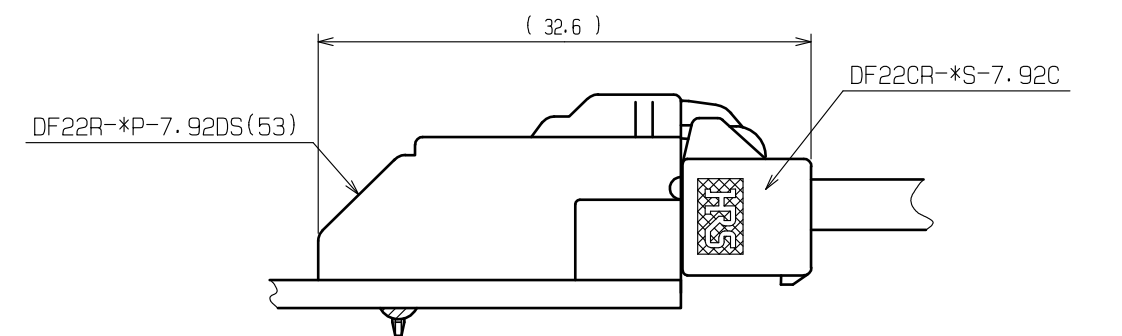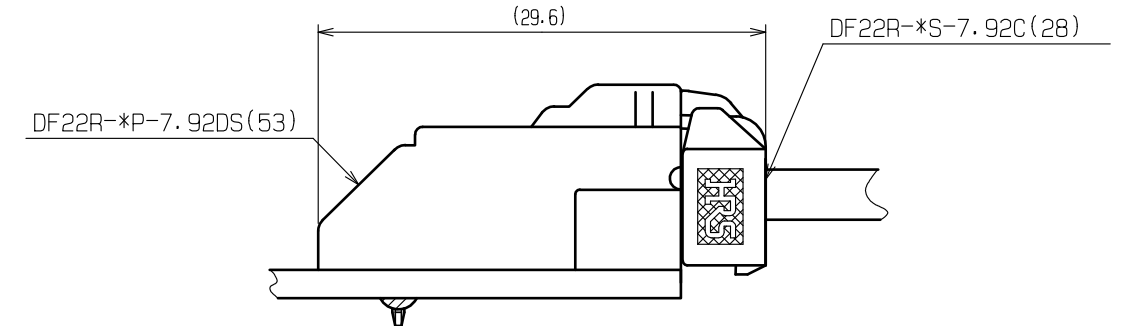

				2		Copper alloy		Contact area:Gold plating 0.2#m min Lead area:Tin plating 1#m min Under plating:Nickel plated 1#m min Other:Nickel plating 1#m min			
1	Polyamide		BLACK, UL94V-0								
NO.	MATERIAL		FINISH , REMARKS			NO.	MATERIAL		FINISH , REMARKS		
UNITS mm		SCALE 2 : 1		COUNT	DESCRIPTION OF REVISIONS		DESIGNED		CHECKED	DATE	
 HIROSE ELECTRIC CO., LTD.		APPROVED	• HS. OKAWA	20200309	DRAWING NO.	EDC-306228-53-00					
		CHECKED	• SZ. ONO	20200309	PART NO.	DF22R- *P-7. 92DS(53)					
		DESIGNED	• SN. MIWA	20200309	CODE NO.	CL680-					
		DRAWN	• DS. HIROWATARI	20200306							


May.1.2024 Copyright 2024 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.

▣Precautions


◆Notification for Insertion Extraction

- 1) Please insert(extract) the crimping socket straight to the mating connector.
Insertion(extraction) at tilted angles applies load concentration to the connetor end and may cause deformation (at connection area, socket and header case, etc). There is firing risk using this kind of defomed connector.


Insertion(Extraction)

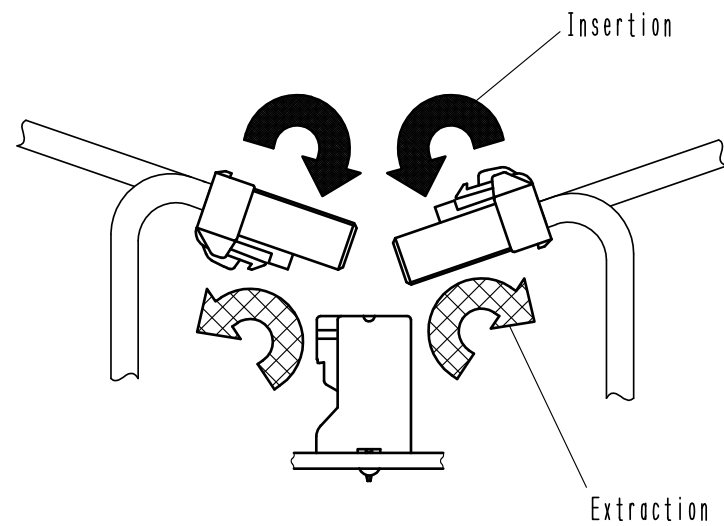

NG

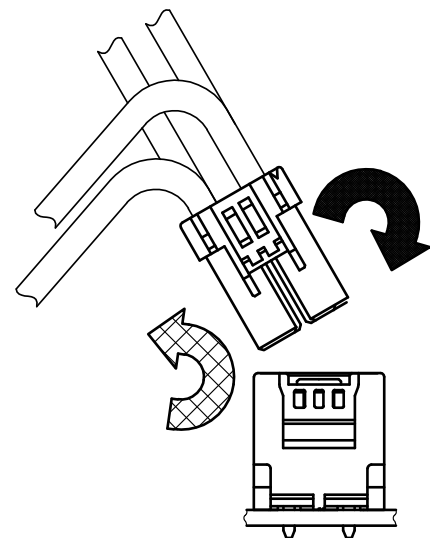

NG

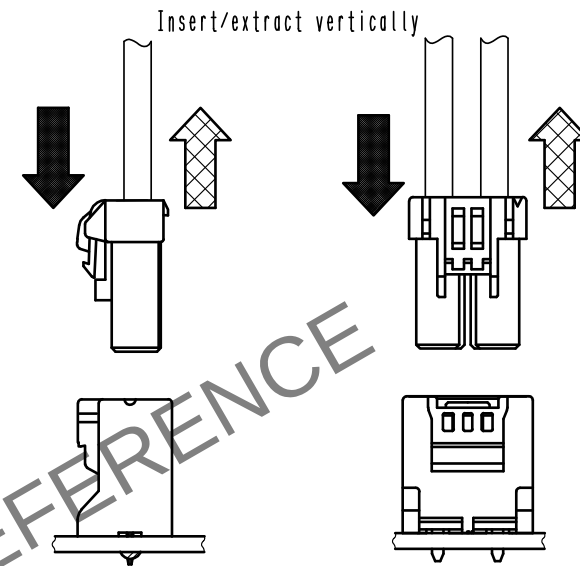


OK


- 2) When it is hard to extract, please lightly insert the connector beforehand and then pull it with releasing the lock.
Forced extraction has a risk of connector breakage.

◆Notification of wiring

- 1) When using a thick cable, short cable length and bending close to the connector end, these load concentration may cause deformation.
Please note that there is firing risk using deformed connector.
When installing, please refrain from stress concentration such as cable bending close to the connector end or cable twisting.

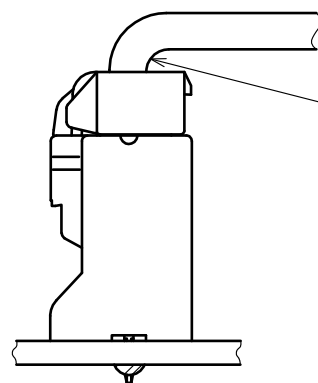

NG

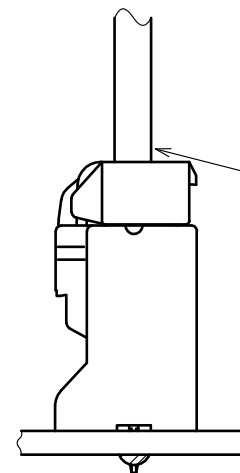

OK

- 2) Since this product uses thick wires, a larger load is applied to the connector when inserting/extracting or routing the wires.
Please use a retainer to reduce the load on the connector.

HR5

DRAWING NO.	EDC-306228-53-00
PART NO.	DF22R-*P-7.92DS(53)
CODE NO.	CL680-

2/2

Mouser Electronics

Authorized Distributor

Click to View Pricing, Inventory, Delivery & Lifecycle Information:

[Hirose Electric:](#)

[DF22R-2P-7.92DS\(53\)](#)