

# ABP2 SERIES

32350268

Issue C

## Board Mount Pressure Sensors

### High Accuracy, Compensated/Amplified

±6 mbar to ±12 bar | ±600 Pa to ±1.2 MPa | ±2 inH<sub>2</sub>O to ±175 psi  
Digital Output, Liquid Media Capable

#### DESCRIPTION

The ABP2 Series are piezoresistive silicon pressure sensors offering a digital output for reading pressure over the specified full scale pressure span and temperature range. They are calibrated and temperature compensated for sensor offset, sensitivity, temperature effects and accuracy errors (which include non-linearity, repeatability and hysteresis) using an on-board Application Specific Integrated Circuit (ASIC). Calibrated output values for pressure and temperature are updated at approximately 200 Hz. All products are designed and manufactured according to ISO 9001 standards. The liquid media option includes an additional gel coating to protect the electronics under port P1, which enables use with non-corrosive liquids (e.g. water and saline) and in applications where condensation can occur. The ABP2 Series is available in tube packaging, Pocket tape and reel packaging is available upon request.

#### VALUE TO CUSTOMERS

- Simplifies design-in: Small size saves room on the PC board (PCB), simplifying design in smaller and lower power devices. Meets IPC/JEDEC J-STD-020E Moisture Sensitivity Level 1 requirements:
  - Allows avoidance of thermal and mechanical damage during solder reflow attachment and/or repair that lesser rated sensors may incur.
  - Allows for unlimited shelf life when stored at <30°C/85 %RH (simplifying storage and reducing scrap).
  - Eliminates lengthy bakes prior to reflow.
  - Allows for lean manufacturing due to stability and usability shortly after reflow.
- Cost-effective: Small size helps engineers reduce design and manufacturing costs while maintaining enhanced performance and reliability of the systems they design.
- Accurate: Total Error Band (TEB) and wide pressure range enable engineers to optimize system performance by improving resolution and system accuracy.


- Flexible: Supply voltage range, variety of pressure units, types and ranges, output options, and wide operating temperature range simplify use in the application
- Versatile: Wet-media compatibility, low power, and temperature output options make the sensor a versatile choice for Internet of Things applications

#### DIFFERENTIATION

- Application-specific design ensures suitability for a wide array of customer requirements.
- Digital output allows the sensor to be directly plugged into the customer's circuitry without requiring major design changes
- Total Error Band (see Figure 1):
  - Provides a more comprehensive measurement of performance over the compensated temperature range, which minimizes testing and calibrating every sensor, thereby potentially reducing manufacturing cost; improves sensor accuracy and offers ease of sensor interchangeability due to minimal part-to-part variation.
  - Improves sensor accuracy
  - Offers ease of sensor interchangeability due to minimal part-to-part variation

#### POTENTIAL APPLICATIONS

- **Medical:** Ventilators/portable ventilators, CPAP, blood analysis, blood pressure monitoring, breast pumps, drug dosing, hospital beds, massage machines, oxygen concentrators, patient monitoring, sleep apnea equipment, urine analyzers and wound therapy
- **Industrial:** HVAC transmitters, life sciences, material handling, pneumatic control and regulation, process gas monitoring and valve positioning/positioners
- **Commercial:** Air beds, coffee makers, washing machines, level measurement, dish washers, vacuum cleaners, hand dryers and rice cookers
- **Transportation:** Air brakes, CNG monitoring, fork lifts and fuel level measurement

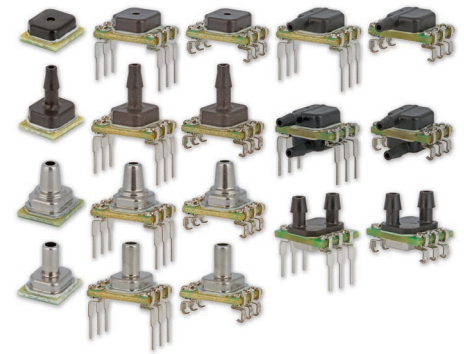

#### FEATURES

- Total Error Band (see Figure 1): As low as ±1.5 %FSS
- Liquid media option: Compatible with a variety of liquid media
- Long-term stability: as low as ±0.2 %FSS
- Accuracy: ±0.25 %FSS BFLS
- Wide pressure range: ±6 mbar to ±12 bar | ±600 Pa to ±1.2 MPa | ±2 inH<sub>2</sub>O to ±175 psi
- High burst pressures
- Wide operating temperature range of -40°C to 110°C [-40°F to 230°F]
- Calibrated over wide temperature range of -40°C to 110°C [-40°F to 230°F]
- 24-bit digital I<sup>2</sup>C or SPI-compatible output
- IoT (Internet of Things) ready interface
- Ultra-low power consumption (as low as 0.01 mW typ. average power, 1 Hz measurement frequency)
- Meets IPC/JEDEC J-STD-020E Moisture Sensitivity Level 1
- REACH and RoHS compliant
- Food grade compatible
- Temperature output available
- NSF-169, LFGB and BPA compliant materials



Honeywell offers a variety of board mount pressure sensors for use in potential medical and industrial applications. To view the entire product portfolio, [click here](#).

**Honeywell**

# BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES

## TABLE OF CONTENTS

|                                                                         |                   |
|-------------------------------------------------------------------------|-------------------|
| <b>TOTAL ERROR BAND</b>                                                 | <b>3</b>          |
| <b>GENERAL SPECIFICATIONS</b>                                           | <b>3-5</b>        |
| <b>POWER CONSUMPTION AND STANDBY MODE</b>                               | <b>6-7</b>        |
| <b>NOMENCLATURE AND ORDER GUIDE</b>                                     | <b>8-10</b>       |
| <b>PRESSURE RANGE SPECIFICATIONS</b>                                    | <b>11-16</b>      |
| <b>DIMENSIONAL DRAWINGS</b>                                             | <b>17-23</b>      |
| <b>1.0 GENERAL INFORMATION</b>                                          | <b>24</b>         |
| <b>2.0 PINOUT AND FUNCTIONALITY</b>                                     | <b>24</b>         |
| <b>3.0 START-UP TIMING</b>                                              | <b>24</b>         |
| <b>4.0 POWER SUPPLY REQUIREMENT</b>                                     | <b>24</b>         |
| <b>5.0 REFERENCE CIRCUIT DESIGN</b>                                     |                   |
| 5.1 I <sup>2</sup> C and SPI Circuit Diagrams                           | 25                |
| 5.2 Bypass Capacitor Use                                                | 25                |
| <b>6.0 I<sup>2</sup>C COMMUNICATIONS</b>                                | <b>26</b>         |
| 6.1 I <sup>2</sup> C Bus Configuration                                  | 26                |
| 6.2 I <sup>2</sup> C Data Transfer                                      | 26                |
| 6.3 I <sup>2</sup> C Sensor Address                                     | 26                |
| 6.4 I <sup>2</sup> C Pressure and Temperature Reading                   | 26                |
| 6.5 I <sup>2</sup> C Status Byte                                        | 27                |
| 6.6 I <sup>2</sup> C Communications                                     | 27                |
| 6.6.1 Output Measurement Command                                        | 27                |
| 6.6.2 I <sup>2</sup> C Sensor Address of 0x28                           | 28                |
| 6.7 I <sup>2</sup> C Timing and Level Parameters                        | 28                |
| 6.8 Reference Code (Arduino/Genuino Uno) for I <sup>2</sup> C Interface | 29                |
| <b>7.0 SPI COMMUNICATIONS</b>                                           | <b>30</b>         |
| 7.1 SPI Definition                                                      | 30                |
| 7.2 SPI Data Transfer                                                   | 30                |
| 7.3 SPI Pressure and Temperature Reading                                | 30                |
| 7.4 SPI Status Byte                                                     | 31                |
| 7.5 SPI Communications                                                  | 31                |
| 7.6 SPI Timing and Level Parameters                                     | 32                |
| 7.7 Reference Code (Arduino/Genuino Uno) for SPI Interface              | 33                |
| <b>8.0 ABP2 SERIES CALCULATIONS</b>                                     | <b>34</b>         |
| 8.1 Pressure Output                                                     | 34                |
| 8.2 Temperature Output                                                  | 35                |
| <b>9.0 RECOMMENDED PNEUMATIC SENSOR CONNECTIONS</b>                     | <b>36</b>         |
| 9.1 Tubing                                                              | 36                |
| 9.2 O-ring Manifold Designs                                             | 37-38             |
| <b>ADDITIONAL INFORMATION</b>                                           | <b>back cover</b> |

BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES


TOTAL ERROR BAND

Total Error Band (TEB) is a single specification that includes the major sources of sensor error. TEB should not be confused with accuracy, which is actually a component of TEB. TEB is the worst error that the sensor could experience.

Honeywell uses the TEB specification in its datasheet because it is the most comprehensive measurement of a sensor's true accuracy. Honeywell also provides the accuracy specification in order to provide a common comparison with competitors' literature that does not use the TEB specification.

Many competitors do not use TEB—they simply specify the accuracy of their device. Their accuracy specification, however, may exclude certain parameters. On their datasheet, the errors are listed individually. When combined, the total error (or what would be TEB) could be significant.

FIGURE 1. TOTAL ERROR BAND

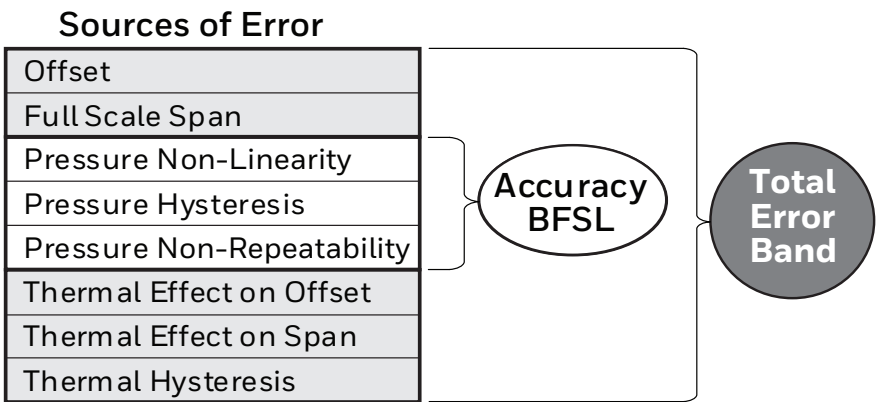

| TABLE 1. ABSOLUTE MAXIMUM SPECIFICATIONS <sup>1</sup> |                            |                           |         |
|-------------------------------------------------------|----------------------------|---------------------------|---------|
| CHARACTERISTIC                                        | MINIMUM                    | MAXIMUM                   | UNIT    |
| Supply voltage (V <sub>supply</sub> )                 | -0.3                       | 3.6                       | Vdc     |
| Voltage on any pin                                    | -0.3                       | V <sub>supply</sub> + 0.3 | Vdc     |
| Digital clock frequency:                              |                            |                           |         |
| I <sup>2</sup> C                                      | 100                        | 400                       | kHz     |
| SPI                                                   | 50                         | 800                       |         |
| ESD susceptibility (human body model)                 | 2                          | —                         | kV      |
| Storage temperature range                             | -40 [-40]                  | 125 [257]                 | °C [°F] |
| Soldering time and temperature:                       |                            |                           |         |
| lead (DIP)                                            | 4 s max. at 250°C [482°F]  |                           |         |
| peak reflow (SMT, Leadless SMT)                       | 15 s max. at 250°C [482°F] |                           |         |

<sup>1</sup>Absolute maximum ratings are the extreme limits the device will withstand without damage.

## BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES

**TABLE 2. OPERATING SPECIFICATIONS**

| CHARACTERISTIC                                      | MINIMUM   | TYPICAL | MAXIMUM   | UNIT                  |
|-----------------------------------------------------|-----------|---------|-----------|-----------------------|
| Supply voltage ( $V_{\text{supply}}$ ) <sup>1</sup> | 1.8       | 3.3     | 3.6       | Vdc                   |
| Current consumption:                                |           |         |           |                       |
| I <sup>2</sup> C sleep/standby mode                 | 3.0       | 33.8    | 211.0     | nA                    |
| SPI sleep/standby mode                              | 13.0      | 43.8    | 221.0     |                       |
| Power consumption                                   | —         | 3.1     | —         | mW                    |
| Operating temperature range <sup>2</sup>            | -40 [-40] | —       | 110 [230] | °C [°F]               |
| Compensated temperature range <sup>3</sup>          | -40 [-40] | —       | 110 [230] | °C [°F]               |
| Startup time (power up to data ready) <sup>4</sup>  | —         | 7.5     | —         | ms                    |
| Data rate (assumes command AA <sub>HEX</sub> )      | 161       | 204     | —         | samples/s             |
| SPI/I <sup>2</sup> C voltage level:                 |           |         |           |                       |
| low                                                 | —         | —       | 20        | % $V_{\text{supply}}$ |
| high                                                | 80        | —       | —         |                       |
| Pull up on SDA, SCL                                 | 1         | —       | —         | kOhm                  |
| Total Error Band <sup>5</sup> :                     |           |         |           |                       |
| 0°C to 50°C                                         | —         | —       | ±1.5      | %FSS <sup>6</sup>     |
| -20°C to 85°C                                       | —         | —       | ±3.0      | %FSS <sup>6</sup>     |
| -40°C to 110°C                                      | —         | —       | ±4.5      | %FSS <sup>6</sup>     |
| Accuracy <sup>7</sup>                               | —         | —       | ±0.25     | %FSS BFSL             |
| Resolution                                          | 14        | —       | —         | bits                  |
| Temperature output error <sup>8</sup>               | —         | ±5      | —         | °C                    |

<sup>1</sup>Sensors are not reverse polarity protected. Incorrect application of supply voltage or ground to the wrong pin may cause electrical failure.

<sup>2</sup>**Operating temperature range:** The temperature range over which the sensor will produce an output proportional to pressure.

<sup>3</sup>**Compensated temperature range:** The temperature range over which the sensor will produce an output proportional to pressure within the specified performance limits (see Total Error Band).

<sup>4</sup>**Startup time:** Based on 2.5 ms for power up to receive the first measurement command and average measurement time of 5 ms (data rate of 204 samples per second). Refer to Section 3.0, Tables 21, 22 and 25 for further details of communication timing.

<sup>5</sup>**Total Error Band:** The maximum deviation from the ideal transfer function over the entire compensated temperature and pressure range. Includes all errors due to offset, full scale span, pressure non-linearity, pressure hysteresis, repeatability, thermal effect on offset, thermal effect on span and thermal hysteresis.

<sup>6</sup>**Full Scale Span (FSS):** The algebraic difference between the output signal measured at the maximum (P<sub>max</sub>.) and minimum (P<sub>min</sub>.) limits of the pressure range (see Figure 2).

<sup>7</sup>**Accuracy:** The maximum deviation in output from a Best Fit Straight Line (BFSL) fitted to the output measured over the pressure range at 25°C [77°F]. Includes all errors due to pressure non-linearity, pressure hysteresis and non-repeatability.

<sup>8</sup>**Temperature Output Error:** The error in Temperature Output reading relative to a thermal reference standard over a temperature range of -40°C to 125°C.

**TABLE 3. ENVIRONMENTAL SPECIFICATIONS**

| CHARACTERISTIC                                           | PARAMETER                                                                                   |
|----------------------------------------------------------|---------------------------------------------------------------------------------------------|
| Humidity:                                                |                                                                                             |
| all external surfaces                                    | 0 %RH to 95 %RH, non-condensing                                                             |
| internal surfaces of liquid media option "T and G"       | 0 %RH to 100 %RH, condensing                                                                |
| internal surfaces of dry gases option "N"                | 0 %RH to 95 %RH, non-condensing                                                             |
| Vibration                                                | 15 g, 10 Hz to 2 kHz                                                                        |
| Shock                                                    | 75 g, 6 ms duration                                                                         |
| Life <sup>1</sup>                                        | 1 million full scale pressure cycles minimum                                                |
| Solder reflow                                            | J-STD-020-E Moisture Sensitivity Level 1 (unlimited shelf life when stored at ≤30°C/85 %RH) |
| Certification (silicone gel coating option, Port 1 only) | NSF169, BPA Free, LFGB                                                                      |

<sup>1</sup>Life may vary depending on specific application in which the sensor is utilized.

## BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES

**TABLE 4. WETTED MATERIALS<sup>1</sup>**

| COMPONENT             | PRESSURE PORT 1 (P1)                |                                         | PRESSURE PORT 2 (P2)       |
|-----------------------|-------------------------------------|-----------------------------------------|----------------------------|
|                       | DRY GAS OPTION                      | LIQUID MEDIA OPTION                     |                            |
| Ports and covers      | high temperature polyamide, 304 SST |                                         | high temperature polyamide |
| Substrate             | FR4                                 | —                                       | FR4                        |
| Adhesives             | epoxy, silicone                     | epoxy, silicone gel, fluorosilicone gel | epoxy, silicone            |
| Electronic components | silicon, glass, gold, aluminum      | —                                       | silicon                    |

<sup>1</sup> Contact Honeywell customer service for detailed material information.


**TABLE 5. SENSOR PRESSURE TYPES**

| PRESSURE TYPE | DESCRIPTION                                                                                           |
|---------------|-------------------------------------------------------------------------------------------------------|
| Absolute      | Output is proportional to the difference between pressure applied and a built-in vacuum reference.    |
| Differential  | Output is proportional to the difference between the applied pressure to each port (Port1 - Port2)    |
| Gage          | Output is proportional to the difference between applied pressure and atmospheric (ambient) pressure. |

**TABLE 6. SENSOR OUTPUT AT SIGNIFICANT PERCENTAGES**

| OUTPUT | DIGITAL COUNTS |          |
|--------|----------------|----------|
|        | DECIMAL        | HEX      |
| 0      | 0              | 0X000000 |
| 10     | 1677722        | 0X19999A |
| 30     | 5033165        | 0X4CCCCC |
| 50     | 8388608        | 0X800000 |
| 70     | 11744051       | 0XB33333 |
| 90     | 15099494       | 0XE66666 |
| 100    | 16777215       | 0XFFFFFF |

**FIGURE 2. TRANSFER FUNCTION LIMITS**

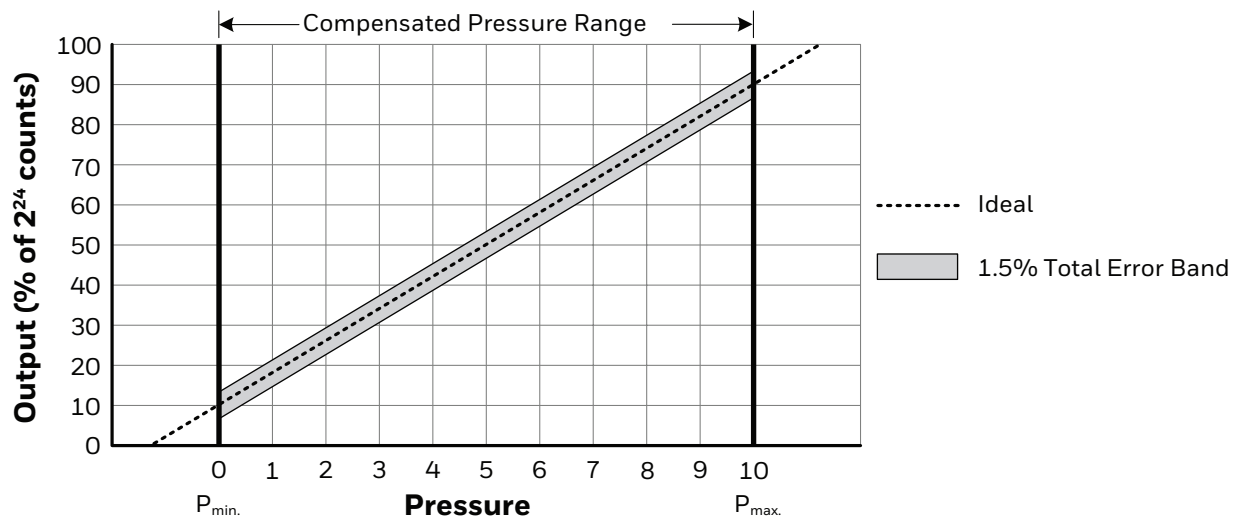

### Pressure example 1: Transfer Function A (10% to 90%)

$$\text{Output (\% of } 2^{24} \text{ counts)} = \frac{80\%}{P_{\text{max.}} - P_{\text{min.}}} \times (\text{Pressure}_{\text{applied}} - P_{\text{min.}}) + 10\%$$

### Pressure example 2: Transfer Function B (30% to 70%)

$$\text{Output (\% of } 2^{24} \text{ counts)} = \frac{40\%}{P_{\text{max.}} - P_{\text{min.}}} \times (\text{Pressure}_{\text{applied}} - P_{\text{min.}}) + 30\%$$

# BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES


## POWER CONSUMPTION AND STANDBY MODE

The sensor is normally in Standby Mode and is only turned on in response to a user command, thus minimizing power consumption. Upon receiving the user command, the sensor wakes up from Standby Mode, runs a measurement in Active State, and automatically returns to Standby Mode, awaiting the next command. The resulting sensor power consumption is a function of the sampling rate (samples per second) as shown in Tables 7 and 8 and Figures 3 and 4.

**TABLE 7. AVERAGE POWER CONSUMPTION AT 1.8 V<sub>SUPPLY</sub> (ASSUMES COMMAND AA<sub>HEX</sub>)**

| SAMPLING RATE<br>(samples per second) | AVERAGE POWER<br>(mW) | ACTIVE TIME<br>(ms) | ACTIVE POWER<br>(mW) | IDLE TIME<br>(ms) | IDLE POWER<br>(mW) |
|---------------------------------------|-----------------------|---------------------|----------------------|-------------------|--------------------|
| <b>Minimum Average Power</b>          |                       |                     |                      |                   |                    |
| 1                                     | 0.0068                | 3.625               | 1.884                | 996.375           | 0.0000054          |
| 2                                     | 0.0137                | 7.25                | 1.884                | 992.75            | 0.0000054          |
| 5                                     | 0.0341                | 18.125              | 1.884                | 981.875           | 0.0000054          |
| 10                                    | 0.0683                | 36.25               | 1.884                | 963.75            | 0.0000054          |
| 20                                    | 0.1366                | 72.5                | 1.884                | 927.5             | 0.0000054          |
| 50                                    | 0.3414                | 181.25              | 1.884                | 818.75            | 0.0000054          |
| 100                                   | 0.6829                | 362.5               | 1.884                | 637.5             | 0.0000054          |
| 160                                   | 1.0926                | 580                 | 1.884                | 420               | 0.0000054          |
| <b>Typical Average Power</b>          |                       |                     |                      |                   |                    |
| 1                                     | 0.0094                | 4.157               | 2.248                | 995.843           | 0.00006084         |
| 2                                     | 0.0187                | 8.314               | 2.248                | 991.686           | 0.00006084         |
| 5                                     | 0.0468                | 20.785              | 2.248                | 979.215           | 0.00006084         |
| 10                                    | 0.0935                | 41.57               | 2.248                | 958.43            | 0.00006084         |
| 20                                    | 0.1870                | 83.14               | 2.248                | 916.86            | 0.00006084         |
| 50                                    | 0.4673                | 207.85              | 2.248                | 792.15            | 0.00006084         |
| 100                                   | 0.9345                | 415.7               | 2.248                | 584.3             | 0.00006084         |
| 160                                   | 1.4592                | 665.12              | 2.248                | 334.88            | 0.00006084         |
| <b>Maximum Average Power</b>          |                       |                     |                      |                   |                    |
| 1                                     | 0.0129                | 4.839               | 2.588                | 995.161           | 0.0003798          |
| 2                                     | 0.0254                | 9.678               | 2.588                | 990.322           | 0.0003798          |
| 5                                     | 0.0630                | 24.195              | 2.588                | 975.805           | 0.0003798          |
| 10                                    | 0.1256                | 48.39               | 2.588                | 951.61            | 0.0003798          |
| 20                                    | 0.2508                | 96.78               | 2.588                | 903.22            | 0.0003798          |
| 50                                    | 0.6264                | 241.95              | 2.588                | 758.05            | 0.0003798          |
| 100                                   | 1.2524                | 483.9               | 2.588                | 516.1             | 0.0003798          |
| 160                                   | 2.0036                | 774.24              | 2.588                | 225.76            | 0.0003798          |

**FIGURE 3. AVERAGE POWER CONSUMPTION VS SAMPLING RATE AT 1.8 V<sub>SUPPLY</sub>**

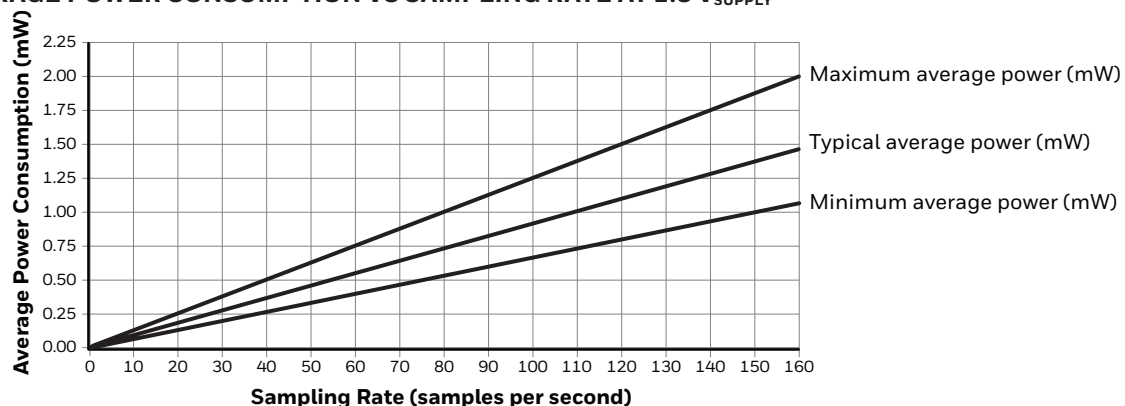


## BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES

**TABLE 8 . AVERAGE POWER CONSUMPTION AT 3.3 V<sub>SUPPLY</sub> (ASSUMES COMMAND AA<sub>HEX</sub>)**

| SAMPLING RATE<br>(samples per second) | AVERAGE POWER<br>(mW) | ACTIVE TIME<br>(ms) | ACTIVE POWER<br>(mW) | IDLE TIME<br>(ms) | IDLE POWER<br>(mW) |
|---------------------------------------|-----------------------|---------------------|----------------------|-------------------|--------------------|
| <b>Minimum Average Power</b>          |                       |                     |                      |                   |                    |
| 1                                     | 0.0114                | 3.625               | 3.134                | 996.375           | 0.0000099          |
| 2                                     | 0.0227                | 7.25                | 3.134                | 992.75            | 0.0000099          |
| 5                                     | 0.0568                | 18.125              | 3.134                | 981.875           | 0.0000099          |
| 10                                    | 0.1136                | 36.25               | 3.134                | 963.75            | 0.0000099          |
| 20                                    | 0.2272                | 72.5                | 3.134                | 927.5             | 0.0000099          |
| 50                                    | 0.5680                | 181.25              | 3.134                | 818.75            | 0.0000099          |
| 100                                   | 1.1361                | 362.5               | 3.134                | 637.5             | 0.0000099          |
| 160                                   | 1.8177                | 580                 | 3.134                | 420               | 0.0000099          |
| <b>Typical Average Power</b>          |                       |                     |                      |                   |                    |
| 1                                     | 0.0156                | 4.157               | 3.729                | 995.843           | 0.00011154         |
| 2                                     | 0.0311                | 8.314               | 3.729                | 991.686           | 0.00011154         |
| 5                                     | 0.0776                | 20.785              | 3.729                | 979.215           | 0.00011154         |
| 10                                    | 0.1551                | 41.57               | 3.729                | 958.43            | 0.00011154         |
| 20                                    | 0.3101                | 83.14               | 3.729                | 916.86            | 0.00011154         |
| 50                                    | 0.7751                | 207.85              | 3.729                | 792.15            | 0.00011154         |
| 100                                   | 1.5501                | 415.7               | 3.729                | 584.3             | 0.00011154         |
| 160                                   | 2.4800                | 665.12              | 3.729                | 334.88            | 0.00011154         |
| <b>Maximum Average Power</b>          |                       |                     |                      |                   |                    |
| 1                                     | 0.0214                | 4.839               | 4.275                | 995.161           | 0.0006963          |
| 2                                     | 0.0421                | 9.678               | 4.275                | 990.322           | 0.0006963          |
| 5                                     | 0.1041                | 24.195              | 4.275                | 975.805           | 0.0006963          |
| 10                                    | 0.2075                | 48.39               | 4.275                | 951.61            | 0.0006963          |
| 20                                    | 0.4144                | 96.78               | 4.275                | 903.22            | 0.0006963          |
| 50                                    | 1.0349                | 241.95              | 4.275                | 758.05            | 0.0006963          |
| 100                                   | 2.0692                | 483.9               | 4.275                | 516.1             | 0.0006963          |
| 160                                   | 3.3103                | 774.24              | 4.275                | 225.76            | 0.0006963          |

**FIGURE 4. AVERAGE POWER CONSUMPTION VS SAMPLING RATE AT 3.3 V<sub>SUPPLY</sub>**

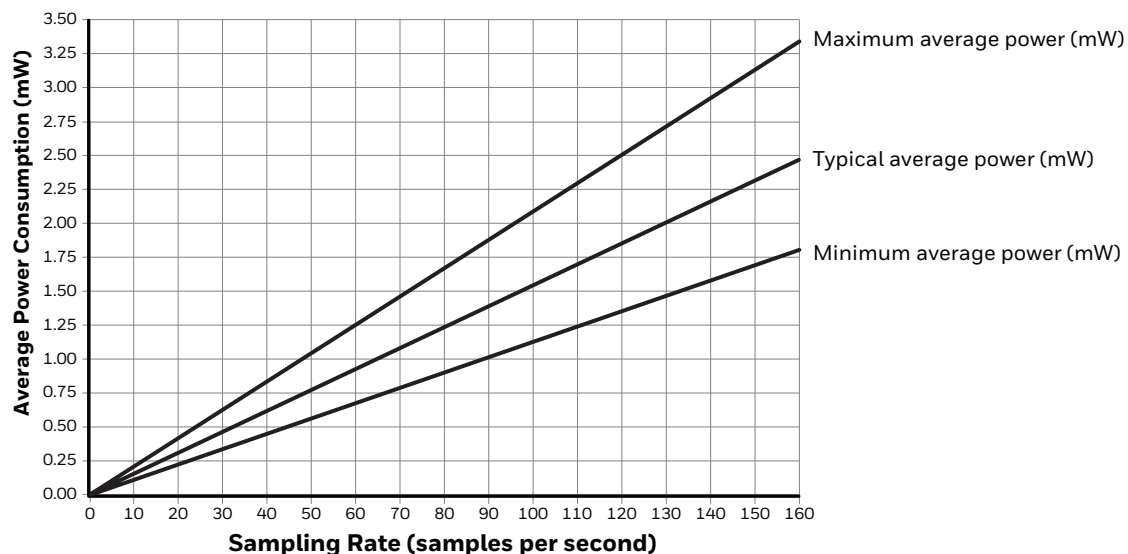

# BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES

FIGURE 5. NOMENCLATURE AND ORDER GUIDE

For example, **ABP2DANT001BA2A3XX** defines an ABP2 Series Amplified Basic Pressure Sensor, DIP package, plastic single axial barbed pressure port, liquid media, food-grade silicone gel, no diagnostics, 1 bar absolute pressure range, digital I<sup>2</sup>C, address 0x28 output type, 10% to 90% of 2<sup>24</sup> counts (digital) transfer function, 3.3 Vdc supply voltage.

**ABP2 D AN T 001BA 2 A 3 XX**

**Product Series**  
**ABP2** Amplified Basic

**Package**  
**D** DIP (Dual Inline Pin)  
**M** SMT (Surface Mount Technology)  
**L** Leadless SMT

**Pressure Port<sup>1</sup>**

|                | DIP                                               | SMT                                               | Leadless SMT                                      |
|----------------|---------------------------------------------------|---------------------------------------------------|---------------------------------------------------|
| <b>Plastic</b> | <b>NN</b> No port<br>                             | <b>NN</b> No port<br>                             | <b>NN</b> No port<br>                             |
|                | <b>AN</b> Single axial barbed port<br>            | <b>AN</b> Single axial barbed port<br>            | <b>AN</b> Single axial barbed port<br>            |
| <b>Metal</b>   | <b>VN</b> Single axial barbless port<br>          | <b>VN</b> Single axial barbless port<br>          | <b>VN</b> Single axial barbless port<br>          |
|                | <b>SN</b> Single axial straight barbless port<br> | <b>SN</b> Single axial straight barbless port<br> | <b>SN</b> Single axial straight barbless port<br> |
|                | <b>RN</b> Single radial barbed port<br>           | <b>RN</b> Single radial barbed port<br>           | —                                                 |
| <b>Plastic</b> | <b>RR</b> Dual radial barbed ports, same side<br> | <b>RR</b> Dual radial barbed ports, same side<br> | —                                                 |
|                | <b>DA</b> Dual axial barbed ports, same side<br>  | <b>DA</b> Dual axial barbed ports, same side<br>  | —                                                 |

**Product Option<sup>2,3</sup>**  
**N** Dry gases only, no diagnostics  
**T** Liquid media, food-grade silicone gel, no diagnostics  
**G** Liquid media, fluorosilicone gel, no diagnostics

**Future**  
**XX**

**Supply Voltage**  
**3** 3.3 Vdc

**Transfer Function**  
**A** 10% to 90% of 2<sup>24</sup> counts (digital)  
**B** 30% to 70% of 2<sup>24</sup> counts (digital)

**Output Type**  
**S** SPI  
**0** I<sup>2</sup>C, Address 0x08  
**1** I<sup>2</sup>C, Address 0x18  
**2** I<sup>2</sup>C, Address 0x28  
**3** I<sup>2</sup>C, Address 0x38  
**4** I<sup>2</sup>C, Address 0x48  
**5** I<sup>2</sup>C, Address 0x58  
**6** I<sup>2</sup>C, Address 0x68  
**7** I<sup>2</sup>C, Address 0x78

**Pressure Range**

| ±6 mbar to ±12 bar |         | ±600 Pa to ±1.2 MPa |         | ±2 inH <sub>2</sub> O to ±175 psi |        |
|--------------------|---------|---------------------|---------|-----------------------------------|--------|
| Absolute           |         | Absolute            |         | Absolute                          |        |
| <b>001BA</b>       | 1 bar   | <b>100KA</b>        | 100 kPa | <b>015PA</b>                      | 15 psi |
| <b>1.6BA</b>       | 1.6 bar | <b>060KA</b>        | 160 kPa | <b>030PA</b>                      | 30 psi |
| <b>2.5BA</b>       | 2.5 bar | <b>250KA</b>        | 250 kPa |                                   |        |

| Differential |           | Differential |          | Differential |                        |
|--------------|-----------|--------------|----------|--------------|------------------------|
| <b>006MD</b> | ±6 mbar   | <b>600LD</b> | ±600 Pa  | <b>002ND</b> | ±2 inH <sub>2</sub> O  |
| <b>010MD</b> | ±10 mbar  | <b>001KD</b> | ±1 kPa   | <b>004ND</b> | ±4 inH <sub>2</sub> O  |
| <b>016MD</b> | ±16 mbar  | <b>1.6KD</b> | ±1.6 kPa | <b>005ND</b> | ±5 inH <sub>2</sub> O  |
| <b>025MD</b> | ±25 mbar  | <b>2.5KD</b> | ±2.5 kPa | <b>010ND</b> | ±10 inH <sub>2</sub> O |
| <b>040MD</b> | ±40 mbar  | <b>004KD</b> | ±4 kPa   | <b>020ND</b> | ±20 inH <sub>2</sub> O |
| <b>060MD</b> | ±60 mbar  | <b>006KD</b> | ±6 kPa   | <b>030ND</b> | ±30 inH <sub>2</sub> O |
| <b>100MD</b> | ±100 mbar | <b>010KD</b> | ±10 kPa  | <b>001PD</b> | ±1 psi                 |
| <b>160MD</b> | ±160 mbar | <b>016KD</b> | ±16 kPa  | <b>005PD</b> | ±5 psi                 |
| <b>250MD</b> | ±250 mbar | <b>025KD</b> | ±25 kPa  | <b>015PD</b> | ±15 psi                |
| <b>400MD</b> | ±400 mbar | <b>040KD</b> | ±40 kPa  | <b>030PD</b> | ±30 psi                |
| <b>600MD</b> | ±600 mbar | <b>060KD</b> | ±60 kPa  | <b>060PD</b> | ±60 psi                |
| <b>001BD</b> | ±1 bar    | <b>100KD</b> | ±100 kPa |              |                        |
| <b>1.6BD</b> | ±1.6 bar  | <b>160KD</b> | ±160 kPa |              |                        |
| <b>2.5BD</b> | ±2.5 bar  | <b>250KD</b> | ±250 kPa |              |                        |
| <b>004BD</b> | ±4 bar    | <b>400KD</b> | ±400 kPa |              |                        |

| Gage         |          | Gage         |         | Gage         |                       |
|--------------|----------|--------------|---------|--------------|-----------------------|
| <b>010MG</b> | 10 mbar  | <b>001KG</b> | 1 kPa   | <b>004NG</b> | 4 inH <sub>2</sub> O  |
| <b>016MG</b> | 16 mbar  | <b>1.6KG</b> | 1.6 kPa | <b>005NG</b> | 5 inH <sub>2</sub> O  |
| <b>025MG</b> | 25 mbar  | <b>2.5KG</b> | 2.5 kPa | <b>010NG</b> | 10 inH <sub>2</sub> O |
| <b>040MG</b> | 40 mbar  | <b>004KG</b> | 4 kPa   | <b>020NG</b> | 20 inH <sub>2</sub> O |
| <b>060MG</b> | 60 mbar  | <b>006KG</b> | 6 kPa   | <b>030NG</b> | 30 inH <sub>2</sub> O |
| <b>100MG</b> | 100 mbar | <b>010KG</b> | 10 kPa  | <b>001PG</b> | 1 psi                 |
| <b>160MG</b> | 160 mbar | <b>016KG</b> | 16 kPa  | <b>005PG</b> | 5 psi                 |
| <b>250MG</b> | 250 mbar | <b>025KG</b> | 25 kPa  | <b>015PG</b> | 15 psi                |
| <b>400MG</b> | 400 mbar | <b>040KG</b> | 40 kPa  | <b>030PG</b> | 30 psi                |
| <b>600MG</b> | 600 mbar | <b>060KG</b> | 60 kPa  | <b>060PG</b> | 60 psi                |
| <b>001BG</b> | 1 bar    | <b>100KG</b> | 100 kPa | <b>100PG</b> | 100 psi               |
| <b>1.6BG</b> | 1.6 bar  | <b>160KG</b> | 160 kPa | <b>150PG</b> | 150 psi               |
| <b>2.5BG</b> | 2.5 bar  | <b>250KG</b> | 250 kPa | <b>175PG</b> | 175 psi               |
| <b>004BG</b> | 4 bar    | <b>400KG</b> | 400 kPa |              |                       |
| <b>006BG</b> | 6 bar    | <b>600KG</b> | 600 kPa |              |                       |
| <b>008BG</b> | 8 bar    | <b>800KG</b> | 800 kPa |              |                       |
| <b>010BG</b> | 10 bar   | <b>001GG</b> | 1 MPa   |              |                       |
| <b>012BG</b> | 12 bar   | <b>1.2GG</b> | 1.2 MPa |              |                       |

<sup>1</sup> The "DA" Pressure Port is only available with Product Option "N" (dry gases, no diagnostics). The "DA" Pressure Port is available in standard listings with pressure ranges up to 250 mbar. For higher pressure ranges, please consult the factory.

<sup>2</sup> Product Option "N" is only available with gage pressure ranges 10 mbar to 40 mbar | 1 kPa to 4 kPa | 4 inH<sub>2</sub>O to 20 inH<sub>2</sub>O, ±6 mbar to ±25 mbar | ±1 kPa to ±2.5 kPa | ±2 inH<sub>2</sub>O to ±10 inH<sub>2</sub>O.


<sup>3</sup> Product Option "G" is available with 4 bar | 60 psi gage and 1.6 bar | 30 psi differential and above. See Tables 13, 15, and 17 for pressure range specifications when using fluorosilicone gel.

BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES

SELECT ABP2 SERIES SENSORS MOUNTED ON BREAKOUT BOARDS

Breakout boards, with or without the sensor premounted (see Figure 6 and Tables 9, 10, and 11) are designed for use with the Honeywell SEB Sensor Evaluation Kit.

FIGURE 6. ABP2 SERIES SENSORS AND BREAKOUT BOARDS

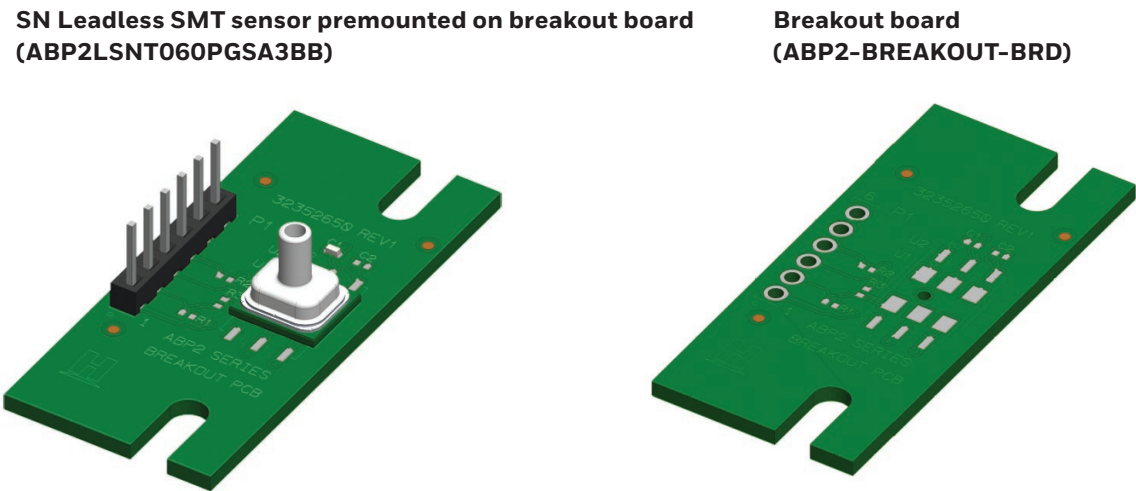

| TABLE 9. ORDER GUIDE FOR ABP2 SERIES SENSORS AND BREAKOUT BOARDS |                                                                                                                                                                                                                                                                                                                               |
|------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| CATALOG LISTING                                                  | DESCRIPTION                                                                                                                                                                                                                                                                                                                   |
| ABP2MRRN004ND2B3BB                                               | ABP2 Series sensor with SMT package, plastic dual radial barbed ports, same side pressure port, dry gases only, no diagnostics, ±4 inH <sub>2</sub> O differential pressure range, I <sup>2</sup> C address 0x28, 30% to 70% of 2 <sup>24</sup> counts digital transfer function, 3.3 Vdc supply premounted on breakout board |
| ABP2MDAN004ND2B3BB                                               | ABP2 Series sensor with SMT package, plastic dual axial barbed ports same side, dry gases only, no diagnostics, ±4 inH <sub>2</sub> O differential pressure range, I <sup>2</sup> C address 0x28, 30% to 70% of 2 <sup>24</sup> counts digital transfer function, 3.3 Vdc supply premounted on breakout board                 |
| ABP2MVNT400MG2A3BB                                               | ABP2 Series sensor with leaded SMT package, metal single axial tapered pressure port, liquid media, food-grade silicone gel, no diagnostics, 400 mbar gage pressure range, I <sup>2</sup> C address 0x28, 10% to 90% of 2 <sup>24</sup> counts digital transfer function, 3.3 Vdc supply premounted on breakout board         |
| ABP2LANT001PG2A3BB                                               | ABP2 Series sensor with leadless SMT package, plastic single axial barbed pressure port, liquid media, food-grade silicone gel, no diagnostics, 1 psi gage pressure range, I <sup>2</sup> C address 0x28, 10% to 90% of 2 <sup>24</sup> counts digital transfer function, 3.3 Vdc supply premounted on breakout board         |
| ABP2LSNT060PGSA3BB                                               | ABP2 Series sensor with leadless SMT package, metal single axial straight barbless pressure port, liquid media, food-grade silicone gel, no diagnostics, 60 psi gage pressure range, SPI output type, 10% to 90% of 2 <sup>24</sup> counts digital transfer function, 3.3 Vdc supply premounted on breakout board             |
| ABP2LANT001BA2A3BB                                               | ABP2 Series sensor with leadless SMT package, plastic single axial barbed pressure port, liquid media, food-grade silicone gel, no diagnostics, 1 bar absolute pressure range, I <sup>2</sup> C address 0x28, 10%to 90% of 2 <sup>24</sup> counts digital transfer function, 3.3 Vdc supply premounted on breakout board      |
| ABP2-BREAKOUT-BRD                                                | Bare breakout board for use with SMT and leadless SMT packages with AN, SN, VN, NN, RN, or RR pressure ports                                                                                                                                                                                                                  |

## BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES

### SELECT ABP2 SERIES SENSORS MOUNTED ON BREAKOUT BOARDS (CONTINUED)

| TABLE 10. BREAKOUT BOARD ASSEMBLY DETAILS |                |                                                                |                          |           |                                                                                                                                                     |
|-------------------------------------------|----------------|----------------------------------------------------------------|--------------------------|-----------|-----------------------------------------------------------------------------------------------------------------------------------------------------|
| SL NUMBER                                 | REF DESIGNATOR | DESCRIPTION                                                    | MANUFACTURER PART NUMBER | POPULATE  | DESCRIPTION                                                                                                                                         |
| 1                                         | C1             | capacitor, ceramic, 0.1 $\mu$ F, 16 V, X7R, 10% SMD 0402       | GCM155R71C104KA55J       | populated | a decoupling capacitor, breakout board shipped with this part assembled                                                                             |
| 2                                         | C2             | capacitor, ceramic SMD 0402                                    | NA                       | DNP       | do not populate                                                                                                                                     |
| 3                                         | R1, R2         | resistor SMD 0402<br>SCL line/R1 and SDA line R2               | NA                       | DNP       | optional pull-up resistors for I <sup>2</sup> C output (not populated on the breakout board); recommended pull-up resistor value: 1 kOhm to 10 kOhm |
| 4                                         | R3             | resistor, SMD 0402                                             | NA                       | DNP       | jumper resistor, do not populate                                                                                                                    |
| 5                                         | P1             | connector, header, 6 pin, straight, 2,54 mm pitch through hole | 826629-6                 | populated | 6 pin connector                                                                                                                                     |
| 6                                         | U1             | ABP2 sensor                                                    | ABP2                     | populated | respective ABP2 sensor mounted                                                                                                                      |

| TABLE 11. BREAKOUT BOARD PINOUTS |                         |                 |
|----------------------------------|-------------------------|-----------------|
| PIN NUMBER                       | I <sup>2</sup> C OUTPUT | SPI OUTPUT      |
| 1                                | V <sub>DD</sub>         | V <sub>DD</sub> |
| 2                                | SCL                     | SCLK            |
| 3                                | EOC                     | MISO            |
| 4                                | SDA                     | MOSI            |
| 5                                | GND                     | GND             |
| 6                                | NC                      | SS              |

# BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES

**TABLE 12. PRESSURE RANGE SPECIFICATIONS:  $\pm 6$  MBAR TO  $\pm 12$  BAR FOR PRODUCT OPTIONS "N" AND "T" ONLY**

| PRESSURE RANGE | PRESSURE RANGE    |                   | UNIT | OVERPRESSURE <sup>1</sup> |                | BURST PRESSURE <sup>2</sup> |                | TOTAL ERROR BAND <sup>3</sup><br>(%FSS) |                     |                      | TYPICAL OFFSET<br>SHIFT WITH<br>REFLOW<br>(%FSS) | LONG-TERM<br>STABILITY<br>(1000 HR)<br>(%FSS) | TRANSFER<br>FUNCTION |
|----------------|-------------------|-------------------|------|---------------------------|----------------|-----------------------------|----------------|-----------------------------------------|---------------------|----------------------|--------------------------------------------------|-----------------------------------------------|----------------------|
|                | P <sub>MIN.</sub> | P <sub>MAX.</sub> |      | PORT 1<br>(P1)            | PORT 2<br>(P2) | PORT 1<br>(P1)              | PORT 2<br>(P2) | 0°C<br>TO<br>50°C                       | -20°C<br>TO<br>85°C | -40°C<br>TO<br>110°C |                                                  |                                               |                      |
| Absolute       |                   |                   |      |                           |                |                             |                |                                         |                     |                      |                                                  |                                               |                      |
| 001BA          | 0                 | 1                 | bar  | 16                        | —              | 25                          | NA             | ±1.5                                    | ±3.0                | ±4.5                 | ±1.0                                             | ±0.2                                          | A                    |
| 1.6BA          | 0                 | 1.6               | bar  | 16                        | —              | 25                          | NA             | ±1.5                                    | ±3.0                | ±4.5                 | ±1.0                                             | ±0.2                                          | A                    |
| 2.5BA          | 0                 | 2.5               | bar  | 16                        | —              | 25                          | NA             | ±1.5                                    | ±3.0                | ±4.5                 | ±1.0                                             | ±0.2                                          | A                    |
| Differential   |                   |                   |      |                           |                |                             |                |                                         |                     |                      |                                                  |                                               |                      |
| 006MD          | -6                | 6                 | mbar | 700                       | 700            | 7000                        | 1000           | ±2.0                                    | ±3.5                | —                    | ±1.0                                             | ±0.3                                          | B                    |
| 010MD          | -10               | 10                | mbar | 700                       | 700            | 7000                        | 1000           | ±2.0                                    | ±3.5                | —                    | ±1.0                                             | ±0.3                                          | B                    |
| 016MD          | -16               | 16                | mbar | 700                       | 700            | 7000                        | 1000           | ±2.0                                    | ±3.5                | —                    | ±1.0                                             | ±0.3                                          | A                    |
| 025MD          | -25               | 25                | mbar | 700                       | 700            | 7000                        | 1000           | ±2.0                                    | ±3.5                | —                    | ±1.0                                             | ±0.3                                          | A                    |
| 040MD          | -40               | 40                | mbar | 2000                      | 1000           | 7000                        | 2000           | ±1.5                                    | ±3.0                | ±4.5                 | ±1.0                                             | ±0.2                                          | A                    |
| 060MD          | -60               | 60                | mbar | 2000                      | 1000           | 7000                        | 2000           | ±1.5                                    | ±3.0                | ±4.5                 | ±1.0                                             | ±0.2                                          | A                    |
| 100MD          | -100              | 100               | mbar | 2000                      | 1000           | 7000                        | 2000           | ±1.5                                    | ±3.0                | ±4.5                 | ±1.0                                             | ±0.2                                          | A                    |
| 160MD          | -160              | 160               | mbar | 2000                      | 1000           | 7000                        | 2000           | ±1.5                                    | ±3.0                | ±4.5                 | ±1.0                                             | ±0.2                                          | A                    |
| 250MD          | -250              | 250               | mbar | 16000                     | —              | 25000                       | —              | ±1.5                                    | ±3.0                | ±4.5                 | ±1.0                                             | ±0.2                                          | A                    |
| 400MD          | -400              | 400               | mbar | 16000                     | —              | 25000                       | —              | ±1.5                                    | ±3.0                | ±4.5                 | ±1.0                                             | ±0.2                                          | A                    |
| 600MD          | -600              | 600               | mbar | 16000                     | —              | 25000                       | —              | ±1.5                                    | ±3.0                | ±4.5                 | ±1.0                                             | ±0.2                                          | A                    |
| 001BD          | -1                | 1                 | bar  | 16                        | —              | 25                          | —              | ±1.5                                    | ±3.0                | ±4.5                 | ±1.0                                             | ±0.2                                          | A                    |
| 1.6BD          | -1.6              | 1.6               | bar  | 16                        | —              | 25                          | —              | ±1.5                                    | ±3.0                | ±4.5                 | ±1.0                                             | ±0.2                                          | A                    |
| 2.5BD          | -2.5              | 2.5               | bar  | 16                        | —              | 25                          | —              | ±1.5                                    | ±3.0                | ±4.5                 | ±1.0                                             | ±0.2                                          | A                    |
| 004BD          | -4                | 4                 | bar  | 16                        | —              | 25                          | —              | ±1.5                                    | ±3.0                | ±4.5                 | ±1.0                                             | ±0.2                                          | A                    |
| Gage           |                   |                   |      |                           |                |                             |                |                                         |                     |                      |                                                  |                                               |                      |
| 010MG          | 0                 | 10                | mbar | 700                       | —              | 7000                        | —              | ±2.0                                    | ±3.5                | —                    | ±1.0                                             | ±0.3                                          | B                    |
| 016MG          | 0                 | 16                | mbar | 700                       | —              | 7000                        | —              | ±2.0                                    | ±3.5                | —                    | ±1.0                                             | ±0.3                                          | B                    |
| 025MG          | 0                 | 25                | mbar | 700                       | —              | 7000                        | —              | ±2.0                                    | ±3.5                | —                    | ±1.0                                             | ±0.3                                          | A                    |
| 040MG          | 0                 | 40                | mbar | 700                       | —              | 7000                        | —              | ±2.0                                    | ±3.5                | —                    | ±1.0                                             | ±0.3                                          | A                    |
| 060MG          | 0                 | 60                | mbar | 2000                      | —              | 7000                        | —              | ±1.5                                    | ±3.0                | ±4.5                 | ±1.0                                             | ±0.2                                          | A                    |
| 100MG          | 0                 | 100               | mbar | 2000                      | —              | 7000                        | —              | ±1.5                                    | ±3.0                | ±4.5                 | ±1.0                                             | ±0.2                                          | A                    |
| 250MG          | 0                 | 250               | mbar | 2000                      | —              | 7000                        | —              | ±1.5                                    | ±3.0                | ±4.5                 | ±1.0                                             | ±0.2                                          | A                    |
| 400MG          | 0                 | 400               | mbar | 2000                      | —              | 7000                        | —              | ±1.5                                    | ±3.0                | ±4.5                 | ±1.0                                             | ±0.2                                          | A                    |
| 600MG          | 0                 | 600               | mbar | 16000                     | —              | 25000                       | —              | ±1.5                                    | ±3.0                | ±4.5                 | ±1.0                                             | ±0.2                                          | A                    |
| 001BG          | 0                 | 1                 | bar  | 16                        | —              | 25                          | —              | ±1.5                                    | ±3.0                | ±4.5                 | ±1.0                                             | ±0.2                                          | A                    |
| 1.6BG          | 0                 | 1.6               | bar  | 16                        | —              | 25                          | —              | ±1.5                                    | ±3.0                | ±4.5                 | ±1.0                                             | ±0.2                                          | A                    |
| 2.5BG          | 0                 | 2.5               | bar  | 16                        | —              | 25                          | —              | ±1.5                                    | ±3.0                | ±4.5                 | ±1.0                                             | ±0.2                                          | A                    |
| 004BG          | 0                 | 4                 | bar  | 16                        | —              | 25                          | —              | ±1.5                                    | ±3.0                | ±4.5                 | ±1.0                                             | ±0.2                                          | A                    |
| 006BG          | 0                 | 6                 | bar  | 16                        | —              | 25                          | —              | ±1.5                                    | ±3.0                | ±4.5                 | ±1.0                                             | ±0.2                                          | A                    |
| 008BG          | 0                 | 8                 | bar  | 16                        | —              | 25                          | —              | ±1.5                                    | ±3.0                | ±4.5                 | ±1.0                                             | ±0.2                                          | A                    |
| 010BG          | 0                 | 10                | bar  | 16                        | —              | 25                          | —              | ±1.5                                    | ±3.0                | ±4.5                 | ±1.0                                             | ±0.2                                          | A                    |
| 012BG          | 0                 | 12                | bar  | 16                        | —              | 25                          | —              | ±1.5                                    | ±3.0                | ±4.5                 | ±1.0                                             | ±0.2                                          | A                    |

<sup>1</sup> **Overpressure:** The maximum pressure which may safely be applied to the product for it to remain in specification once pressure is returned to the operating pressure range. Exposure to higher pressures may cause permanent damage to the product. Unless otherwise specified, this applies to all available pressure ports at any temperature within the operating temperature range.

<sup>2</sup> **Burst Pressure:** The maximum pressure that may be applied to any port of the product without causing escape of pressure media. The product should not be expected to function after exposure to any pressure beyond the burst pressure.

<sup>3</sup> **Total Error Band:** The maximum deviation from the ideal transfer function over the entire compensated temperature and pressure range without causing changes in specified performance.

## BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES

**TABLE 13. PRESSURE RANGE SPECIFICATIONS: ±1.6 BAR TO ±12 BAR FOR PRODUCT OPTIONS "G" ONLY**

| PRESSURE RANGE | PRESSURE RANGE    |                   | UNIT | OVERPRESSURE <sup>1</sup> |             | BURST PRESSURE <sup>2</sup> |             | COMMON <sup>3</sup> MODE PRESSURE | TOTAL ERROR BAND <sup>4</sup> (%FSS) |               |                | TYPICAL OFFSET SHIFT WITH REFLOW (%FSS) | LONG-TERM STABILITY (1000 HR) (%FSS) | TRANSFER FUNCTION |
|----------------|-------------------|-------------------|------|---------------------------|-------------|-----------------------------|-------------|-----------------------------------|--------------------------------------|---------------|----------------|-----------------------------------------|--------------------------------------|-------------------|
|                | P <sub>MIN.</sub> | P <sub>MAX.</sub> |      | PORT 1 (P1)               | PORT 2 (P2) | PORT 1 (P1)                 | PORT 2 (P2) |                                   | 0°C TO 50°C                          | -20°C TO 85°C | -40°C TO 110°C |                                         |                                      |                   |
| Differential   |                   |                   |      |                           |             |                             |             |                                   |                                      |               |                |                                         |                                      |                   |
| 1.6BD          | -1.6              | 1.6               | bar  | 16                        | —           | 25                          | —           | 16                                | ±2.0                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.5                                 | A                 |
| 2.5BD          | -2.5              | 2.5               | bar  | 16                        | —           | 25                          | —           | 16                                | ±2.0                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.5                                 | A                 |
| 004BD          | -4                | 4                 | bar  | 16                        | —           | 25                          | —           | 16                                | ±2.0                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.5                                 | A                 |
| Gage           |                   |                   |      |                           |             |                             |             |                                   |                                      |               |                |                                         |                                      |                   |
| 004BG          | 0                 | 4                 | bar  | 16                        | —           | 25                          | —           | —                                 | ±2.0                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.5                                 | A                 |
| 006BG          | 0                 | 6                 | bar  | 16                        | —           | 25                          | —           | —                                 | ±2.0                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.5                                 | A                 |
| 008BG          | 0                 | 8                 | bar  | 16                        | —           | 25                          | —           | —                                 | ±2.0                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.5                                 | A                 |
| 010BG          | 0                 | 10                | bar  | 16                        | —           | 25                          | —           | —                                 | ±2.0                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.5                                 | A                 |
| 012BG          | 0                 | 12                | bar  | 16                        | —           | 25                          | —           | —                                 | ±2.0                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.5                                 | A                 |

<sup>1</sup>**Overpressure:** The maximum pressure which may safely be applied to the product for it to remain in specification once pressure is returned to the operating pressure range. Exposure to higher pressures may cause permanent damage to the product. Unless otherwise specified, this applies to all available pressure ports at any temperature within the operating temperature range.

<sup>2</sup>**Burst Pressure:** The maximum pressure that may be applied to any port of the product without causing escape of pressure media. The product should not be expected to function after exposure to any pressure beyond the burst pressure.

<sup>3</sup>**Common Mode Pressure:** The maximum pressure that can be applied simultaneously to both ports of a differential pressure sensor without causing changes in specified performance.

<sup>4</sup>**Total Error Band:** The maximum deviation from the ideal transfer function over the entire compensated temperature and pressure range without causing changes in specified performance.

# BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES

**TABLE 14. PRESSURE RANGE SPECIFICATIONS: ±600 PA TO ±1.2 MPA FOR PRODUCT OPTIONS "N" AND "T" ONLY**

| PRESSURE RANGE | PRESSURE RANGE    |                   | UNIT | OVERPRESSURE <sup>1</sup> |             | BURST PRESSURE <sup>2</sup> |             | TOTAL ERROR BAND <sup>3</sup> (%FSS) |               |                | TYPICAL OFFSET SHIFT WITH REFLOW (%FSS) | LONG-TERM STABILITY (1000 HR) (%FSS) | TRANSFER FUNCTION |
|----------------|-------------------|-------------------|------|---------------------------|-------------|-----------------------------|-------------|--------------------------------------|---------------|----------------|-----------------------------------------|--------------------------------------|-------------------|
|                | P <sub>MIN.</sub> | P <sub>MAX.</sub> |      | PORT 1 (P1)               | PORT 2 (P2) | PORT 1 (P1)                 | PORT 2 (P2) | 0°C TO 50°C                          | -20°C TO 85°C | -40°C TO 110°C |                                         |                                      |                   |
| Absolute       |                   |                   |      |                           |             |                             |             |                                      |               |                |                                         |                                      |                   |
| 100KA          | 0                 | 100               | kPa  | 1600                      | —           | 2500                        | —           | ±1.5                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 160KA          | 0                 | 160               | kPa  | 1600                      | —           | 2500                        | —           | ±1.5                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 250KA          | 0                 | 250               | kPa  | 1600                      | —           | 2500                        | —           | ±1.5                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| Differential   |                   |                   |      |                           |             |                             |             |                                      |               |                |                                         |                                      |                   |
| 600LD          | -600              | 600               | Pa   | 70000                     | 70000       | 70000                       | 100000      | ±2.0                                 | ±3.5          | —              | ±1.0                                    | ±0.3                                 | B                 |
| 001KD          | -1                | 1                 | kPa  | 70                        | 70          | 700                         | 100         | ±2.0                                 | ±3.5          | —              | ±1.0                                    | ±0.3                                 | B                 |
| 1.6KD          | -1.6              | 1.6               | kPa  | 70                        | 70          | 700                         | 100         | ±2.0                                 | ±3.5          | —              | ±1.0                                    | ±0.3                                 | A                 |
| 2.5KD          | -2.5              | 2.5               | kPa  | 70                        | 70          | 700                         | 100         | ±2.0                                 | ±3.5          | —              | ±1.0                                    | ±0.3                                 | A                 |
| 004KD          | -4                | 4                 | kPa  | 200                       | 100         | 700                         | 200         | ±1.5                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 006KD          | -6                | 6                 | kPa  | 200                       | 100         | 700                         | 200         | ±1.5                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 010KD          | -10               | 10                | kPa  | 200                       | 100         | 700                         | 200         | ±1.5                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 016KD          | -16               | 16                | kPa  | 200                       | 100         | 700                         | 200         | ±1.5                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 025KD          | -25               | 25                | kPa  | 1600                      | —           | 2500                        | —           | ±1.5                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 040KD          | -40               | 40                | kPa  | 1600                      | —           | 2500                        | —           | ±1.5                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 060KD          | -60               | 60                | kPa  | 1600                      | —           | 2500                        | —           | ±1.5                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 100KD          | -100              | 100               | kPa  | 1600                      | —           | 2500                        | —           | ±1.5                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 160KD          | -160              | 160               | kPa  | 1600                      | —           | 2500                        | —           | ±1.5                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 250KD          | -250              | 250               | kPa  | 1600                      | —           | 2500                        | —           | ±1.5                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 400KD          | -400              | 400               | kPa  | 1600                      | —           | 2500                        | —           | ±1.5                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| Gage           |                   |                   |      |                           |             |                             |             |                                      |               |                |                                         |                                      |                   |
| 001KG          | 0                 | 1                 | kPa  | 70                        | —           | 700                         | —           | ±2.0                                 | ±3.5          | —              | ±1.0                                    | ±0.3                                 | B                 |
| 1.6KG          | 0                 | 1.6               | kPa  | 70                        | —           | 700                         | —           | ±2.0                                 | ±3.5          | —              | ±1.0                                    | ±0.3                                 | B                 |
| 2.5KG          | 0                 | 2.5               | kPa  | 70                        | —           | 700                         | —           | ±2.0                                 | ±3.5          | —              | ±1.0                                    | ±0.3                                 | A                 |
| 004KG          | 0                 | 4                 | kPa  | 70                        | —           | 700                         | —           | ±2.0                                 | ±3.5          | —              | ±1.0                                    | ±0.3                                 | A                 |
| 006KG          | 0                 | 6                 | kPa  | 200                       | —           | 700                         | —           | ±1.5                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 010KG          | 0                 | 10                | kPa  | 200                       | —           | 700                         | —           | ±1.5                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 025KG          | 0                 | 25                | kPa  | 200                       | —           | 700                         | —           | ±1.5                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 040KG          | 0                 | 40                | kPa  | 200                       | —           | 700                         | —           | ±1.5                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 060KG          | 0                 | 60                | kPa  | 1600                      | —           | 2500                        | —           | ±1.5                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 100KG          | 0                 | 100               | kPa  | 1600                      | —           | 2500                        | —           | ±1.5                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 160KG          | 0                 | 160               | kPa  | 1600                      | —           | 2500                        | —           | ±1.5                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 250KG          | 0                 | 250               | kPa  | 1600                      | —           | 2500                        | —           | ±1.5                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 400KG          | 0                 | 400               | kPa  | 1600                      | —           | 2500                        | —           | ±1.5                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 600KG          | 0                 | 600               | kPa  | 1600                      | —           | 2500                        | —           | ±1.5                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 800KG          | 0                 | 800               | kPa  | 1600                      | —           | 2500                        | —           | ±1.5                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 001GG          | 0                 | 1                 | MPa  | 1.6                       | —           | 2.5                         | —           | ±1.5                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 1.2GG          | 0                 | 1.2               | MPa  | 1.6                       | —           | 2.5                         | —           | ±1.5                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |

<sup>1</sup> **Overpressure:** The maximum pressure which may safely be applied to the product for it to remain in specification once pressure is returned to the operating pressure range. Exposure to higher pressures may cause permanent damage to the product. Unless otherwise specified, this applies to all available pressure ports at any temperature within the operating temperature range.

<sup>2</sup> **Burst Pressure:** The maximum pressure that may be applied to any port of the product without causing escape of pressure media. The product should not be expected to function after exposure to any pressure beyond the burst pressure.

<sup>3</sup> **Total Error Band:** The maximum deviation from the ideal transfer function over the entire compensated temperature and pressure range without causing changes in specified performance.

## BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES

**TABLE 15. PRESSURE RANGE SPECIFICATIONS: ±160 KPA TO ±1.2 MPA FOR PRODUCT OPTIONS "G" ONLY**

| PRESSURE RANGE | PRESSURE RANGE    |                   | UNIT | OVERPRESSURE <sup>1</sup> |             | BURST PRESSURE <sup>2</sup> |             | COMMON <sup>3</sup> MODE PRESSURE | TOTAL ERROR BAND <sup>4</sup> (%FSS) |               |                | TYPICAL OFFSET SHIFT WITH REFLOW (%FSS) | LONG-TERM STABILITY (1000 HR) (%FSS) | TRANSFER FUNCTION |
|----------------|-------------------|-------------------|------|---------------------------|-------------|-----------------------------|-------------|-----------------------------------|--------------------------------------|---------------|----------------|-----------------------------------------|--------------------------------------|-------------------|
|                | P <sub>MIN.</sub> | P <sub>MAX.</sub> |      | PORT 1 (P1)               | PORT 2 (P2) | PORT 1 (P1)                 | PORT 2 (P2) |                                   | 0°C TO 50°C                          | -20°C TO 85°C | -40°C TO 110°C |                                         |                                      |                   |
| Differential   |                   |                   |      |                           |             |                             |             |                                   |                                      |               |                |                                         |                                      |                   |
| 160KD          | -160              | 160               | kPa  | 1600                      | —           | 2500                        | —           | 1600                              | ±2.0                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.5                                 | A                 |
| 250KD          | -250              | 250               | kPa  | 1600                      | —           | 2500                        | —           | 1600                              | ±2.0                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.5                                 | A                 |
| 400KD          | -400              | 400               | kPa  | 1600                      | —           | 2500                        | —           | 1600                              | ±2.0                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.5                                 | A                 |
| Gage           |                   |                   |      |                           |             |                             |             |                                   |                                      |               |                |                                         |                                      |                   |
| 400KG          | 0                 | 400               | kPa  | 1600                      | —           | 2500                        | —           | —                                 | ±2.0                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.5                                 | A                 |
| 600KG          | 0                 | 600               | kPa  | 1600                      | —           | 2500                        | —           | —                                 | ±2.0                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.5                                 | A                 |
| 800KG          | 0                 | 800               | kPa  | 1600                      | —           | 2500                        | —           | —                                 | ±2.0                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.5                                 | A                 |
| 001GG          | 0                 | 1                 | MPa  | 1.6                       | —           | 2.5                         | —           | —                                 | ±2.0                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.5                                 | A                 |
| 1.2GG          | 0                 | 1.2               | MPa  | 1.6                       | —           | 2.5                         | —           | —                                 | ±2.0                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.5                                 | A                 |

<sup>1</sup> **Overpressure:** The maximum pressure which may safely be applied to the product for it to remain in specification once pressure is returned to the operating pressure range. Exposure to higher pressures may cause permanent damage to the product. Unless otherwise specified, this applies to all available pressure ports at any temperature within the operating temperature range.

<sup>2</sup> **Burst Pressure:** The maximum pressure that may be applied to any port of the product without causing escape of pressure media. The product should not be expected to function after exposure to any pressure beyond the burst pressure.

<sup>3</sup> **Common Mode Pressure:** The maximum pressure that can be applied simultaneously to both ports of a differential pressure sensor without causing changes in specified performance.

<sup>4</sup> **Total Error Band:** The maximum deviation from the ideal transfer function over the entire compensated temperature and pressure range without causing changes in specified performance.

# BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES

**TABLE 16. PRESSURE RANGE SPECIFICATIONS:  $\pm 2$  INH<sub>2</sub>O TO  $\pm 175$  PSI FOR PRODUCT OPTIONS "N" AND "T" ONLY**

| PRESSURE RANGE | PRESSURE RANGE    |                   | UNIT               | OVERPRESSURE <sup>1</sup> |             | BURST PRESSURE <sup>2</sup> |             | TOTAL ERROR BAND <sup>3</sup><br>(%FSS) |               |                | TYPICAL OFFSET SHIFT WITH REFLOW (%FSS) | LONG-TERM STABILITY (1000 HR) (%FSS) | TRANSFER FUNCTION |
|----------------|-------------------|-------------------|--------------------|---------------------------|-------------|-----------------------------|-------------|-----------------------------------------|---------------|----------------|-----------------------------------------|--------------------------------------|-------------------|
|                | P <sub>MIN.</sub> | P <sub>MAX.</sub> |                    | PORT 1 (P1)               | PORT 2 (P2) | PORT 1 (P1)                 | PORT 2 (P2) | 0°C TO 50°C                             | -20°C TO 85°C | -40°C TO 110°C |                                         |                                      |                   |
| Absolute       |                   |                   |                    |                           |             |                             |             |                                         |               |                |                                         |                                      |                   |
| 015PA          | 0                 | 15                | psi                | 240                       | —           | 375                         | —           | ±1.5                                    | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 030PA          | 0                 | 30                | psi                | 240                       | —           | 375                         | —           | ±1.5                                    | 3.0           | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| Differential   |                   |                   |                    |                           |             |                             |             |                                         |               |                |                                         |                                      |                   |
| 002ND          | -2                | 2                 | inH <sub>2</sub> O | 270                       | 270         | 2800                        | 415         | ±2.0                                    | ±3.5          | —              | ±1.0                                    | ±0.3                                 | B                 |
| 004ND          | -4                | 4                 | inH <sub>2</sub> O | 270                       | 270         | 2800                        | 415         | ±2.0                                    | ±3.5          | —              | ±1.0                                    | ±0.3                                 | B                 |
| 005ND          | -5                | 5                 | inH <sub>2</sub> O | 270                       | 270         | 2800                        | 415         | ±2.0                                    | ±3.5          | —              | ±1.0                                    | ±0.3                                 | A                 |
| 010ND          | -10               | 10                | inH <sub>2</sub> O | 270                       | 270         | 2800                        | 415         | ±2.0                                    | ±3.5          | —              | ±1.0                                    | ±0.3                                 | A                 |
| 020ND          | -20               | 20                | inH <sub>2</sub> O | 830                       | 415         | 2800                        | 830         | ±1.5                                    | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 030ND          | -30               | 30                | inH <sub>2</sub> O | 830                       | 415         | 2800                        | 830         | ±1.5                                    | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 001PD          | -1                | 1                 | psi                | 30                        | 15          | 100                         | 830         | ±1.5                                    | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 005PD          | -5                | 5                 | psi                | 240                       | —           | 375                         | —           | ±1.5                                    | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 015PD          | -15               | 15                | psi                | 240                       | —           | 375                         | —           | ±1.5                                    | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 030PD          | -30               | 30                | psi                | 240                       | —           | 375                         | —           | ±2.0                                    | ±3.0          | ±4.5           | ±1.0                                    | ±0.5                                 | A                 |
| 060PD          | -60               | 60                | psi                | 240                       | —           | 375                         | —           | ±2.0                                    | ±3.0          | ±4.5           | ±1.0                                    | ±0.5                                 | A                 |
| Gage           |                   |                   |                    |                           |             |                             |             |                                         |               |                |                                         |                                      |                   |
| 004NG          | 0                 | 4                 | inH <sub>2</sub> O | 270                       | —           | 2800                        | —           | ±2.0                                    | ±3.5          | —              | ±1.0                                    | ±0.3                                 | B                 |
| 005NG          | 0                 | 5                 | inH <sub>2</sub> O | 270                       | —           | 2800                        | —           | ±2.0                                    | ±3.5          | —              | ±1.0                                    | ±0.3                                 | B                 |
| 010NG          | 0                 | 10                | inH <sub>2</sub> O | 270                       | —           | 2800                        | —           | ±2.0                                    | ±3.5          | —              | ±1.0                                    | ±0.3                                 | A                 |
| 020NG          | 0                 | 20                | inH <sub>2</sub> O | 270                       | —           | 2800                        | —           | ±2.0                                    | ±3.5          | —              | ±1.0                                    | ±0.3                                 | A                 |
| 030NG          | 0                 | 30                | inH <sub>2</sub> O | 830                       | —           | 2800                        | —           | ±1.5                                    | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 001PG          | 0                 | 1                 | psi                | 30                        | —           | 100                         | —           | ±1.5                                    | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 005PG          | 0                 | 5                 | psi                | 240                       | —           | 375                         | —           | ±1.5                                    | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 015PG          | 0                 | 15                | psi                | 240                       | —           | 375                         | —           | ±1.5                                    | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 030PG          | 0                 | 30                | psi                | 240                       | —           | 375                         | —           | ±1.5                                    | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 060PG          | 0                 | 60                | psi                | 240                       | —           | 375                         | —           | ±1.5                                    | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 100PG          | 0                 | 100               | psi                | 240                       | —           | 375                         | —           | ±1.5                                    | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 150PG          | 0                 | 150               | psi                | 240                       | —           | 375                         | —           | ±1.5                                    | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |
| 175PG          | 0                 | 175               | psi                | 240                       | —           | 375                         | —           | ±1.5                                    | ±3.0          | ±4.5           | ±1.0                                    | ±0.2                                 | A                 |

<sup>1</sup> **Overpressure:** The maximum pressure which may safely be applied to the product for it to remain in specification once pressure is returned to the operating pressure range. Exposure to higher pressures may cause permanent damage to the product. Unless otherwise specified, this applies to all available pressure ports at any temperature within the operating temperature range.

<sup>2</sup> **Burst Pressure:** The maximum pressure that may be applied to any port of the product without causing escape of pressure media. The product should not be expected to function after exposure to any pressure beyond the burst pressure.

<sup>3</sup> **Total Error Band:** The maximum deviation from the ideal transfer function over the entire compensated temperature and pressure range without causing changes in specified performance.

## BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES

**TABLE 17. PRESSURE RANGE SPECIFICATIONS:  $\pm 30$  PSI TO  $\pm 175$  PSI FOR PRODUCT OPTION "G" ONLY**

| PRESSURE RANGE | PRESSURE RANGE    |                   | UNIT | OVERPRESSURE <sup>1</sup> |             | BURST PRESSURE <sup>2</sup> |             | COMMON <sup>3</sup> MODE PRESSURE | TOTAL ERROR BAND <sup>4</sup> (%FSS) |               |                | TYPICAL OFFSET SHIFT WITH REFLOW (%FSS) | LONG-TERM STABILITY (1000 HR) (%FSS) | TRANSFER FUNCTION |
|----------------|-------------------|-------------------|------|---------------------------|-------------|-----------------------------|-------------|-----------------------------------|--------------------------------------|---------------|----------------|-----------------------------------------|--------------------------------------|-------------------|
|                | P <sub>MIN.</sub> | P <sub>MAX.</sub> |      | PORT 1 (P1)               | PORT 2 (P2) | PORT 1 (P1)                 | PORT 2 (P2) |                                   | MODE                                 | -20°C TO 85°C | -40°C TO 110°C |                                         |                                      |                   |
| Differential   |                   |                   |      |                           |             |                             |             |                                   |                                      |               |                |                                         |                                      |                   |
| 030PD          | -30               | 30                | psi  | 240                       | —           | 375                         | —           | 240                               | ±2.0                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.5                                 | A                 |
| 060PD          | -60               | 60                | psi  | 240                       | —           | 375                         | —           | 240                               | ±2.0                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.5                                 | A                 |
| Gage           |                   |                   |      |                           |             |                             |             |                                   |                                      |               |                |                                         |                                      |                   |
| 060PG          | 0                 | 60                | psi  | 240                       | —           | 375                         | —           | —                                 | ±2.0                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.5                                 | A                 |
| 100PG          | 0                 | 100               | psi  | 240                       | —           | 375                         | —           | —                                 | ±2.0                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.5                                 | A                 |
| 150PG          | 0                 | 150               | psi  | 240                       | —           | 375                         | —           | —                                 | ±2.0                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.5                                 | A                 |
| 175PG          | 0                 | 175               | psi  | 240                       | —           | 375                         | —           | —                                 | ±2.0                                 | ±3.0          | ±4.5           | ±1.0                                    | ±0.5                                 | A                 |

<sup>1</sup>**Overpressure:** The maximum pressure which may safely be applied to the product for it to remain in specification once pressure is returned to the operating pressure range. Exposure to higher pressures may cause permanent damage to the product. Unless otherwise specified, this applies to all available pressure ports at any temperature within the operating temperature range.

<sup>2</sup>**Burst Pressure:** The maximum pressure that may be applied to any port of the product without causing escape of pressure media. The product should not be expected to function after exposure to any pressure beyond the burst pressure.


<sup>3</sup>**Common Mode Pressure:** The maximum pressure that can be applied simultaneously to both ports of a differential pressure sensor without causing changes in specified performance.

<sup>4</sup>**Total Error Band:** The maximum deviation from the ideal transfer function over the entire compensated temperature and pressure range without causing changes in specified performance.


## BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES

**FIGURE 7. DIP PACKAGE DIMENSIONAL DRAWINGS (FOR REFERENCE ONLY: MM [IN].)**

**DIP NN:** Plastic no port

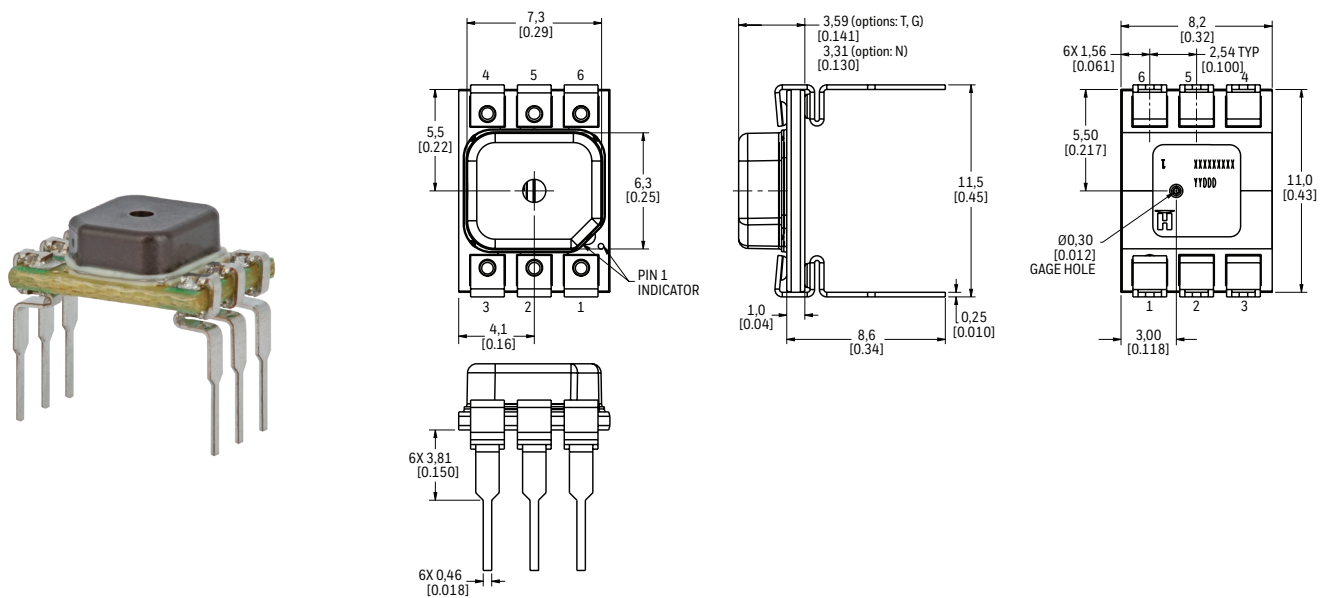


**DIP AN:** Plastic single axial barbed port

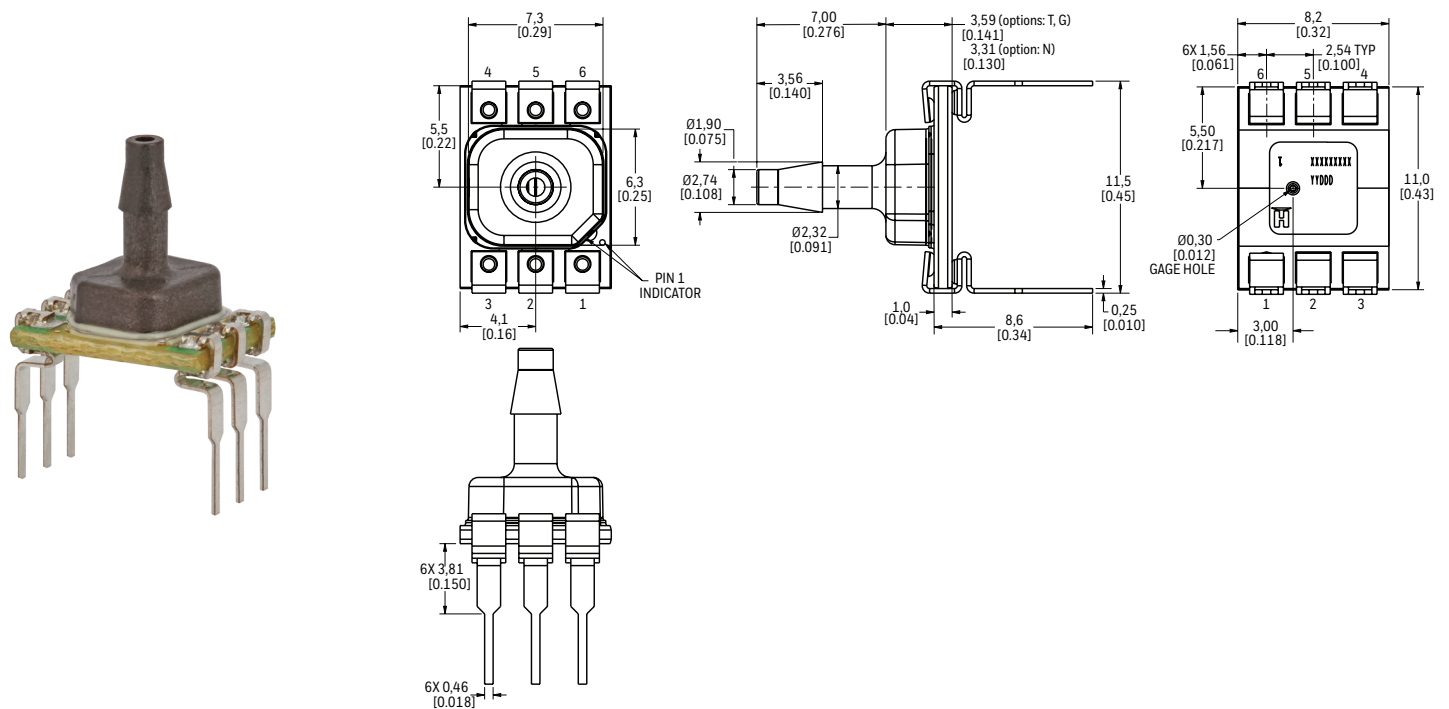


BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES

FIGURE 7. DIP PACKAGE DIMENSIONAL DRAWINGS (CONTINUED)

DIP VN: Metal single axial barbless port

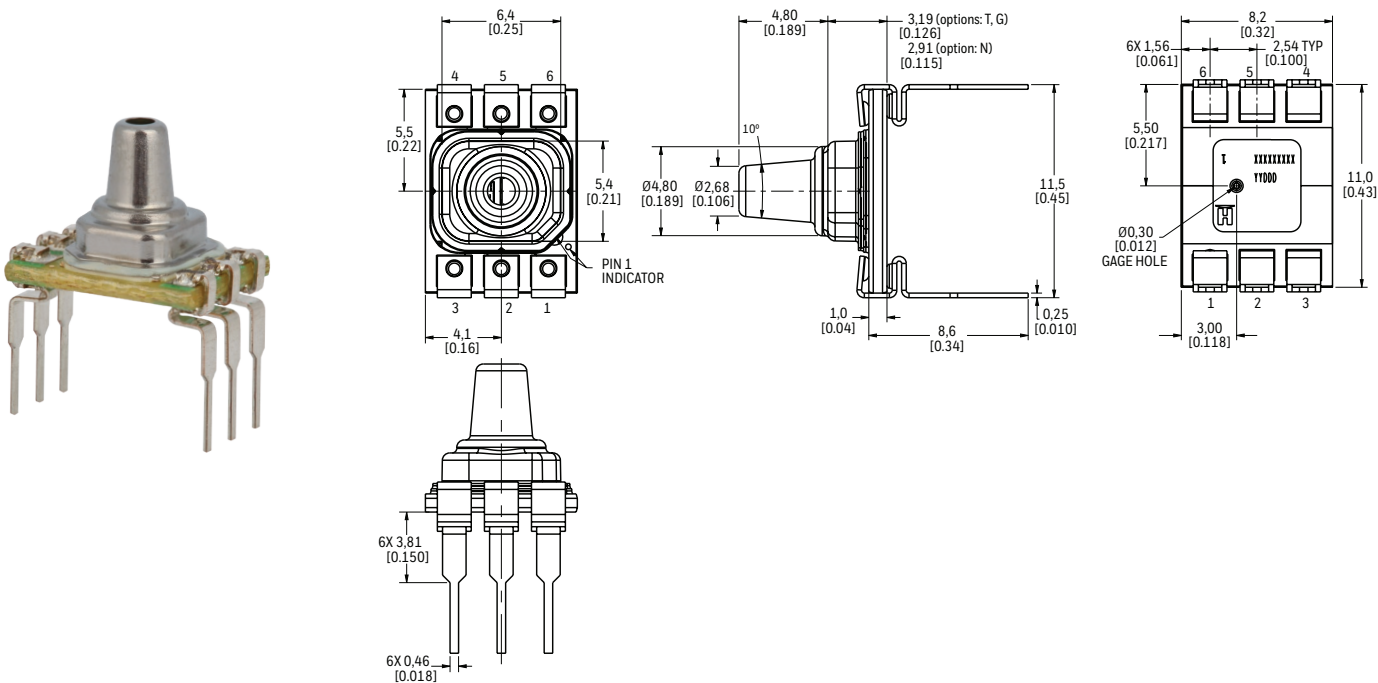


DIP SN: Metal single axial straight barbless port

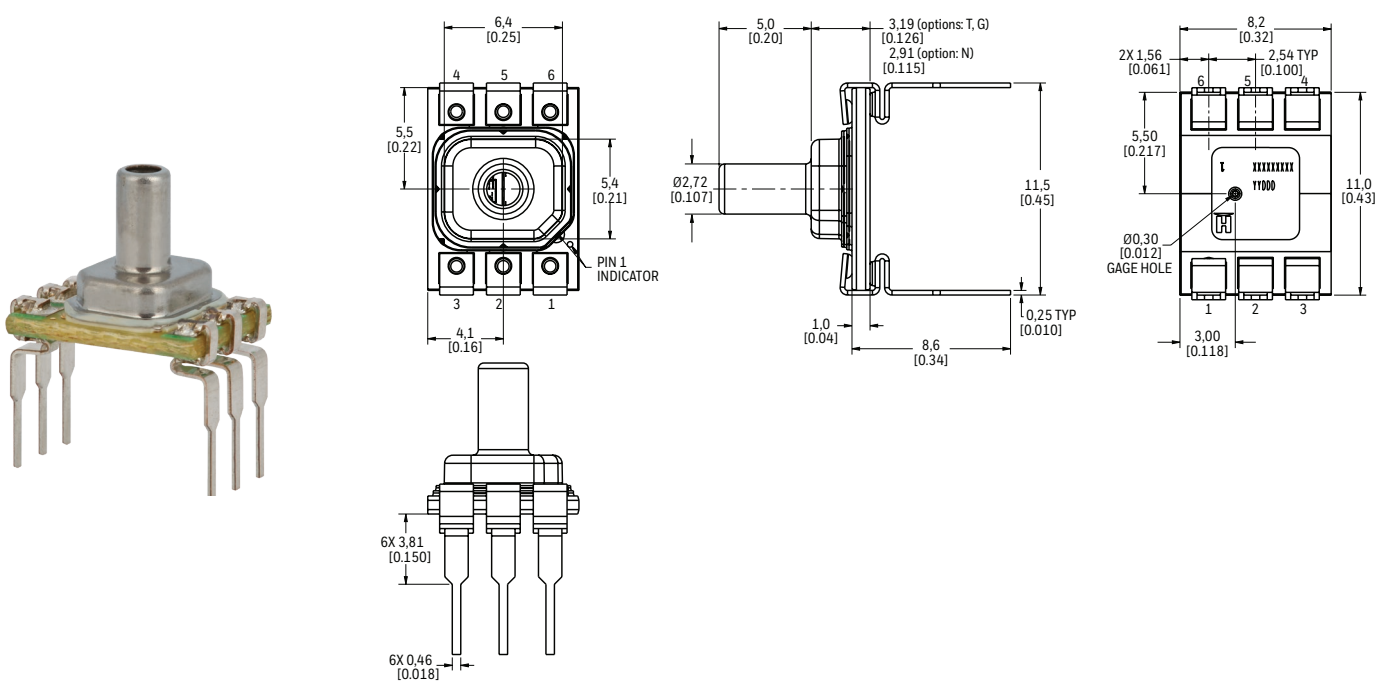


# BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES

**FIGURE 7. DIP PACKAGE DIMENSIONAL DRAWINGS (CONTINUED)**


**DIP RN:** Plastic single radial barbed port

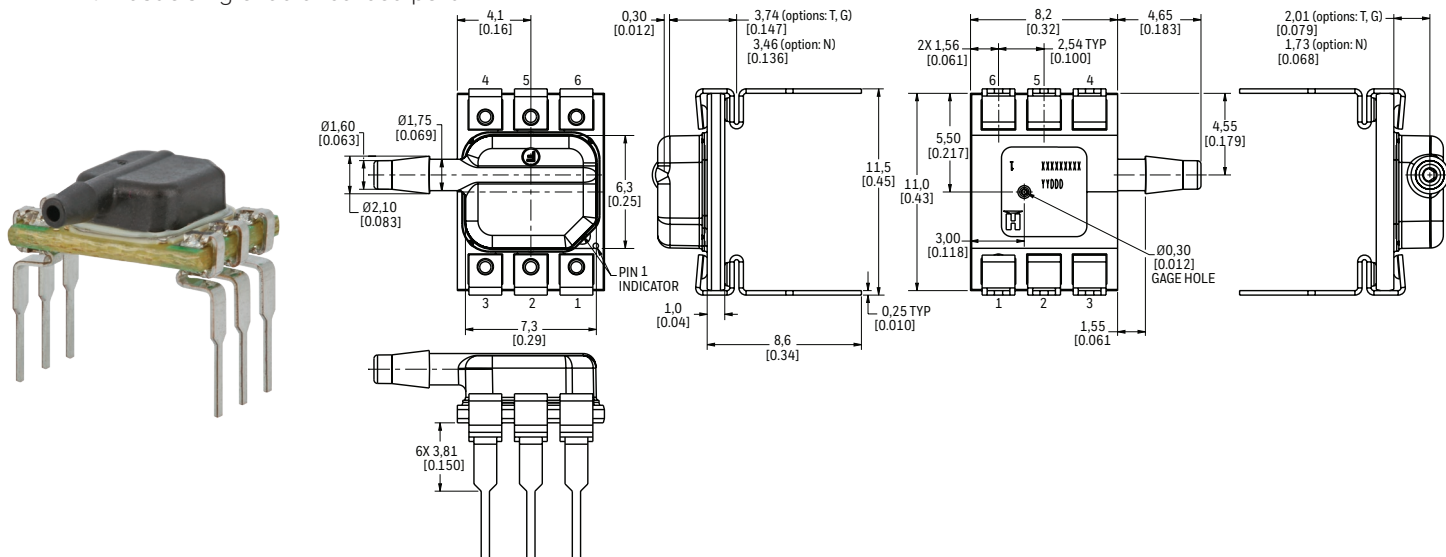

**DIP RR:** Plastic dual radial barbed ports, same side

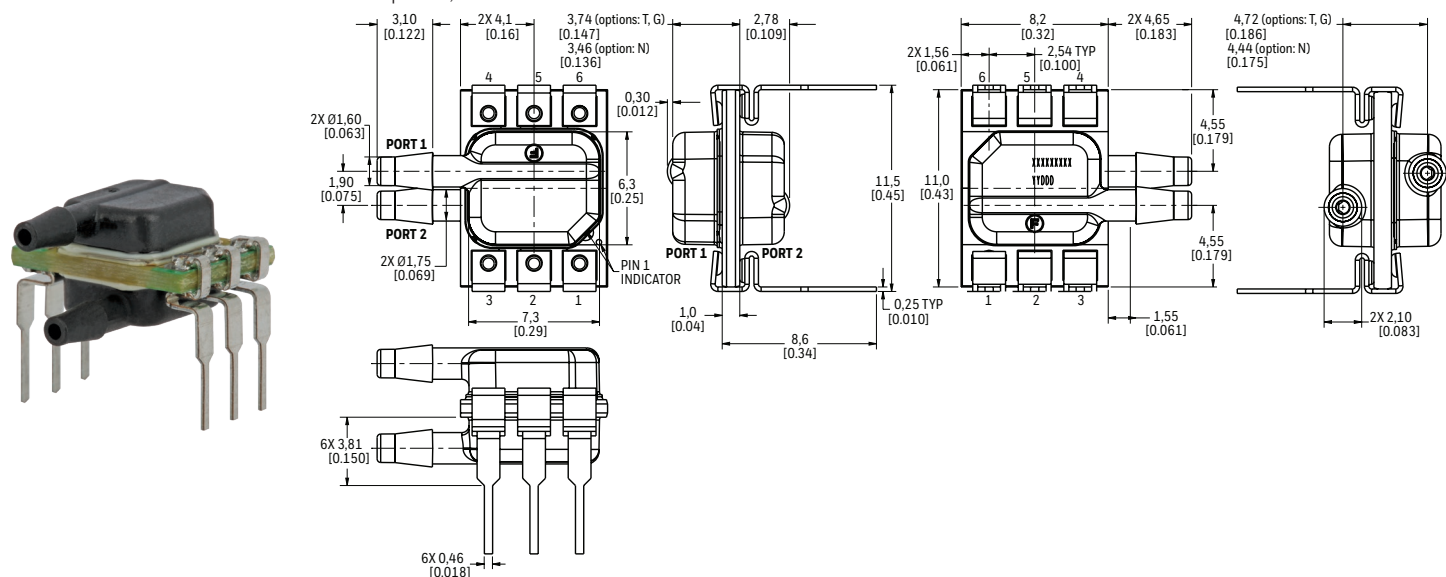


**DIP DA:** Plastic dual axial barbed ports, same side

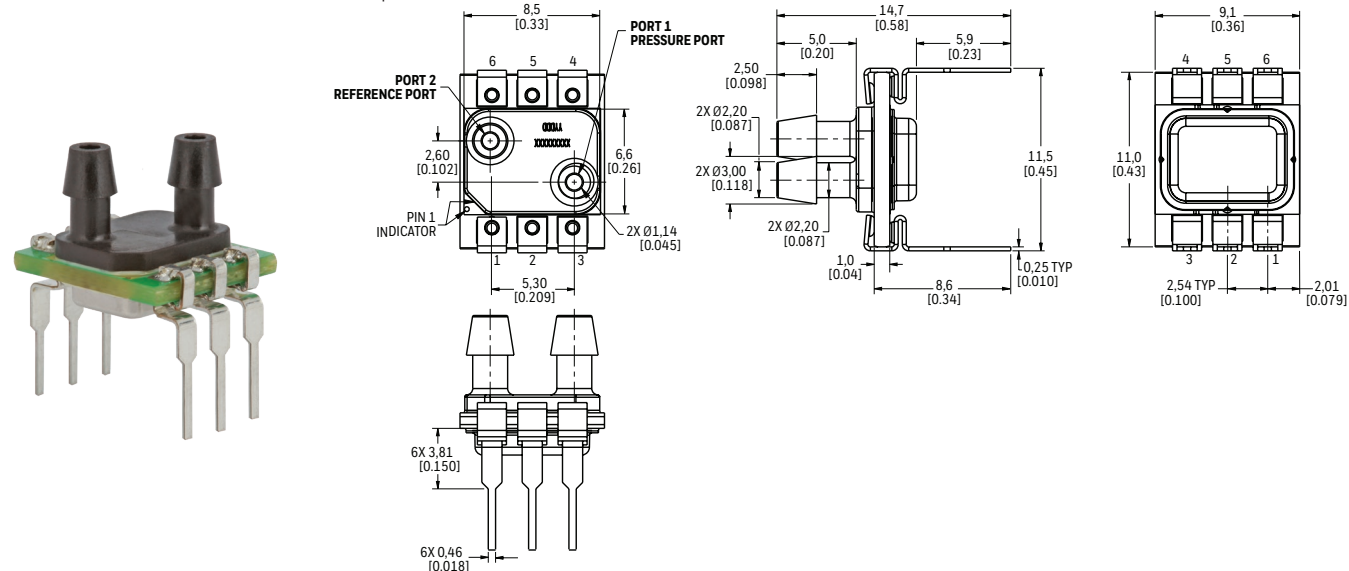


# BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES

**FIGURE 8. SMT PACKAGE DIMENSIONAL DRAWINGS (FOR REFERENCE ONLY: MM [IN].)**


**SMT NN:** Plastic no port

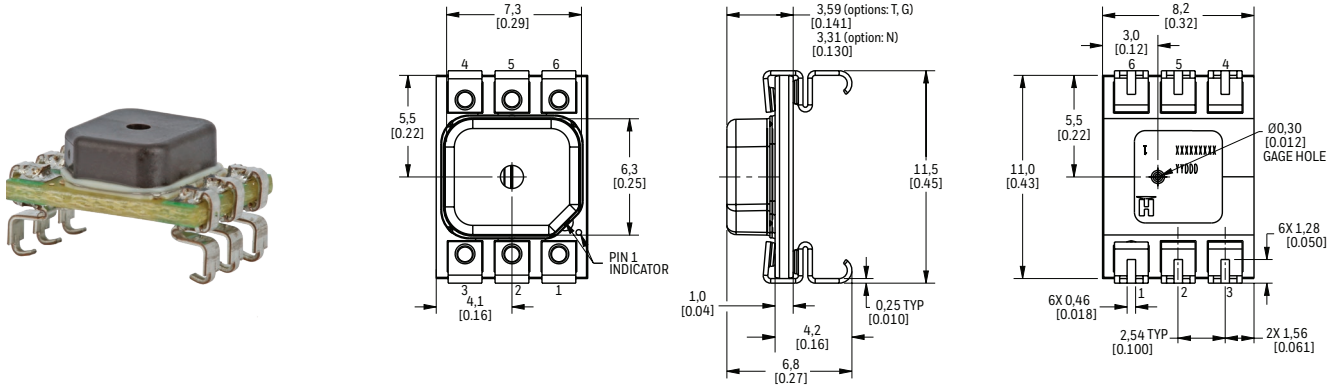


**SMT AN:** Plastic single axial barbed port

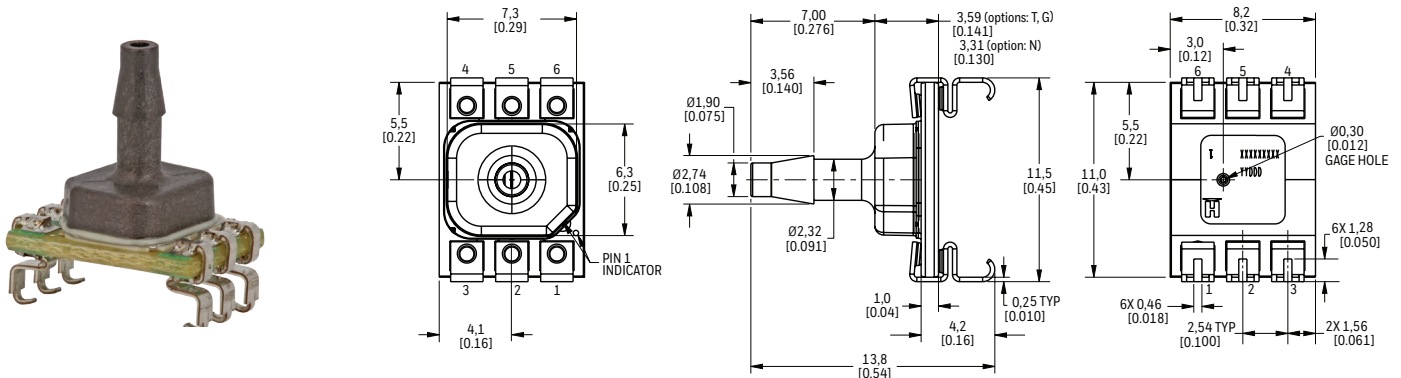

**SMT VN:** Metal single axial barbless port

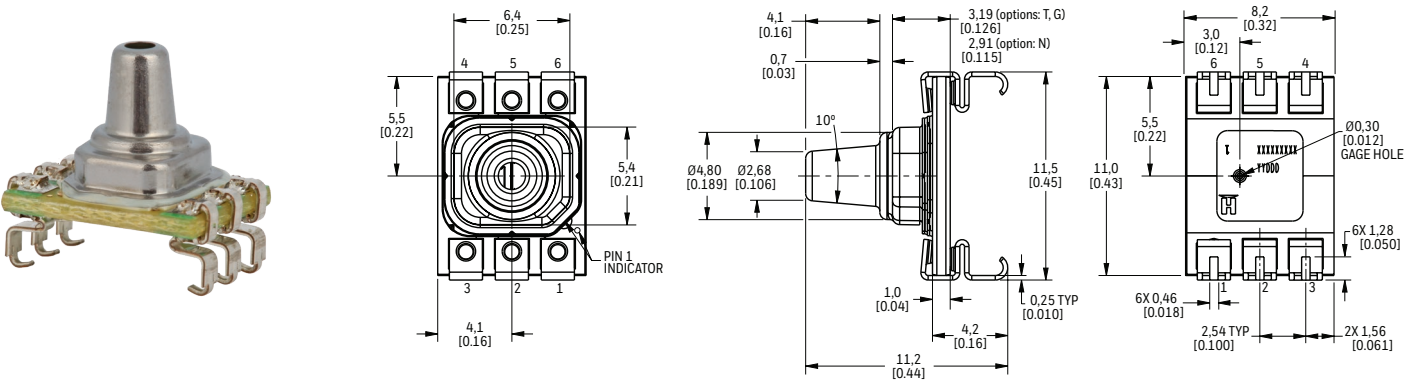


**SMT SN:** Metal single axial straight barbless port

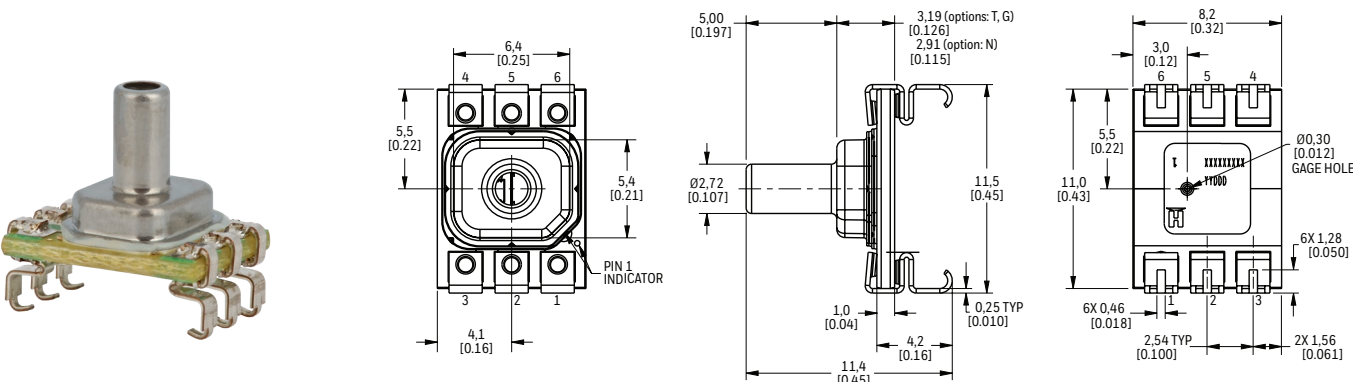


# BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES

**FIGURE 8. SMT PACKAGE DIMENSIONAL DRAWINGS (CONTINUED)**


**SMT RN:** Plastic single radial barbed port

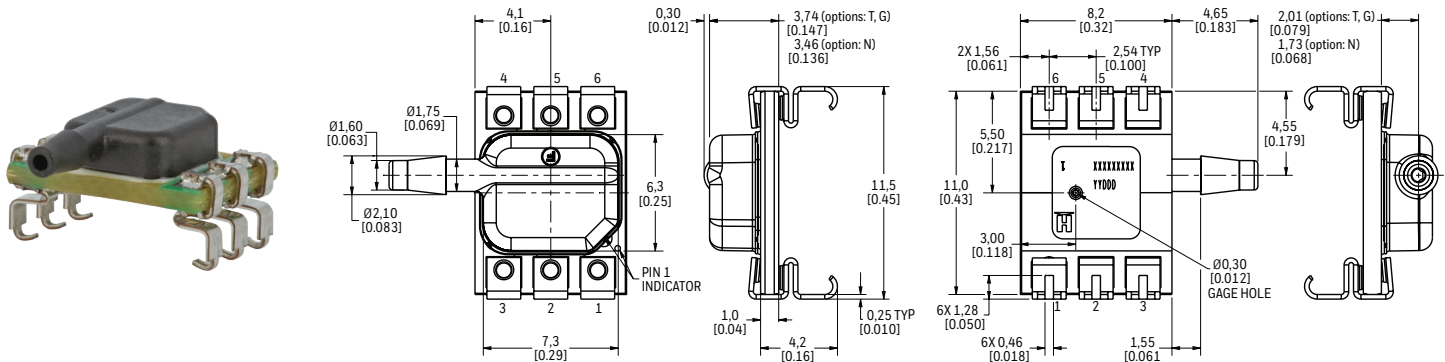

**SMT RR:** Plastic dual radial barbed ports, same side

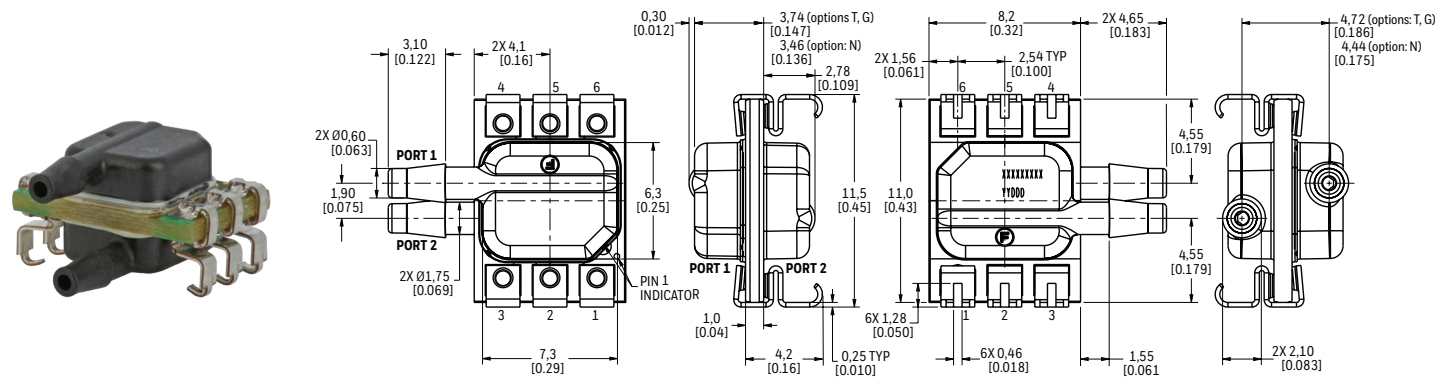


**SMT DA:** Plastic dual axial barbed ports, same side

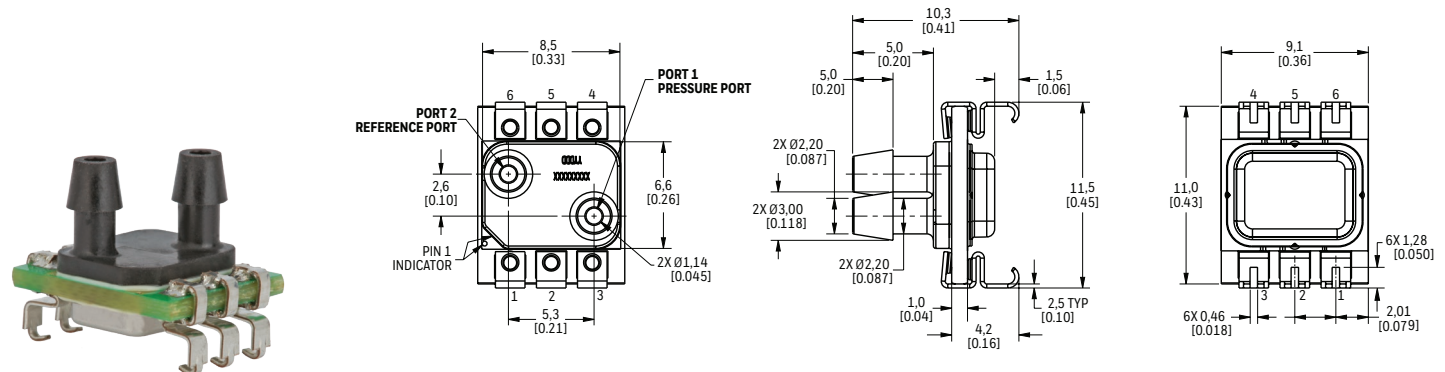


# BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES

FIGURE 9. LEADLESS SMT PACKAGE DIMENSIONAL DRAWINGS (FOR REFERENCE ONLY: MM [IN].)


LEADLESS SMT NN: Plastic no port

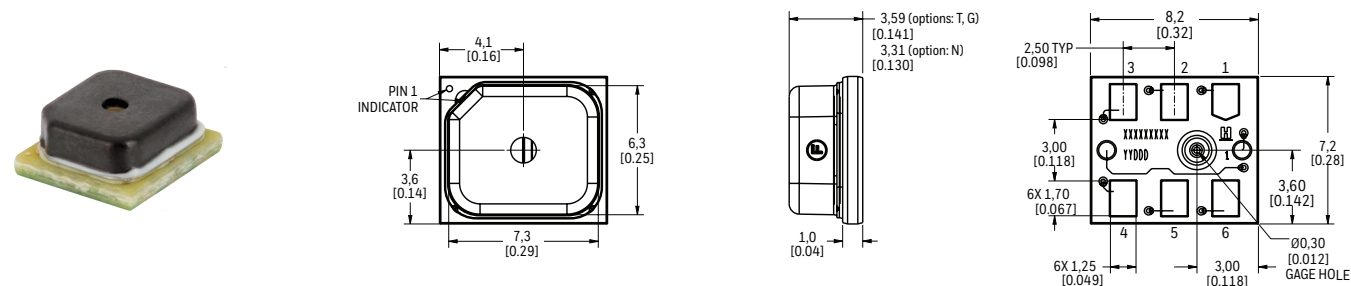


LEADLESS SMT AN: Plastic single axial barbed port

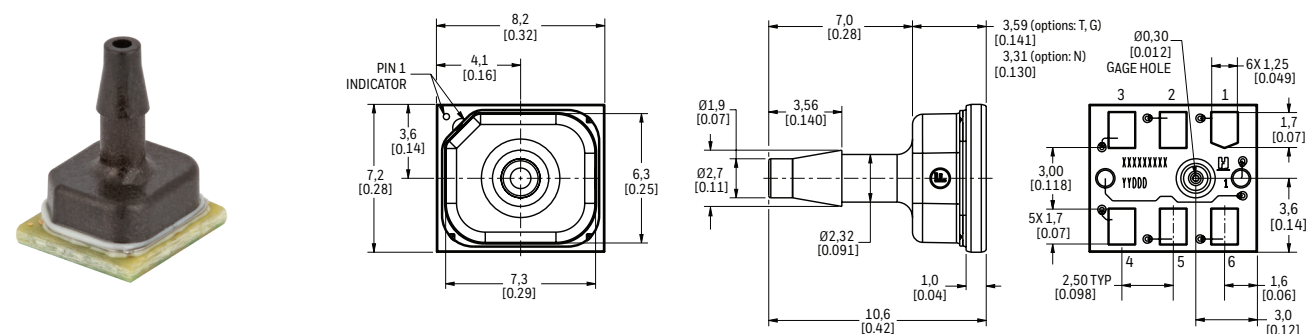

LEADLESS SMT VN: Metal single axial barbless port

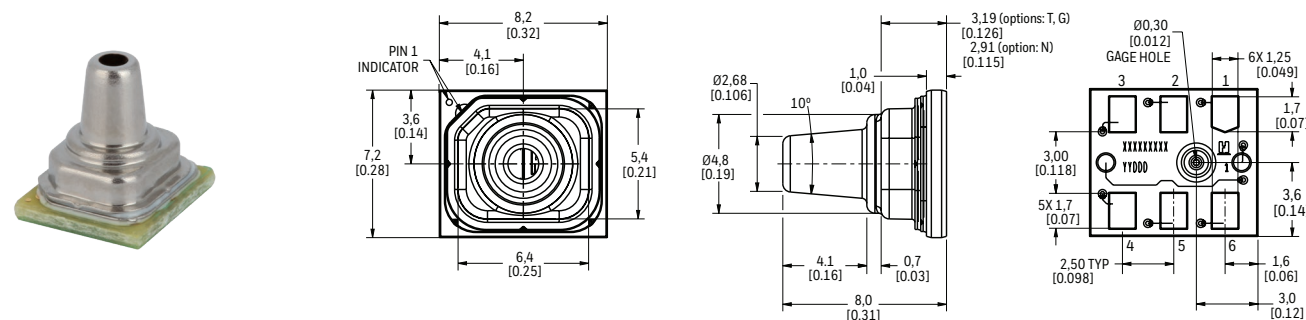


LEADLESS SMT SN: Metal single axial straight port

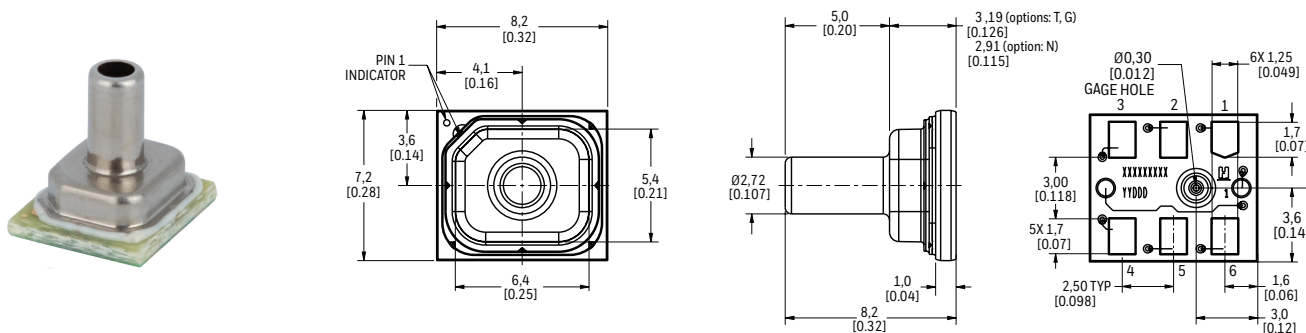


BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES

| TABLE 18. PINOUT |       |                 |       |       |       |       |
|------------------|-------|-----------------|-------|-------|-------|-------|
| OUTPUT TYPE      | PIN 1 | PIN 2           | PIN 3 | PIN 4 | PIN 5 | PIN 6 |
| I <sup>2</sup> C | GND   | V <sub>DD</sub> | EOC   | NC    | SDA   | SCL   |
| SPI              | GND   | V <sub>DD</sub> | MISO  | SS    | MOSI  | SCLK  |

FIGURE 10. RECOMMENDED PCB LAYOUT AND PART MARKING DETAILS

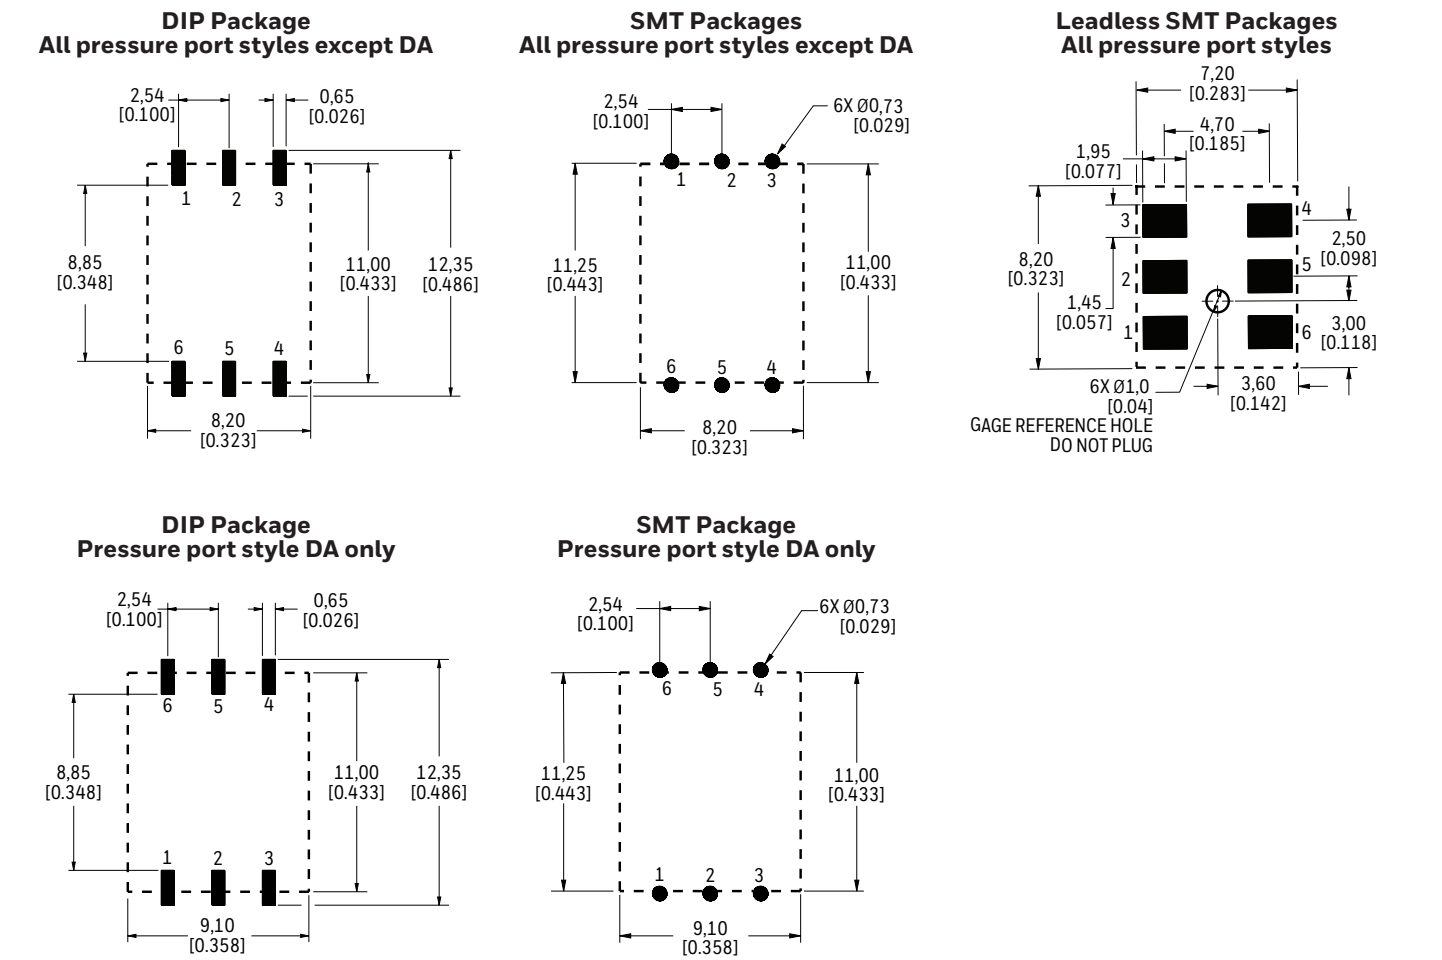

Part Marking Details

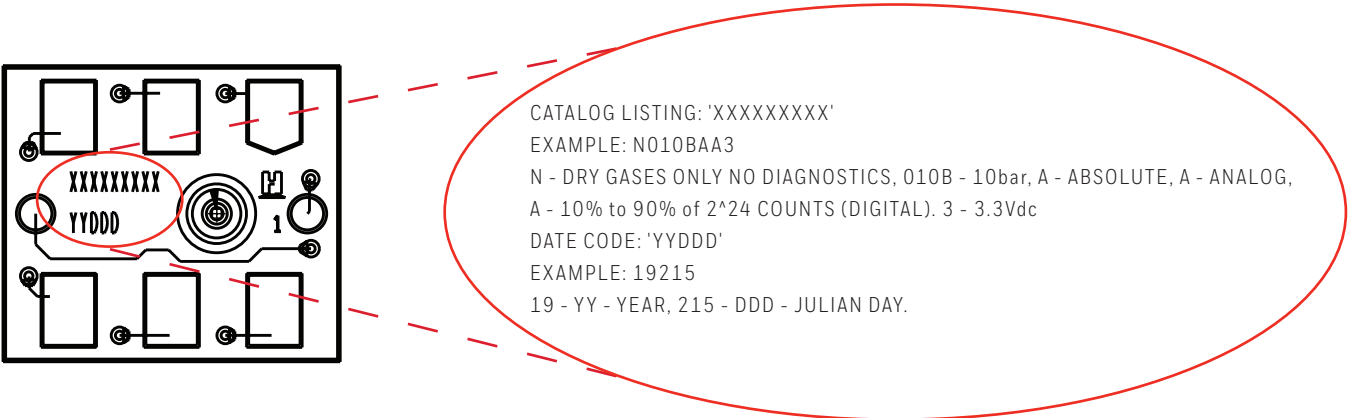

# BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES

## 1.0 GENERAL INFORMATION

Please see Figures 7, 8, and 9 for product dimensions and pinout details.

## 2.0 PINOUT AND FUNCTIONALITY (SEE TABLE 19.)

| TABLE 19. PINOUT AND FUNCTIONALITY |                         |                                                                                                                                                  |                 |                                   |
|------------------------------------|-------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------|-----------------|-----------------------------------|
| PAD NUMBER                         | I <sup>2</sup> C SENSOR |                                                                                                                                                  | SPI SENSOR      |                                   |
|                                    | NAME                    | DESCRIPTION                                                                                                                                      | NAME            | DESCRIPTION                       |
| 1                                  | GND                     | Ground reference voltage signal                                                                                                                  | GND             | Ground reference voltage signal   |
| 2                                  | V <sub>DD</sub>         | Positive supply voltage                                                                                                                          | V <sub>DD</sub> | Positive supply voltage           |
| 3                                  | EOC <sup>1</sup>        | End-of-conversion indicator: This pin is set high when a measurement and calculation have been completed and the data is ready to be clocked out | MISO            | Master In/Sensor Out: Data output |
| 4                                  | NC                      | No connection                                                                                                                                    | SS              | Sensor Select: Chip select        |
| 5                                  | SDA                     | Data in/out                                                                                                                                      | MOSI            | Master Out/Sensor In: Data in     |
| 6                                  | SCL                     | Clock input                                                                                                                                      | SCLK            | Clock input                       |

<sup>1</sup> For more details on EOC functionality, please refer to the technical note.

## 3.0 START-UP TIMING

On power-up, the ABP2 Series digital sensor is able to receive the first command after 2.5 ms from when the V<sub>DD</sub> supply is within operating specifications.

## 4.0 POWER SUPPLY REQUIREMENT

Verify that system power to the sensor meets the V<sub>DD</sub> rising slope requirement (minimum V<sub>DD</sub> rising slope is at least 10 V/ms).

# BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES

## 5.0 REFERENCE CIRCUIT DESIGN

### 5.1 I<sup>2</sup>C and SPI Circuit Diagrams (See Figures 11 and 12.)

FIGURE 11. I<sup>2</sup>C CIRCUIT DIAGRAM


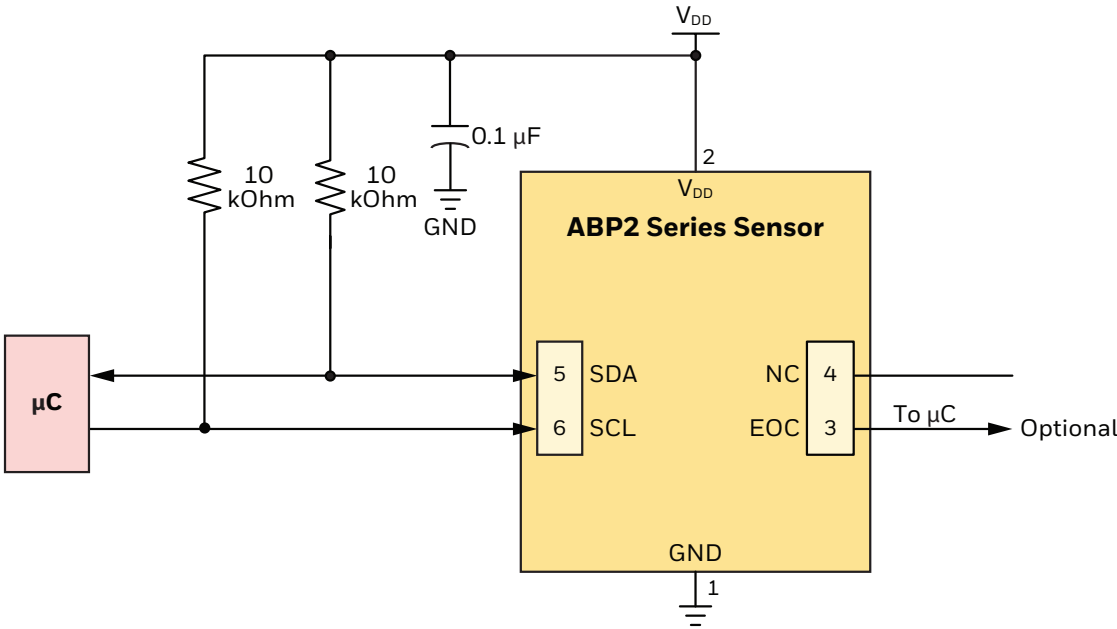


FIGURE 12. SPI CIRCUIT DIAGRAM

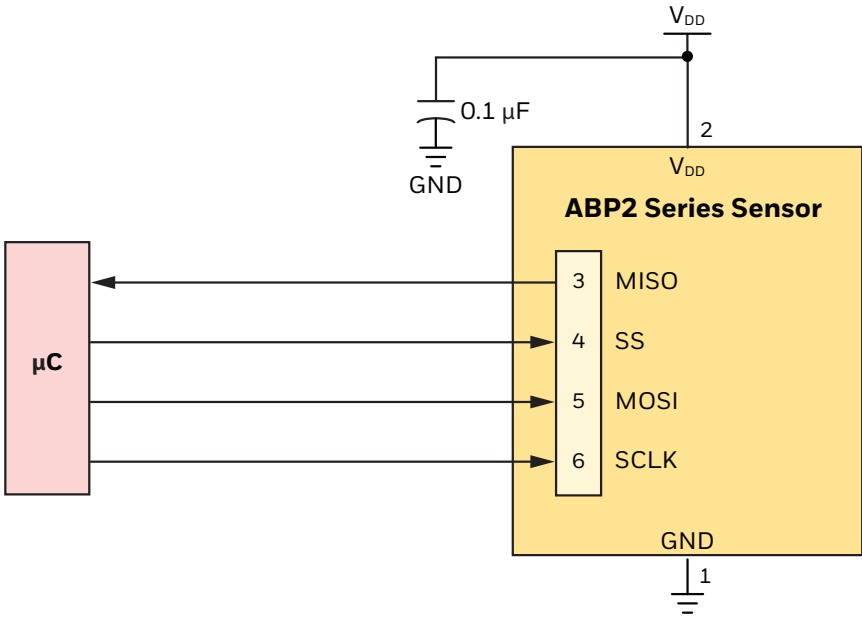

### 5.2 Bypass Capacitor Use

#### NOTICE

To ensure output noise suppression, place an external bypass capacitor of 0.1 μF very close to the sensor power supply pin (see Figures 11 and 12) in the end-user design.

# BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES

## 6.0 I<sup>2</sup>C COMMUNICATIONS


### 6.1 I<sup>2</sup>C Bus Configuration (See Figure 13.)

The I<sup>2</sup>C bus is a simple, serial 8-bit oriented computer bus for efficient I<sup>2</sup>C (Inter-IC) control. It provides good support for communication between different ICs across short circuit-board distances, such as interfacing microcontrollers with various low speed peripheral devices. For detailed specifications of the I<sup>2</sup>C protocol, see Version 6 (April 2014) of the I<sup>2</sup>C Bus Specification (source: NXP Semiconductor at <https://www.nxp.com/docs/en/user-guide/UM10204.pdf>).

Each device connected to the bus is software addressable by a unique address and a simple Master/Sensor relationship that exists at all times. The output stages of devices connected to the bus are designed around an open collector architecture. Because of this, pull-up resistors to +V<sub>DD</sub> must be provided on the bus. Both SDA and SCL are bidirectional lines, and it is important to system performance to match the capacitive loads on both lines. In addition, in accordance with the I<sup>2</sup>C specification, the maximum allowable capacitance on either line is 400 pF to ensure reliable edge transitions at 400 kHz clock speeds.

When the bus is free, both lines are pulled up to +V<sub>DD</sub>. Data on the I<sup>2</sup>C bus can be transferred at a rate up to 100 kbit/s in the standard-mode, or up to 400 kbit/s in the fast-mode.

**FIGURE 13. I<sup>2</sup>C BUS CONFIGURATION**

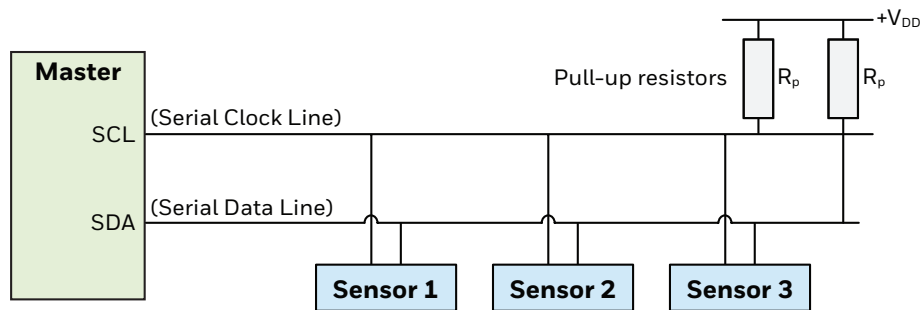

### 6.2 I<sup>2</sup>C Data Transfer

The ABP2 Series I<sup>2</sup>C sensors are designed to respond to requests from a Master device. Following the address and read bit from the Master, the ABP2 Series digital output pressure sensors are designed to output up to 7 bytes of data. The first data byte is the Status Byte (8 bit), the second to fourth bytes are the compensated pressure output (24 bit) and the fifth to seventh bytes are the compensated temperature output (24 bit).

### 6.3 I<sup>2</sup>C Sensor Address

Each ABP2 Series I<sup>2</sup>C sensor is referenced on the bus by a 7-bit Sensor address. The default address for the ABP2 Series is 40 (28 hex). Other available standard addresses are: 08 (08 hex), 24 (18 hex), 56 (38 hex), 72 (48 hex), 88 (58 hex), 104 (68 hex), 120 (78 hex). (Other custom values are available. Please contact Honeywell Customer Service with questions regarding custom Sensor addresses.)

### 6.4 I<sup>2</sup>C Pressure and Temperature Reading

To read out the compensated pressure and temperature reading, the Master generates a START condition and sends the Sensor address followed by a read bit (1). After the Sensor generates an acknowledge, it will transmit up to 7 bytes of data. The first data byte is the Status Byte (8-bit) and the second to fourth bytes are the compensated pressure output (24 bit) and the fifth to seventh bytes are the compensated temperature output (24 bit). The Master must acknowledge the receipt of each byte, and can terminate the communication by sending a Not Acknowledge (NACK) bit followed by a Stop bit after receiving the required bytes of data.

# BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES

## 6.5 I<sup>2</sup>C Status Byte (See Table 20.)

**TABLE 20. I<sup>2</sup>C STATUS BYTE EXPLANATION**





| BIT (MEANING)                   | STATUS                                                 | COMMENT                                                                                                                                             |
|---------------------------------|--------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------|
| 7                               | always 0                                               | —                                                                                                                                                   |
| 6 (Power indication)            | 1 = device is powered<br>0 = device is not powered     | —                                                                                                                                                   |
| 5 (Busy flag)                   | 1 = device is busy                                     | Indicates that the data for the last command is not yet available. No new commands are processed if the device is busy.                             |
| 4                               | always 0                                               | —                                                                                                                                                   |
| 3                               | always 0                                               | —                                                                                                                                                   |
| 2 (Memory integrity/error flag) | 0 = integrity test passed<br>1 = integrity test failed | Indicates whether the checksum-based integrity check passed or failed; the memory error status bit is calculated only during the power-up sequence. |
| 1                               | always 0                                               | —                                                                                                                                                   |
| 0 (Math saturation)             | 1 = internal math saturation has occurred              | —                                                                                                                                                   |

## 6.6 I<sup>2</sup>C Communications

### 6.6.1 I<sup>2</sup>C Output Measurement Command

To communicate with the ABP2 Series I<sup>2</sup>C output sensor using an Output Measurement Command of “0xAA”, followed by “0x00” “0x00”, follow the steps shown in Table 21. This command will cause the device to exit Standby Mode and enter Operating Mode. At the conclusion of the measurement cycle, the device will automatically re-enter Standby Mode.

**TABLE 21. I<sup>2</sup>C OUTPUT MEASUREMENT COMMAND**
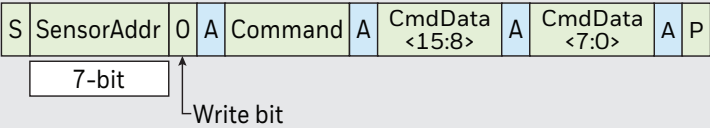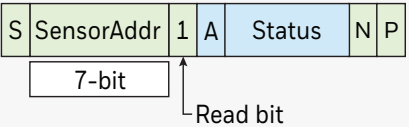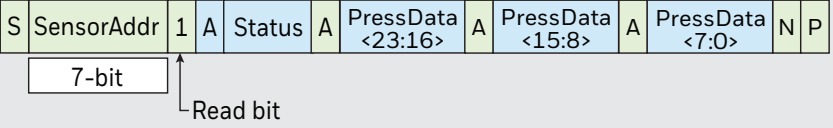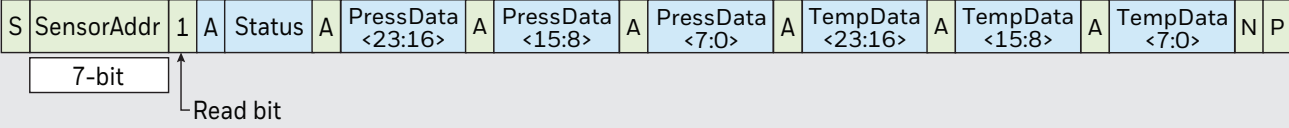
| STEP | ACTION                                                                                                                                                                                                                                                                                                                                                                                               | NOTES                                                                                                                                                                                |
|------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 1    |  <p>Write bit</p>                                                                                                                                                                                                                                                                                                 |  <p>Master to Sensor</p> <p>Sensor to Master</p>                                                |
| 2    | <p><b>Option 1:</b> Wait until the busy flag in the Status Byte clears.</p> <p><b>Option 2:</b> Wait for at least 5 ms for the data conversion to occur.</p> <p><b>Option 3:</b> Wait for the EOC indicator.</p>  <p>Read bit</p>                                                                                 |  <p>S Start condition</p> <p>P Stop condition</p> <p>A Acknowledge</p> <p>N Not acknowledge</p> |
| 3    | <p>To read only the 24-bit pressure output along with the 8-bit Status Byte:</p>  <p>Read bit</p> <p>To read the 24-bit pressure output and 24-bit temperature output along with the 8-bit Status Byte:</p>  <p>Read bit</p> |                                                                                                                                                                                      |

## BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES

### 6.6.2 I<sup>2</sup>C Sensor Address of 0x28


To communicate with the ABP2 Series I<sup>2</sup>C output sensor with an I<sup>2</sup>C Sensor Address of 0x28 (hex), follow the steps shown in Table 22.

**TABLE 22. I<sup>2</sup>C SENSOR ADDRESS OF 0X28 COMMUNICATIONS**

| STEP | ACTION                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      | NOTES                                                                                                                                                                  |
|------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 1    | <div> <div>0x28   0</div> <div> <div>S</div> <div>SensorAddr</div> <div>0</div> <div>A</div> <div>Command</div> <div>A</div> <div>CmdData &lt;15:8&gt;</div> <div>A</div> <div>CmdData &lt;7:0&gt;</div> <div>A</div> <div>P</div> </div> <div>0x50</div> <div>0xAA</div> <div>0x00</div> <div>0x00</div> </div> <p>Write bit</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           | <div>Master to Sensor</div> <div>Sensor to Master</div> <div>S Start condition</div> <div>P Stop condition</div> <div>A Acknowledge</div> <div>N Not acknowledge</div> |
| 2    | <div> <div>0x28   1</div> <div> <div>S</div> <div>SensorAddr</div> <div>1</div> <div>A</div> <div>Status</div> <div>N</div> <div>P</div> </div> <div>0x51</div> </div> <p>Read bit</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |                                                                                                                                                                        |
| 3    | <p>To read the 24-bit pressure output along with the 8-bit Status Byte:</p> <div> <div>0x28   1</div> <div> <div>S</div> <div>SensorAddr</div> <div>1</div> <div>A</div> <div>Status</div> <div>A</div> <div>PressData &lt;23:16&gt;</div> <div>A</div> <div>PressData &lt;15:8&gt;</div> <div>A</div> <div>PressData &lt;7:0&gt;</div> <div>N</div> <div>P</div> </div> <div>0x51</div> </div> <p>Read bit</p> <p>To read the 24-bit pressure output and the 24-bit temperature output along with the 8-bit Status Byte:</p> <div> <div>0x28   1</div> <div> <div>S</div> <div>SensorAddr</div> <div>1</div> <div>A</div> <div>Status</div> <div>A</div> <div>PressData &lt;23:16&gt;</div> <div>A</div> <div>PressData &lt;15:8&gt;</div> <div>A</div> <div>PressData &lt;7:0&gt;</div> <div>A</div> <div>TempData &lt;23:16&gt;</div> <div>A</div> <div>TempData &lt;15:8&gt;</div> <div>A</div> <div>TempData &lt;7:0&gt;</div> <div>N</div> <div>P</div> </div> <div>0x51</div> </div> <p>Read bit</p> |                                                                                                                                                                        |

### 6.7 I<sup>2</sup>C Timing and Level Parameters (See Table 23.)

**TABLE 23. I<sup>2</sup>C BUS TIMING DIAGRAM AND PARAMETERS**

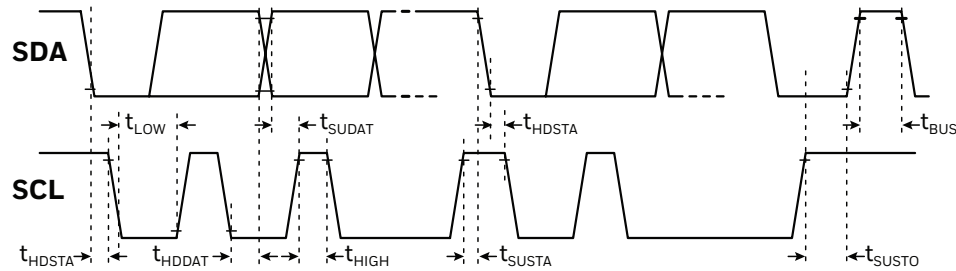

| CHARACTERISTIC                                           | ABBREVIATION | MIN. | TYP. | MAX. | UNIT     |
|----------------------------------------------------------|--------------|------|------|------|----------|
| SCL clock frequency                                      | $f_{SCL}$    | 100  | —    | 400  | kHz      |
| Start condition hold time relative to SCL edge           | $t_{HDSTA}$  | 0.1  | —    | —    | $\mu s$  |
| Minimum SCL clock low width <sup>1</sup>                 | $t_{LOW}$    | 0.6  | —    | —    | $\mu s$  |
| Minimum SCL clock high width <sup>1</sup>                | $t_{HIGH}$   | 0.6  | —    | —    | $\mu s$  |
| Start condition setup time relative to SCL edge          | $t_{SUSTA}$  | 0.1  | —    | —    | $\mu s$  |
| Data hold time on SDA relative to SCL edge               | $t_{HDDAT}$  | 0    | —    | —    | $\mu s$  |
| Data setup time on SDA relative to SCL edge              | $t_{SUDAT}$  | 0.1  | —    | —    | $\mu s$  |
| Stop condition setup time on SCL                         | $t_{SUSTO}$  | 0.1  | —    | —    | $\mu s$  |
| Bus free time between stop condition and start condition | $t_{BUS}$    | 2    | —    | —    | $\mu s$  |
| Output level low                                         | $Out_{low}$  | —    | 0    | 0.2  | $V_{DD}$ |
| Output level high                                        | $Out_{high}$ | 0.8  | 1    | —    | $V_{DD}$ |
| Pull-up resistance on SDA and SCL                        | $R_p$        | 1    | —    | 50   | kOhm     |

<sup>1</sup> Combined low and high widths must equal or exceed minimum SCL period.

# BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES

## 6.8 Reference Code (Arduino/Genuino Uno) for I<sup>2</sup>C Interface

See also Section 8.0 for details and examples of ABP2 Series Pressure and Temperature output calculations.

```
#include<Arduino.h>
#include<Wire.h>

uint8_t id = 0x28; // i2c address
uint8_t data[7]; // holds output data
uint8_t cmd[3] = {0xAA, 0x00, 0x00}; // command to be sent
double press_counts = 0; // digital pressure reading [counts]
double temp_counts = 0; // digital temperature reading [counts]
double pressure = 0; // pressure reading [bar, psi, kPa, etc.]
double temperature = 0; // temperature reading in deg C
double outputmax = 15099494; // output at maximum pressure [counts]
double outputmin = 1677722; // output at minimum pressure [counts]
double pmax = 1; // maximum value of pressure range [bar, psi, kPa, etc.]
double pmin = 0; // minimum value of pressure range [bar, psi, kPa, etc.]
double percentage = 0; // holds percentage of full scale data
char printBuffer[200], cBuff[20], percBuff[20], pBuff[20], tBuff[20];
void setup() {
    Serial.begin(9600);
    while (!Serial) {
        delay(10);
    }
    Wire.begin();
    sprintf(printBuffer, "\nStatus Register, 24 - bit Sensor data, Digital Pressure Counts,\n\nPercentage of full scale pressure, Pressure Output, Temperature\n");
    Serial.println(printBuffer);
}
void loop() {
    Wire.beginTransmission(id);
    int stat = Wire.write (cmd, 3); // write command to the sensor
    stat |= Wire.endTransmission();
    delay(10);
    Wire.requestFrom(id, 7); // read back Sensor data 7 bytes
    int i = 0;
    for (i = 0; i < 7; i++) {
        data [i] = Wire.read();
    }
    press_counts = data[3] + data[2] * 256 + data[1] * 65536; // calculate digital pressure counts
    temp_counts = data[6] + data[5] * 256 + data[4] * 65536; // calculate digital temperature counts
    temperature = (temp_counts * 200 / 16777215) - 50; // calculate temperature in deg c
    percentage = (press_counts / 16777215) * 100; // calculate pressure as percentage of full scale
    //calculation of pressure value according to equation 2 of datasheet
    pressure = ((press_counts - outputmin) * (pmax - pmin)) / (outputmax - outputmin) + pmin;
    dtostrf(press_counts, 4, 1, cBuff);
    dtostrf(percentage, 4, 3, percBuff);
    dtostrf(pressure, 4, 3, pBuff);
    dtostrf(temperature, 4, 3, tBuff);
    /*
    The below code prints the raw data as well as the processed data
    Data format : Status Register, 24-bit Sensor Data, Digital Counts, percentage of full scale
    pressure,
    pressure output, temperature
    */
    sprintf(printBuffer, " %x\t%2x%2x%2x\t%s\t%s\t%s\t%s\n", data[0], data[1], data[2],
        data[3],
        cBuff, percBuff, pBuff, tBuff);
    Serial.print(printBuffer);
    delay(10);
}
```


# BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES

## 7.0 SPI COMMUNICATIONS

### 7.1 SPI Definition

The Serial Peripheral Interface (SPI) is a simple bus system for synchronous serial communication between one Master and one or more Sensors. It operates either in full-duplex or half-duplex mode, allowing communication to occur in either both directions simultaneously, or in one direction only. The Master device initiates an information transfer on the bus and generates clock and control signals. Sensor devices are controlled by the Master through individual Sensors Select (SS) lines and are active only when selected. The ABP2 Series SPI sensors operate in full-duplex mode only, with data transfer from the Sensors to the Master. This data transmission uses four, unidirectional bus lines. The Master controls SCLK, MOSI and SS; the Sensor controls MISO. (See Figure 14.)


FIGURE 14. SPI BUS CONFIGURATION

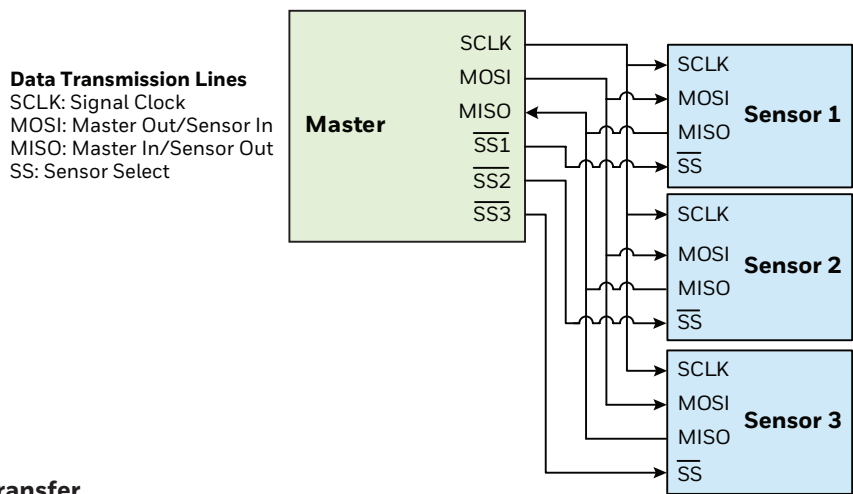

### 7.2 SPI Data Transfer

Communicate with the ABP2 Series SPI sensors by de-asserting the Sensor Select (SS) line. At this point, the sensor is no longer idle, and will begin sending data once a clock is received. ABP2 Series SPI sensors are configured for SPI operation in mode 0 (clock polarity is 0 and clock phase is 0). (See Figure 15.)

FIGURE 15. EXAMPLE OF 1 BYTE SPI DATA TRANSFER

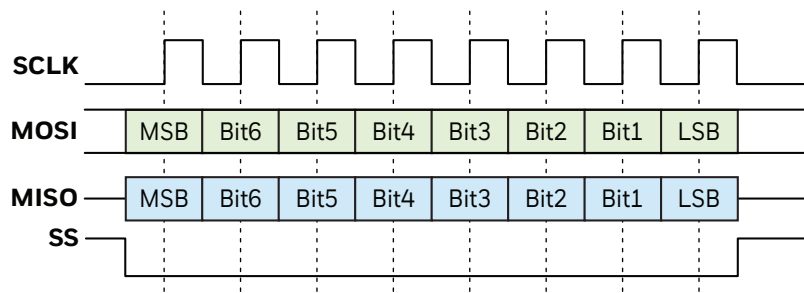

Once the clocking begins, the ABP2 Series SPI sensor is designed to output up to 7 bytes of data. The first data byte is the Status Byte (8-bit), the second to fourth bytes are the compensated pressure output (24-bit) and the fifth to seventh bytes are the compensated temperature output (24-bit).

### 7.3 SPI Pressure and Temperature Reading

To read out the compensated pressure and temperature reading, the Master generates the necessary clock signal after activating the sensor with the Sensor Select (SS) line. The sensor will transmit up to 7 bytes of data. The first data byte is the Status Byte (8-bit), the second to fourth bytes are the compensated pressure output (24-bit) and the fifth to seventh bytes are the compensated temperature output (24-bit). The Master can terminate the communication by stopping the clock and deactivating the SS line.

# BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES

## 7.4 SPI Status Byte

The SPI status byte contains the bits shown in Table 24.

| TABLE 24. SPI STATUS BYTE EXPLANATION |                                                        |                                                                                                                                                     |
|---------------------------------------|--------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------|
| BIT (MEANING)                         | STATUS                                                 | COMMENT                                                                                                                                             |
| 7                                     | always 0                                               | —                                                                                                                                                   |
| 6 (Power indication)                  | 1 = device is powered<br>0 = device is not powered     | —                                                                                                                                                   |
| 5 (Busy flag)                         | 1 = device is busy                                     | Indicates that the data for the last command is not yet available. No new commands are processed if the device is busy.                             |
| 4                                     | always 0                                               | —                                                                                                                                                   |
| 3                                     | always 0                                               | —                                                                                                                                                   |
| 2 (Memory integrity/error flag)       | 0 = integrity test passed<br>1 = integrity test failed | Indicates whether the checksum-based integrity check passed or failed; the memory error status bit is calculated only during the power-up sequence. |
| 1                                     | always 0                                               | —                                                                                                                                                   |
| 0 (Math saturation)                   | 1 = internal math saturation has occurred              | —                                                                                                                                                   |

## 7.5 SPI Communication


To communicate with the ABP2 Series SPI output sensor using an Output Measurement Command of “0xAA”, followed by “0x00” “0x00”, follow the steps shown in Table 25. This command will cause the device to exit Standby Mode and enter Operating Mode. At the conclusion of the measurement cycle, the device will automatically re-enter Standby Mode.

| TABLE 25. SPI OUTPUT MEASUREMENT COMMAND                                                               |                   |                                                                                                                                                                                                                                                                                                          |                   |                                                                                                                                                               |                   |                   |      |                                                                                                                                                        |                   |                  |                 |                     |                   |                   |                   |                   |                   |                   |                   |                   |                   |
|--------------------------------------------------------------------------------------------------------|-------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|-------------------|------|--------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|------------------|-----------------|---------------------|-------------------|-------------------|-------------------|-------------------|-------------------|-------------------|-------------------|-------------------|-------------------|
| STEP                                                                                                   |                   | ACTION                                                                                                                                                                                                                                                                                                   |                   |                                                                                                                                                               |                   |                   |      | NOTES                                                                                                                                                  |                   |                  |                 |                     |                   |                   |                   |                   |                   |                   |                   |                   |                   |
| 1                                                                                                      |                   | The data on MISO depend on the preceding command. Discard the data on the MISO line.                                                                                                                                                                                                                     |                   |                                                                                                                                                               |                   |                   |      | <div><div></div> Master to Sensor</div> <div><div></div> Sensor to Master</div> <ul style="list-style-type: none"><li>NOP Command is “0xF0”.</li></ul> |                   |                  |                 |                     |                   |                   |                   |                   |                   |                   |                   |                   |                   |
|                                                                                                        |                   | MOSI                                                                                                                                                                                                                                                                                                     |                   | <table><tr><td>0xAA</td><td>0x00</td><td>0x00</td></tr><tr><td>Measurement Command</td><td>CmdData &lt;15:8&gt;</td><td>CmdData &lt;7:0&gt;</td></tr></table> |                   |                   |      |                                                                                                                                                        | 0xAA              | 0x00             | 0x00            | Measurement Command | CmdData <15:8>    | CmdData <7:0>     |                   |                   |                   |                   |                   |                   |                   |
|                                                                                                        |                   | 0xAA                                                                                                                                                                                                                                                                                                     | 0x00              | 0x00                                                                                                                                                          |                   |                   |      |                                                                                                                                                        |                   |                  |                 |                     |                   |                   |                   |                   |                   |                   |                   |                   |                   |
|                                                                                                        |                   | Measurement Command                                                                                                                                                                                                                                                                                      | CmdData <15:8>    | CmdData <7:0>                                                                                                                                                 |                   |                   |      |                                                                                                                                                        |                   |                  |                 |                     |                   |                   |                   |                   |                   |                   |                   |                   |                   |
| MISO                                                                                                   |                   | <table><tr><td>Status</td><td>Data</td><td>Data</td></tr></table>                                                                                                                                                                                                                                        |                   |                                                                                                                                                               |                   | Status            | Data | Data                                                                                                                                                   |                   |                  |                 |                     |                   |                   |                   |                   |                   |                   |                   |                   |                   |
| Status                                                                                                 | Data              | Data                                                                                                                                                                                                                                                                                                     |                   |                                                                                                                                                               |                   |                   |      |                                                                                                                                                        |                   |                  |                 |                     |                   |                   |                   |                   |                   |                   |                   |                   |                   |
|                                                                                                        |                   |                                                                                                                                                                                                                                                                                                          |                   |                                                                                                                                                               |                   |                   |      |                                                                                                                                                        |                   |                  |                 |                     |                   |                   |                   |                   |                   |                   |                   |                   |                   |
| 2                                                                                                      |                   | <b>Option 1:</b> Wait until the busy flag in the Status Byte clears. <b>Option 2:</b> Wait for at least 5 ms for the data conversion to occur.                                                                                                                                                           |                   |                                                                                                                                                               |                   |                   |      |                                                                                                                                                        |                   |                  |                 |                     |                   |                   |                   |                   |                   |                   |                   |                   |                   |
|                                                                                                        |                   | MOSI                                                                                                                                                                                                                                                                                                     |                   | <table><tr><td>0xF0</td></tr><tr><td>Command = NOP</td></tr></table>                                                                                          |                   |                   |      | 0xF0                                                                                                                                                   | Command = NOP     |                  |                 |                     |                   |                   |                   |                   |                   |                   |                   |                   |                   |
|                                                                                                        |                   | 0xF0                                                                                                                                                                                                                                                                                                     |                   |                                                                                                                                                               |                   |                   |      |                                                                                                                                                        |                   |                  |                 |                     |                   |                   |                   |                   |                   |                   |                   |                   |                   |
| Command = NOP                                                                                          |                   |                                                                                                                                                                                                                                                                                                          |                   |                                                                                                                                                               |                   |                   |      |                                                                                                                                                        |                   |                  |                 |                     |                   |                   |                   |                   |                   |                   |                   |                   |                   |
| MISO                                                                                                   |                   | <table><tr><td>Status</td></tr></table>                                                                                                                                                                                                                                                                  |                   |                                                                                                                                                               |                   | Status            |      |                                                                                                                                                        |                   |                  |                 |                     |                   |                   |                   |                   |                   |                   |                   |                   |                   |
| Status                                                                                                 |                   |                                                                                                                                                                                                                                                                                                          |                   |                                                                                                                                                               |                   |                   |      |                                                                                                                                                        |                   |                  |                 |                     |                   |                   |                   |                   |                   |                   |                   |                   |                   |
| 3                                                                                                      |                   | To read only the 24-bit pressure output along with the 8-bit Status Byte:                                                                                                                                                                                                                                |                   |                                                                                                                                                               |                   |                   |      |                                                                                                                                                        |                   |                  |                 |                     |                   |                   |                   |                   |                   |                   |                   |                   |                   |
|                                                                                                        |                   | <table><tr><td>0xF0</td><td>0x00</td><td>0x00</td><td>0x00</td></tr><tr><td>Command = NOP</td><td>00<sub>Hex</sub></td><td>00<sub>Hex</sub></td><td>00<sub>Hex</sub></td></tr></table>                                                                                                                   |                   |                                                                                                                                                               |                   |                   |      | 0xF0                                                                                                                                                   | 0x00              | 0x00             | 0x00            | Command = NOP       | 00 <sub>Hex</sub> | 00 <sub>Hex</sub> | 00 <sub>Hex</sub> |                   |                   |                   |                   |                   |                   |
|                                                                                                        |                   | 0xF0                                                                                                                                                                                                                                                                                                     | 0x00              | 0x00                                                                                                                                                          | 0x00              |                   |      |                                                                                                                                                        |                   |                  |                 |                     |                   |                   |                   |                   |                   |                   |                   |                   |                   |
|                                                                                                        |                   | Command = NOP                                                                                                                                                                                                                                                                                            | 00 <sub>Hex</sub> | 00 <sub>Hex</sub>                                                                                                                                             | 00 <sub>Hex</sub> |                   |      |                                                                                                                                                        |                   |                  |                 |                     |                   |                   |                   |                   |                   |                   |                   |                   |                   |
|                                                                                                        |                   | MISO                                                                                                                                                                                                                                                                                                     |                   | <table><tr><td>Status</td><td>PressData &lt;24:16&gt;</td><td>PressData &lt;15:8&gt;</td><td>PressData &lt;7:0&gt;</td></tr></table>                          |                   |                   |      | Status                                                                                                                                                 | PressData <24:16> | PressData <15:8> | PressData <7:0> |                     |                   |                   |                   |                   |                   |                   |                   |                   |                   |
| Status                                                                                                 | PressData <24:16> | PressData <15:8>                                                                                                                                                                                                                                                                                         | PressData <7:0>   |                                                                                                                                                               |                   |                   |      |                                                                                                                                                        |                   |                  |                 |                     |                   |                   |                   |                   |                   |                   |                   |                   |                   |
|                                                                                                        |                   |                                                                                                                                                                                                                                                                                                          |                   |                                                                                                                                                               |                   |                   |      |                                                                                                                                                        |                   |                  |                 |                     |                   |                   |                   |                   |                   |                   |                   |                   |                   |
| To read the 24-bit pressure output and the 24-bit temperature output along with the 8-bit Status Byte: |                   |                                                                                                                                                                                                                                                                                                          |                   |                                                                                                                                                               |                   |                   |      |                                                                                                                                                        |                   |                  |                 |                     |                   |                   |                   |                   |                   |                   |                   |                   |                   |
| MOSI                                                                                                   |                   | <table><tr><td>0xF0</td><td>0x00</td><td>0x00</td><td>0x00</td><td>0x00</td><td>0x00</td><td>0x00</td></tr><tr><td>Command = NOP</td><td>00<sub>Hex</sub></td><td>00<sub>Hex</sub></td><td>00<sub>Hex</sub></td><td>00<sub>Hex</sub></td><td>00<sub>Hex</sub></td><td>00<sub>Hex</sub></td></tr></table> |                   |                                                                                                                                                               |                   |                   |      | 0xF0                                                                                                                                                   | 0x00              | 0x00             | 0x00            | 0x00                | 0x00              | 0x00              | Command = NOP     | 00 <sub>Hex</sub> | 00 <sub>Hex</sub> | 00 <sub>Hex</sub> | 00 <sub>Hex</sub> | 00 <sub>Hex</sub> | 00 <sub>Hex</sub> |
| 0xF0                                                                                                   | 0x00              | 0x00                                                                                                                                                                                                                                                                                                     | 0x00              | 0x00                                                                                                                                                          | 0x00              | 0x00              |      |                                                                                                                                                        |                   |                  |                 |                     |                   |                   |                   |                   |                   |                   |                   |                   |                   |
| Command = NOP                                                                                          | 00 <sub>Hex</sub> | 00 <sub>Hex</sub>                                                                                                                                                                                                                                                                                        | 00 <sub>Hex</sub> | 00 <sub>Hex</sub>                                                                                                                                             | 00 <sub>Hex</sub> | 00 <sub>Hex</sub> |      |                                                                                                                                                        |                   |                  |                 |                     |                   |                   |                   |                   |                   |                   |                   |                   |                   |
| MISO                                                                                                   |                   | <table><tr><td>Status</td><td>PressData &lt;24:16&gt;</td><td>PressData &lt;15:8&gt;</td><td>PressData &lt;7:0&gt;</td><td>TempData &lt;24:16&gt;</td><td>TempData &lt;15:8&gt;</td><td>TempData &lt;7:0&gt;</td></tr></table>                                                                           |                   |                                                                                                                                                               |                   |                   |      | Status                                                                                                                                                 | PressData <24:16> | PressData <15:8> | PressData <7:0> | TempData <24:16>    | TempData <15:8>   | TempData <7:0>    |                   |                   |                   |                   |                   |                   |                   |
| Status                                                                                                 | PressData <24:16> | PressData <15:8>                                                                                                                                                                                                                                                                                         | PressData <7:0>   | TempData <24:16>                                                                                                                                              | TempData <15:8>   | TempData <7:0>    |      |                                                                                                                                                        |                   |                  |                 |                     |                   |                   |                   |                   |                   |                   |                   |                   |                   |

## BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES

### 7.6 SPI Timing and Level Parameters (See Table 26.)

**TABLE 26. SPI BUS TIMING DIAGRAM AND PARAMETERS**

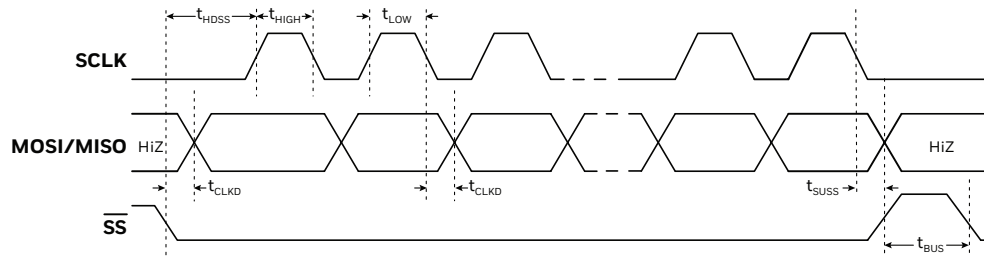

| CHARACTERISTIC                             | ABBREVIATION | MIN. | TYP. | MAX. | UNIT     |
|--------------------------------------------|--------------|------|------|------|----------|
| SCLK clock frequency                       | $f_{SCLK}$   | 50   | —    | 800  | kHz      |
| SS drop to first clock edge                | $t_{HDSS}$   | 2.5  | —    | —    | $\mu s$  |
| Minimum SCLK clock low width <sup>1</sup>  | $t_{LOW}$    | 0.6  | —    | —    | $\mu s$  |
| Minimum SCLK clock high width <sup>1</sup> | $t_{HIGH}$   | 0.6  | —    | —    | $\mu s$  |
| Clock edge to data transition              | $t_{CLKD}$   | 0    | —    | —    | $\mu s$  |
| Rise of SS relative to last clock edge     | $t_{SUSS}$   | 0.1  | —    | —    | $\mu s$  |
| Bus free time between rise and fall of SS  | $t_{BUS}$    | 2    | —    | —    | $\mu s$  |
| Output level low                           | $Out_{low}$  | —    | 0    | 0.2  | $V_{DD}$ |
| Output level high                          | $Out_{high}$ | 0.8  | 1    | —    | $V_{DD}$ |

<sup>1</sup>Combined low and high widths must equal or exceed minimum SCLK period.

## BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES

### 7.7 Reference Code (Arduino/Genuino Uno) for SPI Interface

See also Section 8.0 for details and examples of ABP2 Series Pressure and Temperature output calculations.

```
#include<Arduino.h>
#include<SPI.h>

double press_counts = 0; // digital pressure reading [counts]
double temp_counts = 0; // digital temperature reading [counts]
double pressure = 0; // pressure reading [bar, psi, kPa, etc.]
double temperature = 0; // temperature reading in deg C
double outputmax = 15099494; // output at maximum pressure [counts]
double outputmin = 1677722; // output at minimum pressure [counts]
double pmax = 1; // maximum value of pressure range [bar, psi, kPa, etc.]
double pmin = 0; // minimum value of pressure range [bar, psi, kPa, etc.]
double percentage = 0; // holds percentage of full scale data
char printBuffer[200], cBuff[20], percBuff[20], pBuff[20], tBuff[20];
void setup() {
    Serial.begin(9600);
    while (!Serial) {
        delay(10);
    }
    sprintf(printBuffer, "\nStatus Register, 24-bit Sensor data, Digital Pressure Counts,\
    Percentage of full scale pressure,Pressure Output, Temperature\n");
    Serial.println(printBuffer);
    SPI.begin();
    pinMode(10, OUTPUT); // pin 10 as SS
    digitalWrite(10, HIGH); // set SS High
}
void loop() {
    delay(1);
    while (1) {
        uint8_t data[7] = {0xFA, 0x00, 0x00, 0x00, 0x00, 0x00, 0x00}; // holds output data
        uint8_t cmd[3] = {0xAA, 0x00, 0x00}; // command to be sent
        SPI.beginTransaction(SPISettings(200000, MSBFIRST, SPI_MODE0)); //SPI at 200kHz
        digitalWrite(10, LOW); // set SS Low
        SPI.transfer(cmd, 3); // send Read Command
        digitalWrite(10, HIGH); // set SS High
        delay(10); // wait for conversion
        digitalWrite(10, LOW);
        SPI.transfer(data, 7);
        digitalWrite(10, HIGH);
        SPI.endTransaction();
        press_counts = data[3] + data[2] * 256 + data[1] * 65536; // calculate digital pressure counts
        temp_counts = data[6] + data[5] * 256 + data[4] * 65536; // calculate digital temperature counts
        temperature = (temp_counts * 200 / 16777215) - 50; // calculate temperature in deg c
        percentage = (press_counts / 16777215) * 100; // calculate pressure as percentage of full scale
        //calculation of pressure value according to equation 2 of datasheet
        pressure = ((press_counts - outputmin) * (pmax - pmin)) / (outputmax - outputmin) + pmin;
        dtostrf(press_counts, 4, 1, cBuff);
        dtostrf(percentage, 4, 3, percBuff);
        dtostrf(pressure, 4, 3, pBuff);
        dtostrf(temperature, 4, 3, tBuff);
        /*
        The below code prints the raw data as well as the processed data
        Data format : Status Register, 24-bit Sensor Data, Digital Counts, percentage of full scale
        pressure, pressure output,
        temperature
        */
        sprintf(printBuffer, "%x\t%2x %2x %2x\t%s\t%s\t%s\t%s \n", data[0], data[1], data[2], data[3],
            cBuff, percBuff, pBuff, tBuff);
        Serial.print(printBuffer);
        delay(10);
    }
}
```

# BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES

## 8.0 ABP2 SERIES CALCULATIONS

### 8.1 Pressure Output

The ABP2 Series sensor pressure output may be expressed by the transfer function of the device as shown in Equation 1:

#### Equation 1: Pressure Sensor Transfer Function

$$\text{Output} = \frac{\text{Output}_{\text{max.}} - \text{Output}_{\text{min.}}}{P_{\text{max.}} - P_{\text{min.}}} * (\text{Pressure} - P_{\text{min.}}) + \text{Output}_{\text{min.}}$$

Rearranging this equation to solve for Pressure provides Equation 2:

#### Equation 2: Pressure Output Function

$$\text{Pressure} = \frac{(\text{Output} - \text{Output}_{\text{min.}}) * (P_{\text{max.}} - P_{\text{min.}})}{\text{Output}_{\text{max.}} - \text{Output}_{\text{min.}}} + P_{\text{min.}}$$

Where:

Output<sub>max.</sub> = output at maximum pressure [counts]

Output<sub>min.</sub> = output at minimum pressure [counts]

P<sub>max.</sub> = maximum value of pressure range [bar, psi, kPa, etc.]

P<sub>min.</sub> = minimum value of pressure range [bar, psi, kPa, etc.]

Pressure = pressure reading [bar, psi, kPa, etc.]

Output = digital pressure reading [counts]

**Example:** Calculate the pressure for a -1 psi to 1 psi gage sensor with a 10 to 90 calibration, and a pressure output of 14260634 (decimal) counts:

Output<sub>max.</sub> = 15099494 counts (90 of 2<sup>24</sup> counts or 0xE66666)

Output<sub>min.</sub> = 1677722 counts (10 of 2<sup>24</sup> counts or 0x19999A)

P<sub>max.</sub> = 1 psi

P<sub>min.</sub> = -1 psi

Pressure = calculated pressure in psi

Output = 14260634 counts

$$\text{Pressure} = \left( \frac{(14260634 - 1677722) * (1 - (-1))}{15099494 - 1677722} \right) + (-1)$$

$$\text{Pressure} = \left( \frac{25165824}{13421772} \right) + (-1)$$

Pressure = 0.875 psi

## BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES

### 8.2 Temperature Output

The ABP2 Series sensor temperature output may be expressed by the transfer function of the device as shown in Equation 3:

#### Equation 3: Temperature Output Transfer Function

$$\text{Temperature} = \frac{T_{\text{out}} * (T_{\text{max.}} - T_{\text{min.}})}{(2^{(24)} - 1)} + T_{\text{min.}}$$

Where:

Temperature = calculated temperature output in °C

$T_{\text{out}}$  = digital temperature output in counts (decimal)

$T_{\text{max.}}$  = 150°C

$T_{\text{min.}}$  = -50°C

**Example:** Calculate the temperature for a temperature output of 6291456 (decimal) counts.

$$\text{Temperature} = \frac{T_{\text{out}} * (150 - (-50))}{(2^{(24)} - 1)} + T_{\text{min.}}$$

$$\text{Temperature} = \frac{6291456 * 200}{16777215} - 50$$

$$\text{Temperature} = 25^{\circ}\text{C}$$

## BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES

### 9.0 RECOMMENDED PNEUMATIC SENSOR CONNECTIONS

#### 9.1 Tubing

Tubing is a common method of pneumatically connecting to the sensors and needs to be matched to the sensor's application to provide the required operating temperature range and working pressure. Depending on the working pressure range and operating temperature, the corresponding type of tubing can be selected (i.e., Superthane®, silicone, and vinyl). Silicone tubing, for instance, tends to be the easiest to which to connect; however, its working pressure is not as high as that of the other materials.

The lower the shore rating for the tubing, the easier it is to insert the tubing onto the sensor's pressure port; however, the lower shore rated tubing also has lower working pressures. For working pressures of 20 psi and below, silicone or vinyl tubing tends to be used. For pressures above 20 psi, Superthane® or low-density polyethylene tubing may be considered. Table 27 shows recommended tubing for use with Honeywell's Basic Board Mount Pressure Sensors.

Generally, when the working pressure is 15 psi or less, clamps are typically not required. However, because each application is different, the end use must be taken into account before determining whether clamps are necessary to ensure that the tubing remains in place and doesn't leak. Considerations include vibration, pressure spikes, and the type of tubing being used. A common clamping method is to use a plastic cable tie, available in a variety of sizes and found in most hardware stores. They are relatively easy to install and stay in place over time.

#### NOTICE

Instead of using a clamp, a small drop of epoxy may be applied to either pressure port prior to the tubing being placed onto the port or applied at the end of the tubing once the tubing is in place. This method holds the tubing in place and can further act as a sealing agent to help ensure a leak-tight connection between the pressure port and the tubing. A room temperature sealant is generally used for this purpose. Ensure that the epoxy doesn't block the hole in the port as it needs to remain open.

#### NOTICE

To apply a more rigid tubing-to-port connection, a low-power heat gun may be used to slightly heat the tubing. Once cooled, the tubing tends to grip the pressure port better.

**TABLE 27. RECOMMENDED TUBING**

| PRESSURE PORT | MANUFACTURER      | TYPE                      | PART NUMBER | ID       | OD       | PRESSURE AT 25°C (PSI) |
|---------------|-------------------|---------------------------|-------------|----------|----------|------------------------|
| AN            | Frelin-Wade       | Fre-Thane® (polyurethane) | 1A-156-11   | 0.093 in | 0.156 in | 210                    |
| AN            | Frelin-Wade       | nylon                     | 1A-200-01   | 0.093 in | 0.125 in | 270                    |
| AN            | NewAge Industries | PVC                       | 1100225     | 0.094 in | 0.156 in | 42                     |
| AN            | NewAge Industries | silicone                  | 2800315     | 0.094 in | 0.156 in | 20                     |
| AN            | McMaster          | silicone                  | 5041K512    | 2,0 mm   | 6,0 mm   | 60                     |
| AN            | McMaster          | silicone                  | 5041K601    | 2,0 mm   | 6,0 mm   | 115                    |
| RN, RR        | Frelin-Wade       | Fre-Thane                 | 95a-157     | 0.066 in | 0.125 in | 225                    |
| RN, RR        | NewAge Industries | Superthane® (ether)       | 2110535     | 0.066 in | 0.125 in | 135                    |
| RN            | NewAge Industries | silicone                  | 2800161     | 0.063 in | 0,188 in | 20                     |
| RN, RR        | Du-Bro            | silicone                  | 196 1/16 ID | 0.063 in | 0.125 in | 20                     |
| RN, RR        | US Plastics       | Excelthane polyurethane   | 77901710    | 0.063 in | 0.125 in | 70                     |
| RN, RR        | McMaster          | silicone                  | 5041K603    | 1,0 mm   | 3.00 in  | 15                     |
| DA            | McMaster          | silicone                  | 5041K512    | 2,0 mm   | 6,0 mm   | 60                     |


# BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES

## 9.2 O-ring Manifold Designs


O-rings may also be used to connect pneumatically to the sensor. Most O-ring manufacturers recommend a compression of 20% to 25% to provide the proper O-ring compression over the temperature range. Silicone or fluorosilicone O-rings are commonly used as they tend to take less of a set over temperature verses other O-ring materials. System operating temperatures and sealant media compatibility are the two most important parameters which must be considered when selecting an O-ring base polymer. See Figures, 16, 17 and Table 28 for more information.

FIGURE 16. GUIDELINES FOR O-RING MANIFOLD DESIGNS<sup>1</sup>


### NN Pressure Port

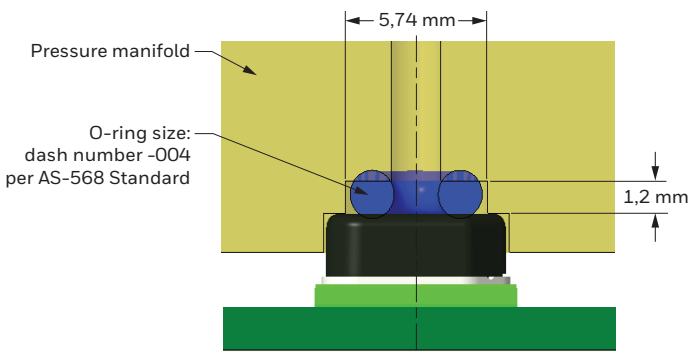


### VN Pressure Port<sup>2</sup>

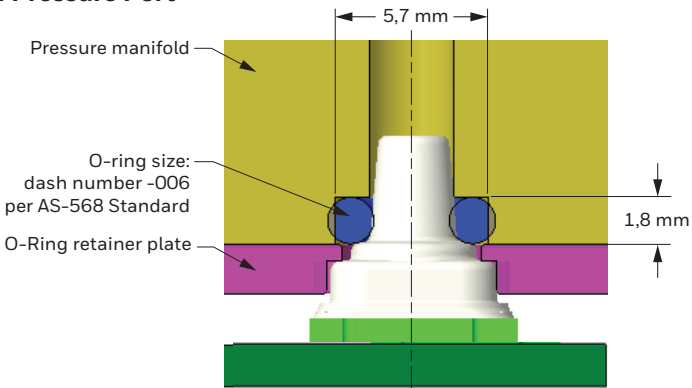

### AN Pressure Port

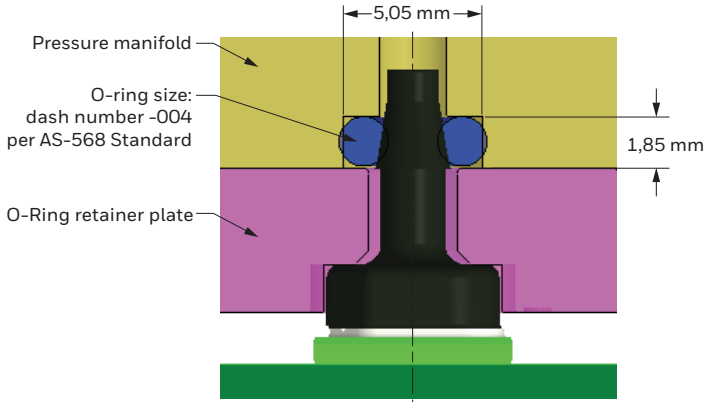


### SN Pressure Port<sup>2</sup>

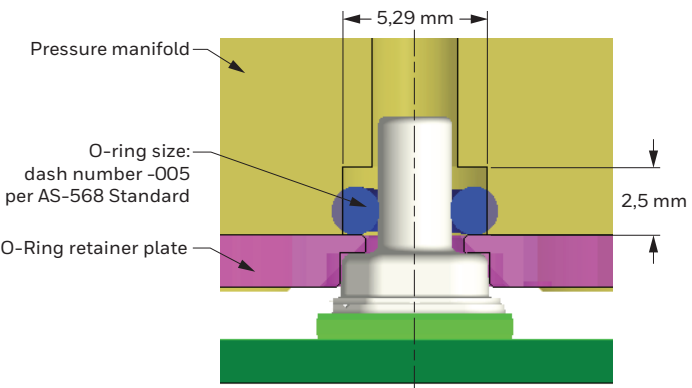

<sup>1</sup>The recommended design has been validated for operating conditions ranging from -40°C to 110°C and up to 16 bar gage pressure.  
<sup>2</sup>For more demanding applications, a second O-ring can be used with a gland height of 3,6 mm (VN pressure port) and 4,55 mm (SN pressure port).

FIGURE 17. FORCE VS % OF O-RING COMPRESSION

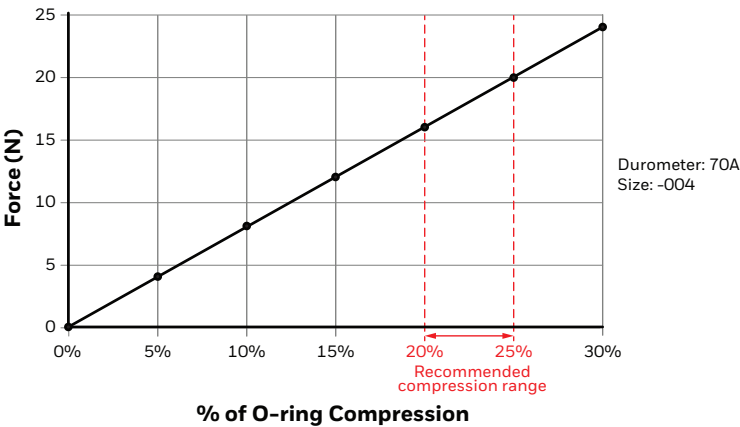

### NOTICE

It is the buyer's sole responsibility to determine the suitability of the product in the application.

BASIC BOARD MOUNT PRESSURE SENSORS, ABP2 SERIES

9.2 O-ring Manifold Designs (continued)

| TABLE 28. RECOMMENDED O-RINGS |                                         |                |                 |                 |          |             |                |
|-------------------------------|-----------------------------------------|----------------|-----------------|-----------------|----------|-------------|----------------|
| PRESSURE PORT                 | O-RING SIZE AS-568 UNIFORM DASH NUMBERS | O-RING ID (MM) | O-RING C/S (MM) | MATERIAL        | SUPPLIER | PART NUMBER | SHORE HARDNESS |
| NN                            | -004                                    | 1,78           | 1,78            | fluoroelastomer | McMaster | 8333T114    | durometer 70A  |
| NN                            | -004                                    | 1,78           | 1,78            | silicone        | McMaster | 1283N14     | durometer 70A  |
| AN                            | -004                                    | 1,78           | 1,78            | fluoroelastomer | McMaster | 8333T114    | durometer 70A  |
| AN                            | -004                                    | 1,78           | 1,78            | silicone        | McMaster | 1283N14     | durometer 70A  |
| SN                            | -005                                    | 2,75           | 1,78            | fluoroelastomer | McMaster | 8333T115    | durometer 70A  |
| SN                            | -005                                    | 2,75           | 1,78            | silicone        | McMaster | 1283N15     | durometer 70A  |
| VN                            | -006                                    | 2,90           | 1,78            | fluoroelastomer | McMaster | 8333T116    | durometer 70A  |
| VN                            | -006                                    | 2,90           | 1,78            | silicone        | McMaster | 1283N16     | durometer 70A  |

## ADDITIONAL MATERIALS

The following associated literature is available at [sensing.honeywell.com](http://sensing.honeywell.com):

- Product range guide
- Application information
- CAD models
- Product images

## WARRANTY/REMEDY

Honeywell warrants goods of its manufacture as being free of defective materials and faulty workmanship during the applicable warranty period. Honeywell's standard product warranty applies unless agreed to otherwise by Honeywell in writing; please refer to your order acknowledgment or consult your local sales office for specific warranty details. If warranted goods are returned to Honeywell during the period of coverage, Honeywell will repair or replace, at its option, without charge those items that Honeywell, in its sole discretion, finds defective.

**The foregoing is buyer's sole remedy and is in lieu of all other warranties, expressed or implied, including those of merchantability and fitness for a particular purpose. In no event shall Honeywell be liable for consequential, special, or indirect damages.**

## FOR MORE INFORMATION

Honeywell Sensing and Internet of Things services its customers through a worldwide network of sales offices and distributors. For application assistance, current specifications, pricing or the nearest Authorized Distributor, visit [sensing.honeywell.com](http://sensing.honeywell.com) or call:

|               |                     |
|---------------|---------------------|
| USA/Canada    | +1 302 613 4491     |
| Latin America | +1 305 805 8188     |
| Europe        | +44 1344 238258     |
| Japan         | +81 (0) 3-6730-7152 |
| Singapore     | +65 6355 2828       |
| Greater China | +86 4006396841      |

### Honeywell Sensing and Internet of Things

830 East Arapaho Road  
Richardson, TX 75081  
[sps.honeywell.com](http://sps.honeywell.com)

Fre-Thane® is a registered trademark of Freelin-Wade Co.  
Superthane® is a registered trademark of NewAge® Industries.

32350268-C-EN | C | 01/21  
© 2021 Honeywell International Inc. All rights reserved.

## WARNING PERSONAL INJURY

DO NOT USE these products as safety or emergency stop devices or in any other application where failure of the product could result in personal injury.

**Failure to comply with these instructions could result in death or serious injury.**

## WARNING MISUSE OF DOCUMENTATION

- The information presented in this product sheet is for reference only. Do not use this document as a product installation guide.
- Complete installation, operation, and maintenance information is provided in the instructions supplied with each product.

**Failure to comply with these instructions could result in death or serious injury.**

While Honeywell may provide application assistance personally, through our literature and the Honeywell web site, it is buyer's sole responsibility to determine the suitability of the product in the application.

Specifications may change without notice. The information we supply is believed to be accurate and reliable as of this writing. However, Honeywell assumes no responsibility for its use.

**Honeywell**

# Mouser Electronics

Authorized Distributor

Click to View Pricing, Inventory, Delivery & Lifecycle Information:

[Honeywell:](#)

|                                    |                                    |                                    |                                    |
|------------------------------------|------------------------------------|------------------------------------|------------------------------------|
| <a href="#">ABP2LSNT150PG2A3XX</a> | <a href="#">ABP2DANN005NG2B3XX</a> | <a href="#">ABP2DANN005NGSB3XX</a> | <a href="#">ABP2DANT001PG2A3XX</a> |
| <a href="#">ABP2DANT005PG2A3XX</a> | <a href="#">ABP2DANT005PGSA3XX</a> | <a href="#">ABP2MRRT160MDSA3XX</a> | <a href="#">ABP2MVNT400MG2A3XX</a> |
| <a href="#">ABP2MRRN016MD2A3XX</a> | <a href="#">ABP2MRRT001PD2A3XX</a> | <a href="#">ABP2MRRT001PDSA3XX</a> | <a href="#">ABP2MRRT006KD2A3XX</a> |
| <a href="#">ABP2MRRT060KD2A3XX</a> | <a href="#">ABP2MRRT160MD2A3XX</a> | <a href="#">ABP2MRNN016MG0A3XX</a> | <a href="#">ABP2MRNT001PG2A3XX</a> |
| <a href="#">ABP2MRRN002ND2B3XX</a> | <a href="#">ABP2MRRN004ND2B3XX</a> | <a href="#">ABP2MRRN004NG2B3XX</a> | <a href="#">ABP2MRRN005ND2A3XX</a> |
| <a href="#">ABP2MANT030PA2A3XX</a> | <a href="#">ABP2MANT030PG2A3XX</a> | <a href="#">ABP2MDAN001PD2A3XX</a> | <a href="#">ABP2MDAN002ND2B3XX</a> |
| <a href="#">ABP2MDAN005ND2A3XX</a> | <a href="#">ABP2MDAN030ND2A3XX</a> | <a href="#">ABP2LSNT015PASA3XX</a> | <a href="#">ABP2LSNT030PA2A3XX</a> |
| <a href="#">ABP2LSNT030PG2A3XX</a> | <a href="#">ABP2LSNT030PGSA3XX</a> | <a href="#">ABP2LSNT400KG2A3XX</a> | <a href="#">ABP2MANT001BG2A3XX</a> |
| <a href="#">ABP2LANT400KG2A3XX</a> | <a href="#">ABP2LNNG010BG2A3XX</a> | <a href="#">ABP2LSNT001GG2A3XX</a> | <a href="#">ABP2LSNT004BG2A3XX</a> |
| <a href="#">ABP2LSNT012BG2A3XX</a> | <a href="#">ABP2LSNT015PA2A3XX</a> | <a href="#">ABP2LANT030PA2A3XX</a> | <a href="#">ABP2LANT030PASA3XX</a> |
| <a href="#">ABP2LANT030PG2A3XX</a> | <a href="#">ABP2LANT030PGSA3XX</a> | <a href="#">ABP2LANT060KG2A3XX</a> | <a href="#">ABP2LANT160MG2A3XX</a> |
| <a href="#">ABP2LANT005PG2A3XX</a> | <a href="#">ABP2LANT005PGSA3XX</a> | <a href="#">ABP2LANT015PA2A3XX</a> | <a href="#">ABP2LANT015PASA3XX</a> |
| <a href="#">ABP2LANT015PG2A3XX</a> | <a href="#">ABP2LANT015PGSA3XX</a> | <a href="#">ABP2DSNT150PG2A3XX</a> | <a href="#">ABP2DSNT150PGSA3XX</a> |
| <a href="#">ABP2LANT001BA2A3XX</a> | <a href="#">ABP2LANT001GG2A3XX</a> | <a href="#">ABP2LANT001PGSA3XX</a> | <a href="#">ABP2LANT004BG2A3XX</a> |
| <a href="#">ABP2DSNT015PA2A3XX</a> | <a href="#">ABP2DSNT015PASA3XX</a> | <a href="#">ABP2DSNT030PA2A3XX</a> | <a href="#">ABP2DSNT030PASA3XX</a> |
| <a href="#">ABP2DSNT030PG2A3XX</a> | <a href="#">ABP2DSNT030PGSA3XX</a> | <a href="#">ABP2DRRT001PD2A3XX</a> | <a href="#">ABP2DRRT001PDSA3XX</a> |
| <a href="#">ABP2DRRT060KD2A3XX</a> | <a href="#">ABP2DRRT100MD2A3XX</a> | <a href="#">ABP2DRRT160MD2A3XX</a> | <a href="#">ABP2DRRT160MDSA3XX</a> |
| <a href="#">ABP2DDAN005ND2A3XX</a> | <a href="#">ABP2DDAN005NDSA3XX</a> | <a href="#">ABP2DRNT030PG2A3XX</a> | <a href="#">ABP2DRRN005ND2A3XX</a> |
| <a href="#">ABP2DRRN005NDSA3XX</a> | <a href="#">ABP2DRRN005NG2B3XX</a> | <a href="#">ABP2DANT150PG2A3XX</a> | <a href="#">ABP2DANT160MG2A3XX</a> |
| <a href="#">ABP2DANT160MGSA3XX</a> | <a href="#">ABP2DANT250KA2A3XX</a> | <a href="#">ABP2DANT400MG2A3XX</a> | <a href="#">ABP2DDAN001PDSA3XX</a> |
| <a href="#">ABP2DANT030PG2A3XX</a> | <a href="#">ABP2DANT030PGSA3XX</a> | <a href="#">ABP2DANT060PG2A3XX</a> | <a href="#">ABP2DANT060PGSA3XX</a> |
| <a href="#">ABP2DANT015PA2A3XX</a> | <a href="#">ABP2DANT015PASA3XX</a> | <a href="#">ABP2DANT015PGSA3XX</a> | <a href="#">ABP2DANT016KG2A3XX</a> |
| <a href="#">ABP2DANT030PA2A3XX</a> | <a href="#">ABP2DANT030PASA3XX</a> | <a href="#">ABP2LANT015PDAA3XT</a> |                                    |