
# 2SMPB-02E Digital Barometric Pressure Sensor

# High accuracy and small size barometric pressure sensor with low current consumption

- Measure barometric pressure and temperature with high accuracy
- Built in low noise 24bit ADC
- Digital control and output via I<sup>2</sup>C/SPI interface
- Automatically power down non-working circuit to minimize power consumption
- Individual calibration parameters stored in OTP\*
- (\*One Time Programmable ROM)

**RoHS** compliant

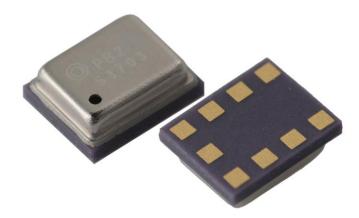

# Application Example

- ·Indoor navigation (floor detection)
- ·Car navigation (to distinguish highway and frontage road)
- Altimeter
- Activity monitor (to detect up and down of stairs)
- ·Life log
- ·Weather forecast

#### Target Devices Example

- Smart Phones / Tablet PCs
- $\ensuremath{\cdot}\ensuremath{\mathsf{Wearable}}$  devices, such as watch type, band type, clip type or glasses type
- GPS devices
- ·Healthcare devices such as pedometer

# Packaging Information

∎St	Standard Models with Surface Mounting Terminals									
	Structure	Packaging	Model	Minimum Packing Unit						
	LGA 9pin	Tape and Reel	2SMPB-02E	3,500						

# **Table of Contents**

1. Ratings, Specifications and Functions	3
1.1 Use conditions and recommended operating conditions	
1.2 Absolute Maximum Ratings	
1.3 Operating Ratings	
1.4 Electrical Characteristics	
1.5 Digital Interface Characteristics4	
1.6 Characteristics by Oversampling setting (Force mode)	
1.7 rms Noise by IIR Filter Selection	
1.8 Bandwidth by IIR Filter Selection	
1.9 Filter selection based on use cases	
2. Connection	6
2.1 Block Diagram	
2.2 Pin Description and Layout	
2.3 Typical Connection Diagram7	
3. Dimensions	8
3.1 Package	0
3.2 Mounting PAD Dimensions	
3.3 Marking structure	
4. Operations	9
4.1 Communication Mode	
<b>4.2 Power Mode</b>	
4.3 Compensation of Pressure and Temperature	
4.4 Implementing Register List	
<b>4.5 I<sup>2</sup>C Protocol</b>	
<b>4.6 SPI Protocol</b>	
4.7 Interface specifications17	
4.8 Reset Function	
4.9 Recommended conditions of communication19	
5. Packaging	20
5.1 Configuration of shipment	
<b>5.2</b> Taping	
5.3 Reel	
5.4 Individual packaging	
6. Recommended Soldering Method	22
7. Precautions	22
8. Warranty and Limited Warranty	23

# 1. Ratings, Specifications and Functions

#### 1.1 Use conditions and recommended operating conditions

Type of Pressure	Absolute pressure					
Medium	Air (*1)					
Operating Pressure Range	30kPa to 110kPa					
Note *1: Never use corrective gases						

Note. \*1: Never use corrosive gases.

#### 1.2 Absolute Maximum Ratings

Item	Symbol	Rating	Unit	Remark
Power Supply Voltage	Vddmax	4.0	V	
Input Voltage (other than power)	Vmax	-0.2~Vopr+0.2	V	
Maximum Pressure	Pmax	800	kPa	
Storage Temperature	Tstr	-40~85	degC	with no condensation or icing
Storage Humidity	Hstr	10~95	%RH	with no condensation or icing
ESD (HBM)	Vhbm	±2000	V	
ESD (MM)	Vmm	±200	V	
ESD (CDM)	Vcdm	±500	V	

#### 1.3 Operating Ratings

Item	Symbol	Min	Тур	Max	Unit	Remark
Operating Voltage	Vopr	1.71	1.8	3.6	V	VDD
	Vio	1.20	1.8	3.6	V	VDDIO
Operating Temperature	Topr	-40	-	85	degC	

## **1.4 Electrical Characteristics**

Item	Symbol	Condition	Min	Тур	Max	Unit
Average Current	lhp	1sample/s force-mode Ultra High Accuracy	-	21.4	-	uA
Operating Current	Iddp	Pressure mode	-	640	800	uA
Consumption	lddt	Temperature mode	-	410	520	uA
Sleep Mode Current Consumption	Isleep		-	1.1	2.3	uA
Measureable Pressure Range	Popr		30	-	110	kPa
Absolute	Pabs1	30-110kPa, 0-65℃	-	±50	-	Pa
Pressure Accuracy	Pabs2	30-110kPa,-20-0°C		±80		
Relative Pressure Accuracy	Prel1	Ultra High Accuracy	-	±3.9	-	Pa
rms Noise	Pnois	Ultra High Accuracy	-	1.3	-	Ра
Absolute Temperature Accuracy	Tabs	30-110kPa,-20-65℃	-2	-	2	degC
Pressure Resolution	Pres		-	0.06	-	Ра
Temperature Resolution	Tres		-	0.0002	-	degC
Power Supply Rejection Ratio (DC)	Ppsrr	101.3kPa,0-40°C, 1.71-3.6V Base on VDD=1.8V	-9.4	-	9.4	Ра

Note : Typical specifications are not guaranteed

(At Ta=25 degC, VDD=1.8V, unless otherwise noted)

#### 1.5 Digital Interface Characteristics

Item	Symbol	Condition	MIN	TYP	MAX	Unit
Digital Input Low Voltage	Vil_d		-	-	Vio*0.2	V
Digital Input High Voltage	Vih_d		Vio*0.8	-	-	V
Digital Input Hysterisis Voltage	Vidhys		Vio*0.1	-	-	V
Digital Output Low Voltage(I2C)	Vol_d1	lo=3mA (SDI) *1)	0	-	Vio*0.2	V
Digital Output Low Voltage(SPI)	Vol_d2	lo=1mA (SDI,SDO) *1)	0	-	Vio*0.2	V
Digital Output High Voltage1 (SPI) (Vio>=1.62V)	Voh_d1	lo=1mA (SDI,SDO) *1)	Vio*0.8	-	-	V
Digital Output High Voltage2 (SPI) (Vio>=1.2V)	Voh_d2	lo=1mA (SDI,SDO) *1)	Vio*0.6			
Leakage Current at Output OFF	loff	SDI,SDO	-10	-	10	uA
Internal Pullup Resistor	Rpullup	CSB	70	120	190	kohm
I <sup>2</sup> C Load Capacitance	Cb	SDI,SCK	-	-	400	рF
Load Capacitance of Reset Terminal	Crst		-	-	20	pF
Pulse Width of Asynchronous Reset	Trst		100	-	-	µsec
Power On Startup Time	Tstart		-	-	10	msec

Note. \*1) "lo" is the load current of the output terminal.

\*2) Undescribed items are compliant with the I<sup>2</sup>C specification.

About detailed I<sup>2</sup>C bus information, please refer to the I<sup>2</sup>C bus specification and user manual presented by NXP.

#### 1.6 Characteristics by Oversampling setting (Force mode)

Oversampling setting	Pressure oversampling	Temperature oversampling	Measurement time Typ.	ODR @standby 1ms Typ.	Average Current Typ. @1sample/sec force-mode	rms Noise Typ.
unit	-	-	msec	Hz	uA	Pa
High speed	2	1	5.5	153	4.1	5.2
Low power	4	1	7.2	121	5.2	3.7
Standard	8	1	10.6	86	7.3	2.6
High accuracy	16	2	18.3	51	12.0	1.8
Ultra High accuracy	32	4	33.7	28	21.4	1.3

(At Ta=25 degC, VDD=1.8V, CPU Clock Frequency=300kHz, unless otherwise noted) Note. \*1) These characteristics are guaranteed by design.

\*2) ODR is defined as Output data rate at standby time 1msec.

#### 1.7 rms Noise by IIR Filter Selection

	Typical rms Noise in Pressure [Pa]								
Oversampling setting			IIR filter of	coefficient					
	off	2	4	8	16	32			
High speed	5.2	2.5	1.6	1.1	0.8	0.5			
Low power	3.7	1.8	1.1	0.8	0.5	0.4			
Standard	2.6	1.3	0.8	0.5	0.4	0.3			
High accuracy	1.8	0.9	0.6	0.4	0.3	0.3			
Ultra High accuracy	1.3	0.6	0.4	0.3	0.3	0.2			

(At Ta=25 degC, VDD=1.8V, unless otherwise noted)

Note. \*1) IIR : Infinite Impulse Response.

\*2) These characteristics are guaranteed by design.

\*3) Initial setting of the IIR filter coefficient is "off".

#### 1.8 Bandwidth by IIR Filter Selection

	Typical Bandwidth [Hz]									
Oversampling setting		IIR filter coefficient								
	off	2	4	8	16	32				
High speed	153.0	35.3	14.7	6.8	3.3	1.6				
Low power	121.0	28.0	11.6	5.4	2.6	1.3				
Standard	86.0	19.9	8.3	3.8	1.8	0.9				
High accuracy	51.0	11.8	4.9	2.3	1.1	0.5				
Ultra High accuracy	28.0	6.5	2.7	1.2	0.6	0.3				

(At Ta=25 degC, VDD=1.8V, unless otherwise noted)

Note. \*1) These characteristics are guaranteed by design. \*2) Initial setting of the IIR filter coefficient is "off".

#### 1.9 Filter selection based on use cases


		Pressure	Temp.	Specification (Typ.)				
Example use case	Oversampling setting	over sampling times	over sampling times	IIR filter coefficient	Current consumption [uA]	ODR [Hz] (Example)	rms Noise [Pa]	
Weather monitoring	High speed	×2	×1	off	1.2	0.05	5.2	
Drop detection	Low power	×4	×1	off	407	100	3.7	
Elevator detection	Standard	×8	×1	4	63.4	10	0.8	
Stair detection	High accuracy	×16	<b>x</b> 2	8	219	20	0.4	
Indoor navigation	Ultra high accuracy	×32	×4	32	570	28	0.2	

(At Ta=25 degC, VDD=1.8V, unless otherwise noted)

Note. These characteristics are guaranteed by design.

# 2. Connection

#### 2.1 Block Diagram

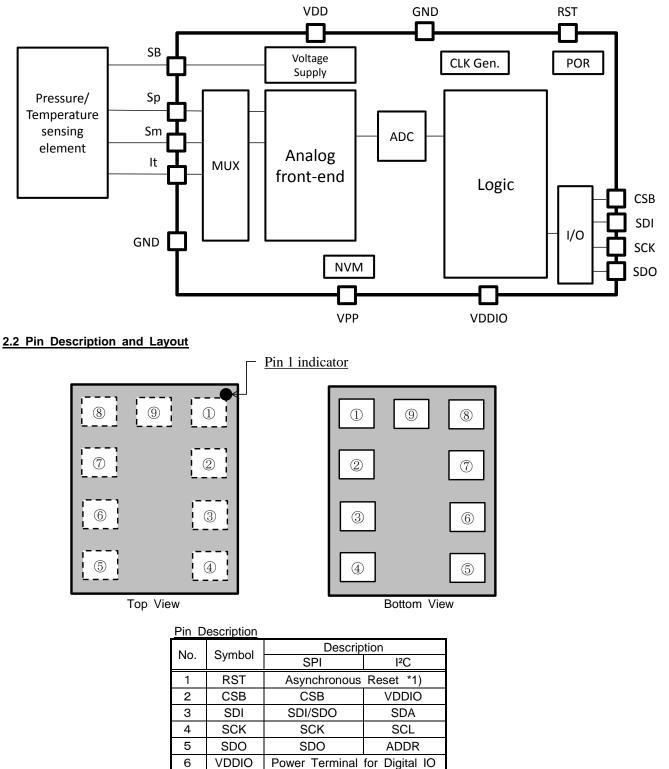

Note.

7

8

9

GND

VDD

VPP

\*1) If you do not need the reset function, please just have the layout design of PCB of connecting both No. 1 (RST) pin and No. 7 (GND) pin into the ground of PCB. Please refer "4.8 Reset Function" for the case of using the reset function.

Ground Terminal

Power Terminal


NVM Writing Terminal \*2)

\*2) Pin 9 is only used internally in OMRON. Please leave the pin disconnected. If Pin 9 is connected with any other Pin electrically, the sensor will not work properly.


#### 2.3 Typical Connection Diagram

#### (1) I<sup>2</sup>C mode


Corresponding to 100Kbit/s (at Standard Mode), 400Kbit/s (at Fast Mode) and 3.4Mbit/s (at High Speed Mode)

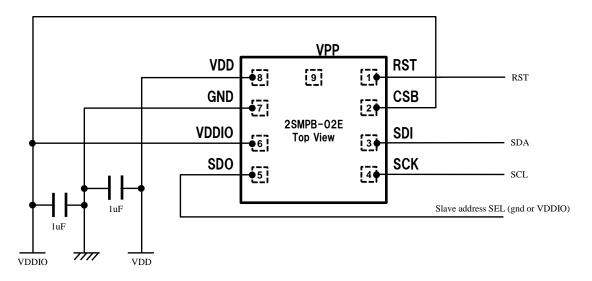

(2) 4-wire SPI mode (Corresponding to 10Mbit/s)

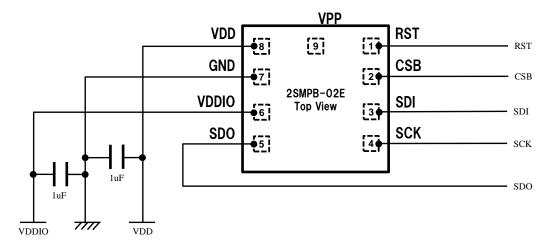

(3) 3-wire SPI mode (Corresponding to 10Mbit/s)

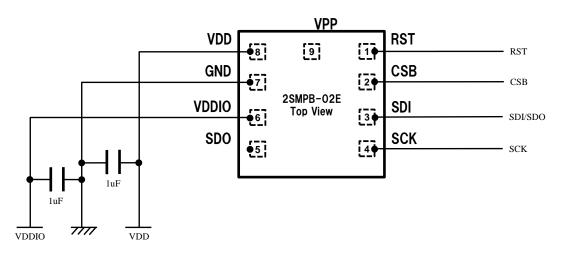


(unit: mm)

# 3. Dimensions

#### 3.1 Package


0.71 ±0.05

85 ±0.10 0



0.35


40.20 ±9.05 0.46 ±0.05 2.50 ±0.10  $2.32 \pm 0.03$ (2.17) 2.00 ±0.10 1.82 ±0.03 (1.67)

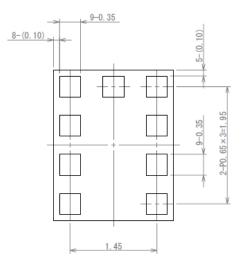

#### **3.2 Mounting PAD Dimensions**

# (Top View) : Recommended 0.65 PITCH 2.00

#### 3.3 Marking structure

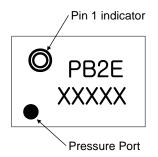

## 4. Operations

#### 4.1 Communication Mode

This sensor is corresponding to I<sup>2</sup>C and SPI communication.

Digital interface terminal functions for each communication mode are as below.

Communication mode	CSB	SDI	SCK	SDO	Remark
I <sup>2</sup> C	VDDIO	SDA	SCL	GND/VDDIO	SDO=GND→70h、SDO=VDDIO→56h
SPI 3 Wires	CSB	SDI/O	SCK	-	spi3w Register = 1
SPI 4 Wires	CSB	SDI	SCK	SDO	spi3w Register = 0

When changing the communication mode, also see Typical Connection Diagram section.


- 1) I<sup>2</sup>C mode becomes effective by pulling CSB up to VDDIO.
- 2) SPI mode becomes effective by pulling CSB down to GND.
- 3) Once CSB is pulled down, SPI mode would not be changed unless otherwise Power on Reset (POR) or Asynchronous Reset. Switching between SPI 3-Wire mode and SPI 4-Wire mode can be configured with the register value of "spi3w". Refer to IO\_SETUP register section for more detail.
- 4) Default mode after POR or Asynchronous Reset will be I<sup>2</sup>C mode.

#### 4.2 Power Mode

This sensor has three power modes and it can be switched by setting CTRL\_MEAS register. Refer to the "CTRL\_MEAS" register section for more detail.

- Sleep mode
- Normal mode
- Forced mode

Transition diagram for each mode is as follows.

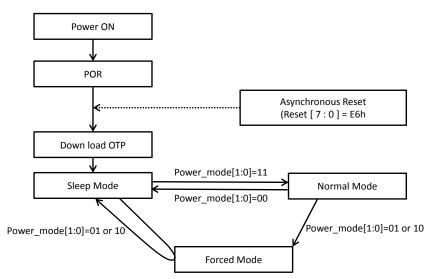


#### 1) Sleep Mode (Power Reduction Mode)

No measurements are performed.

I<sup>2</sup>C/SPI interface and each register can be accessed even if the sensor is in sleep mode.

#### 2) Forced Mode

In case of Forced Mode, a single measurement is performed. When the set up measurement is finished, the sensor returns to Sleep Mode after storing the measurement data to the register.




3) Normal Mode

In case of Normal Mode, the measurements are performed repeatedly between a measurement period and a standby period. The standby time can be configured by "t\_stanby[1:0]" register. Be sure to consider that the data must be read from the master side after a Normal Mode.

Υ						
Pow er Off · · POR	Download OTP	sleep	Temperature Measurement x temp_average[2:0]	Pressure Measurement x temp_average[2:0]	sleep	Temperature Measurement x temp_average[2:0] ····
1	N	/	N		<>	
Read CO	E_** pow	er_mode[	1:0] = 11		t_stanby[s	]

#### 4.3 Compensation of Pressure and Temperature

This section describes a typical measurement procedure and a calculation method after POR. This sensor has compensation coefficients in internal Non Volatile Memory (NVM). The compensated pressure can be calculated by using these values.

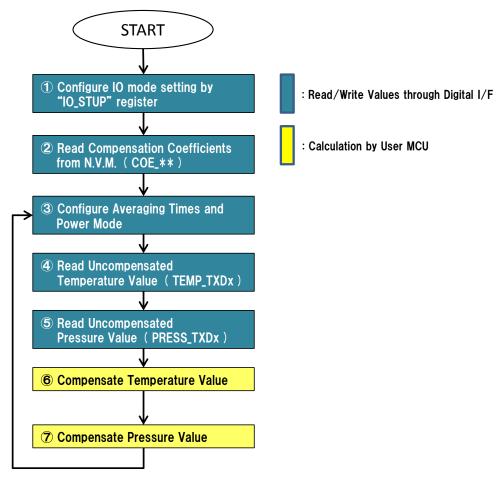

MSB of PRESS\_TXDx, TEMP\_TXDx and COE\_\*\* are sign bit.

- ① Configure IO mode setting. Refer to IO\_SETUP register section for more detail.
- ② Read compensation coefficients which are stored in NVM. This procedure is sufficient just once after POR. These values are used for a compensation calculation at the step ⑥ and ⑦.
- 3 Configure averaging times and power mode. Refer to CTRL\_MEAS register section for more detail.
- ④ Read raw temperature data which are stored in TEMP\_TXDx registers.
- 5 Read raw pressure data which are stored in PRESS\_TXDx registers.
- 6 Compensated temperature can be calculated by using the below formula and the values of the step (2) and (4).

$$Tr = a0 + a1 \bullet Dt + a2 \bullet Dt^2$$

Tr Calculation Result of Temperature (Tr/256 = Temperature [degreeC])

e.g.) If Tr Value is 6400 LSB,

Temperature (degreeC) = 
$$\frac{\text{Tr Value (LSB)}}{\text{Scaling Factor}} = \frac{6400 \text{ LSB}}{256 \text{ LSB/degree C}} = 25.00 \text{ degreeC}$$

- Dt Raw Temperature Data [digit] (20-24bits measurement value of TEMP\_TXDx Reg.)
- a0 Compensation Coefficient of PTAT (NVM resister: COE\_a0\_ex, COE\_a0\_0, COE\_a0\_1)
- a1 Compensation Coefficient of PTAT (NVM resister: COE\_a1\_0, COE\_a1\_1)
- a2 Compensation Coefficient of PTAT (NVM resister: COE\_a2\_0, COE\_a2\_1 )

Correction pressure without temperature compensation can be calculated by using the below formula and the values of the step (2) and (6).

$$Pr = b00 + bt1 \bullet Tr + bp1 \bullet Dp + b11 \bullet Dp \bullet Tr + bt2 \bullet Tr^{2} + bp2 \bullet Dp^{2}$$
$$+ b12 \bullet Dp \bullet Tr^{2} + b21 \bullet Dp^{2} \bullet Tr + bp3 \bullet Dp^{3}$$

- Pr Calculation Result of Pressure [Pa]
- Tr Calculation Result of Temperature (Tr/256 = Temperature [degreeC])
- Dp Raw Pressure Data [digit] (20-24bits measurement value of PRESS\_TXDx Reg.)
- b00 Compensation Coefficient of Pressure ( NVM resister: COE\_b00\_ex, COE\_b00\_0, COE\_b00\_1 )
- bt1 Compensation Coefficient of Pressure (NVM resister: COE\_bt1\_0, COE\_bt1\_1)
- bp1 Compensation Coefficient of Pressure (NVM resister: COE\_bp1\_0, COE\_bp1\_1)
- b11 Compensation Coefficient of Pressure (NVM resister: COE\_b11\_0, COE\_b11\_1)
- bt2 Compensation Coefficient of Pressure (NVM resister: COE\_bt2\_0, COE\_bt2\_1)
- bp2 Compensation Coefficient of Pressure (NVM resister: COE\_bp2\_0, COE\_bp2\_1)
  b12 Compensation Coefficient of Pressure (NVM resister: COE\_b12\_0, COE\_b12\_1)
  - Compensation Coefficient of Pressure (NVM resister: COE\_b12\_0, COE\_b12\_1)
    Compensation Coefficient of Pressure (NVM resister: COE\_b21\_0, COE\_b21\_1)
- b21 Compensation Coefficient of Pressure (NVM resister: COE\_b21\_0, COE\_b21\_1)
  bp3 Compensation Coefficient of Pressure (NVM resister: COE\_bp3\_0, COE\_bp3\_1)
- bps Compensation Coefficient of Pressure ( NVNi resister. COE\_bps\_0, COE\_bps\_1)

#### • How to get compensation coefficients

Each compensation coefficients can be calculated by using the below formula and conversion factors.

$$K = A + \frac{S \times OTP}{32767}$$
 ....a1,a2,bt1,bt2,bp1,b11,bp2,b12,b21,bp3  $K = \frac{OTP}{16}$ .....a0,b00

к	Conversio	n factor		OTP	
Λ	A	S	23-16bit	15-8bit	7-0bit
a1	-6.3E-03	4.3E-04	-	COE_a1_1	COE_a1_0
a2	-1.9E-11	1.2E-10	-	COE_a2_2	COE_a2_0
bt1	1.0E-01	9.1E-02	-	COE_bt1_1	COE_bt1_0
bt2	1.2E-08	1.2E-06	-	COE_bt2_1	COE_bt2_0
bp1	3.3E-02	1.9E-02	-	COE_bp1_1	COE_bp1_0
b11	2.1E-07	1.4E-07	-	COE_b11_1	COE_b11_0
bp2	-6.3E-10	3.5E-10	-	COE_bp2_1	COE_bp2_0
b12	2.9E-13	7.6E-13	-	COE_bp12_1	COE_bp12_0
b21	2.1E-15	1.2E-14	-	COE_bp21_1	COE_bp21_0
bp3	1.3E-16	7.9E-17	-	COE_bp3_1	COE_bp3_0

K	Conversion factor		OTP	
ĸ		19-12bit	11-4bit	3-0bit
a0	Offset value (20Q16)	COE_a0_1	COE_a0_0	COE_a0_ex
b00	Offset value (20Q16)	COE_b00_1	COE_b00_0	COE_b00_ex

TEMP(PRESS)\_TXDx : Temperature and Pressure data : TXD0, TXD1 or TXD2

This sensor holds ADC data with 22 to 24 bits accuracy. It can be obtained as each 24 bits data. If there are redundant data, the low order positions will be filled by zero (0). The shaded regions as shown below are valid data area.

bit	24	23	22	 5	4	3	2	1	Note
22bits output	D21	D20	D19	 D2	D1	D0	0	0	Temp/Press_ave=001
23bits output	D22	D21	D20	 D3	D2	D1	D0	0	Temp/Press_ave=010
24bits output	D23	D22	D21	 D4	D3	D2	D1	D0	Temp/Press_ave=011~111
	-								

%Dn(D23~D0) : Sensor Data .....The value of n bit (1 or 0)

%The raw measurement values are unsigned 24bits values. The values need to do subtraction with 2<sup>23</sup> at 24bits output mode. Here is a programing example for Dt and Dp calculation.

 $Dt = ((TEMP \_ TXD2) <<16) + ((TEMP \_ TXD1) <<8) + (TEMP \_ TXD0) - pow(2,23)$  $Dp = ((PRESS \_ TXD2) <<16) + ((PRESS \_ TXD1) <<8) + (PRESS \_ TXD0) - pow(2,23)$ 

#### 4.4 Implementing Register List

	٨dd	ress							Data					
Register Name	120	SPI	Length	R/W	bit7	bit6	bit5	bit4	bit3	bit2	bit1	bit0	Discription	Initial
TEMP TXD0	0xFC	0x7C	8bit	R/-	DIL/	DILU	DILU		t txd0[7:0]	DILZ	DICT	DILU	Temperature DATA[8:1] in 24bit	00h
TEMP_TXD1	0xFB	0x7B	8bit	R/-					t txd1[7:0]				Temperature DATA[16:9] in 24bit	00h
TEMP_TXD2	0xFA	0x7A	8bit	R/-					t txd2[7:0]				Temperature DATA[24:17] in 24bit (*)	00h
PRESS TXD0	0xF9	0x79	8bit	R/-					o txd0[7:0]				Pressure DATA[8:1] in 24bit	00h
PRESS TXD1	0xF8	0x78	8bit	R/-					o_txd1[7:0]				Pressure DATA[16:9] in 24bit	00h
PRESS_TXD2	0xF7	0x77	8bit	R/-					o txd2[7:0]				Pressure DATA[24:17] in 24bit (*)	00h
													t stanby[2:0] : Standby time setting	
IO_SETUP	0xF5	0x75	8bit	R/W	t_s	tanby[2	:0]		-	spi3_s	-	spi3w	spi3w : SPI mode setting (4 or 3 wire)	00h
-										dim		·	spi3 sdim : Select output type of SDI terminal	
													temp_average[2:0] : Temperature Averaging times	
CTRL_MEAS	0xF4	0x74	8bit	R/W	temp_	average	e[2:0]	pre	ss_average	[2:0]	power	r_mode[1:0]	press_average[2:0] : Pressure Averaging times	00h
-											-		power_mode[1:0] : Power mode setting	
	0 50	0.70	01.11	D (									measure : Status of measurement	0.01
DEVICE_STAT	0xF3	0x73	8bit	R/-	-	-	-	-	measure	-	-	otp_update	otp_update : Status of OTP data access	00h
I2C_SET	0xF2	0x72	8bit	R/W	-	-	1	-	-	ma	aster_co	ode[2:0]	Master code setting at I2C HS mode	01h
IIR_CNT	0xF1	0x71	8bit	R/W	-	-	1	-	-		filter[	2:0]	IIR filter co-efficient setting	00h
DECET	0 50	0.00	01.1	14/					reset[7:0]				When inputting"E6h",	0.01
RESET	0xE0	0x60	8bit	W					reset[7:0]				a software reset will be occurred	00h
CHIP_ID	0xD1	0x51	8bit	R/-					chip_id[7:0]				CHIP_ID: 5Ch	5Ch
COE_b00_a0_ex	0xB8	0x38	8bit	R/-				b00	[3:0] / a0[3	3:0]			Compensation Coefficient	-
COE_a2_0	0xB7	0x37	8bit	R/-					a2[7:0]				Compensation Coefficient	-
COE_a2_1	0xB6	0x36	8bit	R/-					a2[15:8]				Compensation Coefficient (*)	-
COE_a1_0	0xB5	0x35	8bit	R/-					a1[7:0]				Compensation Coefficient	-
COE_a1_1	0xB4	0x34	8bit	R/-					a1[15:8]				Compensation Coefficient (*)	-
COE_a0_0	0xB3	0x33	8bit	R/-					a0[11:4]				Compensation Coefficient	-
COE_a0_1	0xB2	0x32	8bit	R/-					a0[19:12]				Compensation Coefficient (*)	-
COE_bp3_0	0xB1	0x31	8bit	R/-					bp3[7:0]				Compensation Coefficient	-
COE_bp3_1	0xB0	0x30	8bit	R/-					bp3[15:8]				Compensation Coefficient (*)	-
COE_b21_0	0xAF	0x2F	8bit	R/-					b21[7:0]				Compensation Coefficient	-
COE_b21_1	0xAE	0x2E	8bit	R/-					b21[15:8]				Compensation Coefficient (*)	-
COE_b12_0	0xAD	0x2D	8bit	R/-					b12[7:0]				Compensation Coefficient	-
COE_b12_1	0xAC	0x2C	8bit	R/-					b12[15:8]				Compensation Coefficient (*)	-
COE_bp2_0	0xAB	0x2B	8bit	R/-					bp2[7:0]				Compensation Coefficient	-
COE_bp2_1	0xAA	0x2A	8bit	R/-					bp2[15:8]				Compensation Coefficient (*)	-
COE_b11_0	0xA9	0x29	8bit	R/-					b11[7:0]				Compensation Coefficient	-
COE_b11_1	0xA8	0x28	8bit	R/-					b11[15:8]				Compensation Coefficient (*)	-
COE_bp1_0	0xA7	0x27	8bit	R/-					bp1[7:0]				Compensation Coefficient	-
COE_bp1_1	0xA6	0x26	8bit	R/-					bp1[15:8]				Compensation Coefficient (*)	-
COE_bt2_0	0xA5	0x25	8bit	R/-					bt2[7:0]				Compensation Coefficient	-
COE_bt2_1	0xA4	0x24	8bit	R/-					bt2[15:8]				Compensation Coefficient (*)	-
COE bt1_0	0xA3	0x23	8bit	R/-					bt1[7:0]				Compensation Coefficient	-
COE bt1_1	0xA2	0x22	8bit	R/-					bt1[15:8]				Compensation Coefficient (*)	-
COE 600 0	0xA1	0x21	8bit	R/-					b00[11:4]				Compensation Coefficient	-
COE b00 1	0xA0	0x20	8bit	R/-					b00[19:12]				Compensation Coefficient (*)	-

(\*) MSB of PRESS\_TXDx, TEMP\_TXDx and COE\_\*\* are sign bit.

#### IO\_SETUP : IO SETUP Register

Register N	lame	I <sup>2</sup> C Addr.	SPI Addr.	Length	R/W	bit7	bit6	bit5	bit4	bit3	bit2	bit1	bit0	initial
IO_SET	UP	0xF5	0x75	8bits	R/W	t	_stanby[2:0	)]	-	-	spi3_sdim	-	spi3w	0x00
bit7~5	t_stan	by[2:0] : S	Standby tir	ne setti	ng									
	00	0 00	01	010	011	1	00	101	110	11	1			
	1n	ns 5	ms 5	0ms	250m	ns 50	0ms	1s	2s	4:	S			
bit3~4	Reser	ved : keep	o these bit	s at 0										
bit2		dim : Sele		type of	SDI te	rminal								
		.o / Hi-Z o												
		o / Hi outp												
bit1	Reser	ved : keep	o this bit a	t 0										
bit0	•	: Change		ween S	PI 4-w	ire and	SPI 3-wi	re						
		-wire (Def	fault)											
	1:3	-wire												

#### CTRL\_MEAS : Measurement Condition Control Register

0:

Register Name	I <sup>2</sup> C Addr.	SPI Addr.	Length	R/W	bit7	bi	it6	bit5	bit4	bit3	bit2	bit1	bit0	initial
CTRL_MEAS	0xF4	0x74	8bits	R/W	ter	np_ave	erage[2:0	0]	pres	ss_average	[2:0]	power_m	node[1:0]	0x00
bit7,6,5 temp_ave	erage[2:0]	Ave	raging	times	setting f	or Te	mpera	ature m	easurer	nent (sk	ip means	s no mea	asureme	nt.)
		00	0 0	01	010 0	11	100	101	110	111				
		sk	lip	1	2	4	8	16	32	64				
bit4,3,2 press_av	erage[2:0]	Ave	raging	times	setting f	or Pre	essure	e meas	uremen	t(skip m	neans no	measur	ement.)	
		00	0 0	01	010 0	11	100	101	110	111				
		sk	lip	1	2	4	8	16	32	64				
bit1,0 power_m	ode[1:0]	Ope 00 01, 11	: 10 :	Sleep Force	setting mode d mode I mode				· · · ·					

#### **DEVICE\_STAT : Device Status Register**

Register Name	I <sup>2</sup> C Addr.	SPI Addr.	Length	R/W	bit7	bit6	bit5	bit4	bit3	bit2	bit1	bit0	initial
DEVICE_STAT	0xF3	0x73	8bits	R	-	-	-	-	measure	-	-	otp_update	0x00

	bit7~4	Reserved : keep these bits at 0	
--	--------	---------------------------------	--

Device operation status. This value automatically changes.

Finish a measurement -- waiting for next measurement

On a measurement -- waiting for finishing the data store

1: bit2,1 Reserved : keep these bits at 0

measure

otp\_update

bit3

bit0

The status of OTP data access. This value automatically changes.

0: No accessing OTP data

1: While accessing OTP data

#### I<sup>2</sup>C\_SET : Master code setting

Register Name	I <sup>2</sup> C Addr.	SPI Addr.	Length	R/W	bit7	bit6	bit5	bit4	bit3	bit2	bit1	bit0	initial
I <sup>2</sup> C_SET	0xF2	0x72	8bits	R/W	-	-	-	-	-	master_code[2:0]		2:0]	0x01

#### bit7~3 Reserved : keep these bits at 0 bit2,1,0 master code[2:0] Master code

Master code setting at I<sup>2</sup>C high-speed mode.

000	001	010	011	100	101	110	111
0x08	0x09	0x0A	0x0B	0x0C	0x0D	0x0E	0x0F

#### IIR\_CNT : IIR filter co-efficient setting Register


Register Name	I <sup>2</sup> C Addr.	SPI Addr.	Length	R/W	bit7	bit6	bit5	bit4	bit3	bit2	bit1	bit0	initial
IIR_CNT	0xF1	0X71	8bits	R/W	-	-	-	-	-	filter[2:0]			0x00

bit7~3 Reserved : keep these bits at 0

bit2,1,0 filter[2:0] IIR filter co-efficient setting

Write access to this register address, IIR filter will be initialized.

Note. Initial setting of the IIR filter coefficient is "OFF"

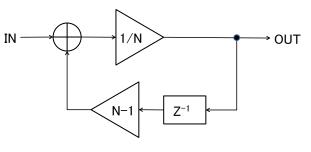

000	001	010	011	100	101	110	111
OFF	N=2	N=4	N=8	N=16	N=32	N=32	N=32

#### **RESET : Reset Control Register**

Register Name	I <sup>2</sup> C Addr.	SPI Addr.	Length	R/W	bit7	bit6	bit5	bit4	bit3	bit2	bit1	bit0	initial
RESET	0xE0	0x60	8bits	W				rese	t[7:0]				0x00

bit7~0 reset[7:0]

When input "E6h", the software reset will be effective. Except for that, nothing is to happen.

#### CHIP\_ID : Chip ID Confirmation Register

ſ	Register Name	I <sup>2</sup> C Addr.	SPI Addr.	Length	R/W	bit7	bit6	bit5	bit4	bit3	bit2	bit1	bit0	initial
ſ	CHIP_ID	0xD1	0x51	8bits	R	chip_id[7:0]					0x5C			
	bit7~0 chip_id[7:	:0]	5C											

#### 4.5 I<sup>2</sup>C Protocol

# (1) I<sup>2</sup>C Slave Address

The 2SMPB-02 module I<sup>2</sup>C slave address is shown below.

SDO	I <sup>2</sup> C Slave	Bit	bit7	bit6	bit5	bit4	bit3	bit2	bit1	bit0
300	Address (7bits)	DIL	Add[6]	Add[5]	Add[4]	Add[3]	Add[2]	Add[1]	Add[0]	R/W
High(1)	56h+R/W	Value	1	0	1	0	1	1	0	1/0
Low(0)	70h+R/W	Value	1	1	1	0	0	0	0	1/0

For example, in case of SDO=Low (0),

Write Access : Please set LSB of slave address as "0", then the address is E0h(1110\_0000b). (70h<<1+WR(0)) Read Access : Please set LSB of slave address as "1", then the address is E1h(1110\_0001b). (70h<<1+RD(1))


#### (2) I<sup>2</sup>C Access Protocol Examples

- Symbol : START condition START
- STOP

- : STOP condition
- **Re-START** : Re-START condition for Read : Acknowledge by Slave
- SACK
- MACK : Acknowledge by Master
- MNACK: Not Acknowledge by Master

#### (3) Register Write Access Protocol


After the START condition, a Device Address is sent. This address is seven bits long followed by an eighth bit which is a data direction bit. A 'zero' indicates a transmission "WRITE". After that, the register address and the writing data shall be one set and it should be continuously transmitted until a STOP condition. A data transfer is always terminated by a STOP condition generated by the master.

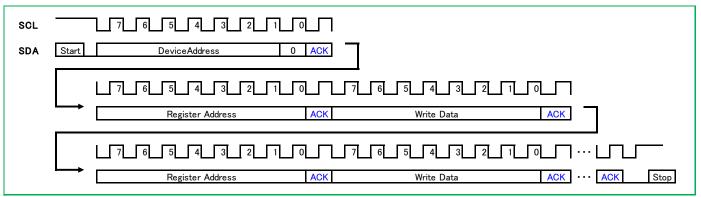

<sup>※</sup>Black characters : Master → Slave / Blue characters : Slave → Master

#### (4) Register Read Access Protocol

After a START condition, the Device Address with WRITE sign ("0") and Word Address intended to read a fir st data are transmitted. Next, "STOP-START" or "Re-START" condition are transmitted by the master. After th at, Device Address with READ sign ("1") is transmitted by the master. Then, the slave will output the first dat a that is intended to read. In case of incrementing Register Address automatically, the slave will output the d ata repeatedly until NACK is input by the master. If Register Address becomes "0xFF", please continue to out put "0xFF." Below example shows 3 bytes reading method from "0xFA" register.

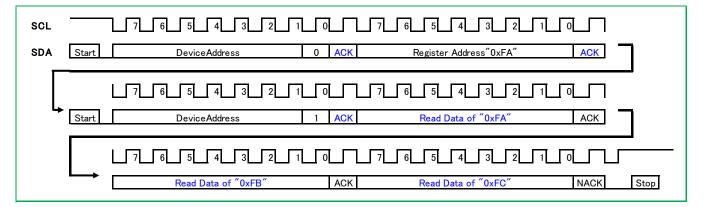

#### 4.6 SPI Protocol

#### (1) SPI write

"SPI Write" needs to transmit the one set data of Register Address(Ctl.="0"+Address) and a writing data in the situation where CSB is "L". Two or more writing can be possible during CSB is "L". If CSB becomes "H", SPI communication will finish. (as well as I<sup>2</sup>C write)

сѕв								
scк	ノ … //~ /	<u> </u>		$\sim$		·/- ···	\\	
SDI/O Start 0	Address(7bit)	Write Data(	8bit)	0	Address(7bit)	Write Data(	8bit) ····	Stop

#### (2) SPI read

First, "SPI read" needs to transmit Register Address(Ctl.="1"+Address) in a situation where CSB is "L". Next, the data of the requested register address will be output from SDO. (in case of 3-wire mode, the data will

be output from SDI). After that, the register address will be output norm object (in case of o whe mode, the data will be output from SDI). After that, the register address is automatically incremented by one until CSB becomes "H", the device will output the data repeatedly. (as well as I<sup>2</sup>C read) Below shows an example of the 2 bytes reading from "0xFA" register.

СЅВ				
scк —	┌ … ∖/¯	<u>√</u> … /	√~ …	$\sqrt{}$
SDI/O Start 1	Address"0x7A"(7bit)	Read Data of "0x7A"	Read Data of "	0x7B″ Stop

#### 4.7 Interface specifications


#### (1) I<sup>2</sup>C timings

All timings apply to 100kbps(at Standard Mode), 400kbps (at Fast Mode) and 3.4Mbps(at High Speed Mode). For I<sup>2</sup>C timings, the following abbreviations are used :

\*1) S&F Mode = standard and fast mode

\*2) Cb = bus capacitance on SDI line

All other naming refers to I<sup>2</sup>C specification 2.1 (January 2000).

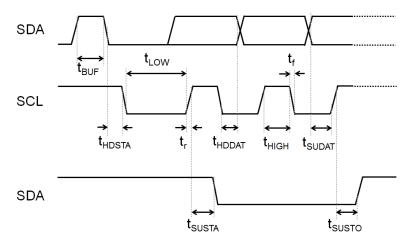


Undescribed items and symbols are compliant with the I<sup>2</sup>C specification.

Items	Symbol	Conditio	n	min	typ	max	Units	Remark
		S&F Mode *1)		160	-	-	ns	
SDI setup time	t <sub>SUDAT</sub>	HS Mode *2)	Vio=1.62V	30	-	-	ns	
		HS Mode	Vio=1.2V	55	-	-	ns	
		S&F Mode,Cb≦100p	F	80	-	-	ns	
		S&F Mode,Cb≦400p	F	90	-	-	ns	
	+	HS Mode,Cb≦	Vio=1.62V	18	-	115	ns	
SDI hold time	HDDAT	100pF	Vio=1.2V	25	-	140	ns	
		HS Mode,Cb≦	Vio=1.62V	24	-	150	ns	
		400pF	Vio=1.2V	45		170	ns	
	+	HS Mode,Cb≦	Vio=1.62V	160	-	-	ns	
SCK low pulse	Low	100pF	Vio=1.2V	210	-	-	ns	

#### (2) SPI timings

All timings are applied both to 4- and 3-wire SPI. To reduce external noise in High-Z state, we recommend the following; In 4-wire mode, SDO terminal is pulled up to Vio via the resister. In 3-wire mode, SDI terminal is pulled up to Vio via the resister. e.g.) Rpullup =  $3.6k\Omega$  @Vio=1.8V.

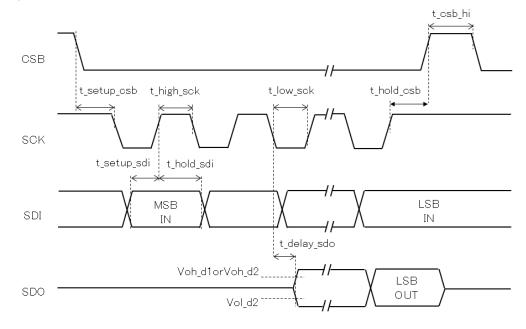


Items	Symbol	Condition	min	typ	max	Units	Remark
SCK frequency	f_spi			_	10	MHz	
SCK low pulse	t_low_sck		40			ns	
SCK high pulse	t_high_sck		40		_	ns	
SDI setup time	t_setup_sdi		20		_	ns	
SDI hold time	t_hold_sdi		20		_	ns	
		Cb=25pF,Vio=1.62V min	_		30	ns	
SDO output delay	t_delay_sdo	Cb=25pF,Vio=1.2V min	_	_	40	ns	
CSB setup time	t_setup_csb		40		_	ns	
CSB hold time	t_hold_csb		40	_		ns	
CSB_HI time	t_csb_hi		100		_	ns	

## 4.8 Reset Function

The sensor is capable of resetting the operation with "Asynchronous Reset Terminal (RST pin)".

- The procedure is as follows:
  - 1 Input high voltage to RST pin. (100us  $\geqq$ )
  - 2 Turn off (input low voltage) and wait 10ms.

#### ♦Reset sequence

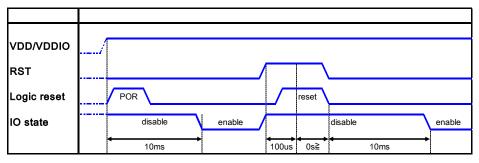


#### 4.9 Recommended conditions of communication

In case that this sensor and other sensors are connected with a common bus line, if you use this sensor at a communication speed more than 400kbit/s,

after finishing the communication with other sensors, we recommend to provide 1 ms or more waiting time before starting the communication with this sensor in order to ensure a stable communication (see diagram below).

◆Typical connection diagram

Example of communication



# 5. Packaging


#### 5.1 Configuration of shipment

Packaging	Embossed Carrier Tape
Quantity	3,500 pcs / 1 reel
	1 reel / 1 Interior box
	Max. 20 Interior boxes / 1 exterior box
Reel	180 mm dia.
Insert method	see below

Specification of taping & reel comply with JIS C 0806-3 (IEC 60286-3).


#### 5.2 Taping

Emboss pitch 4 mm type & tape width 8 mm type.

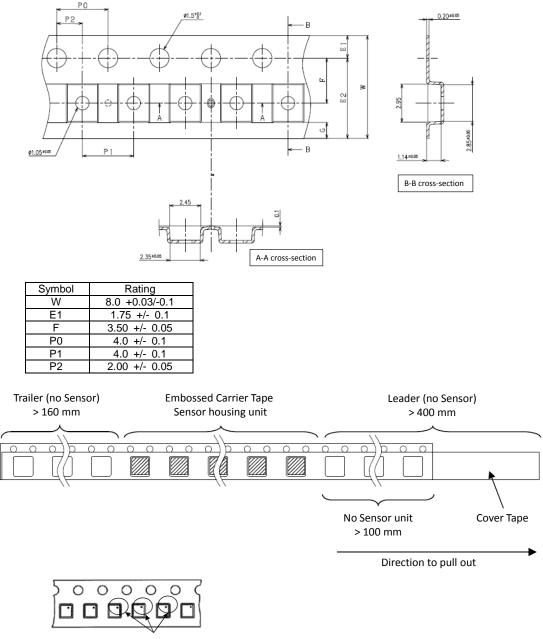


1 pin Mark

5.3 Reel

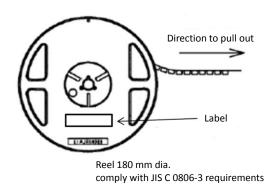


5.4 Individual packaging

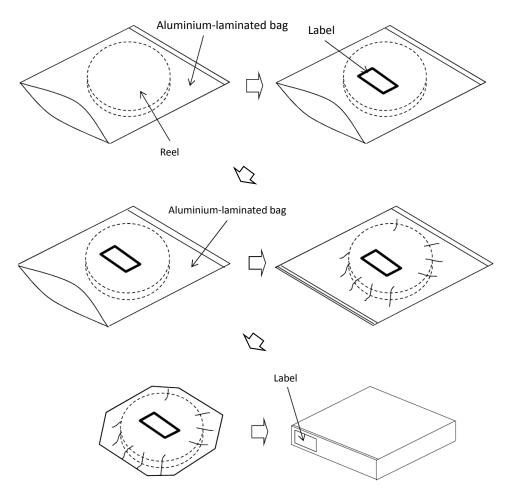

# 6. Recommended Soldering Method

- Soldering method
- : Air Reflow (Max 2 times)
- Condition of Temperature : Max.260 degreeC, within 40seconds Recommended Soldering Method

.

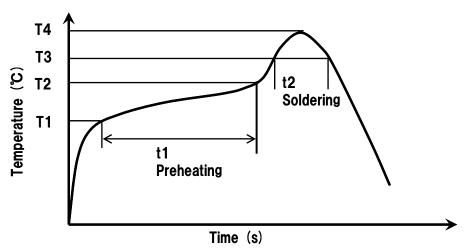

Temperature profile conditions of reflow soldering should set the temperature condition as shown in the below table and then confirm that actual conditions are met them in the table

Item	Preheating (T1 to T2, t1)	Soldering (T3, t2)	Peak Value (T4)				
Terminal	150 degreeC to 200 degreeC	217degreeC min.	260 degreeC				
	60sec to 180sec.	60sec to 150sec.	20sec to 40sec				

Since the pressure sensor chip is exposed to atmosphere, cleaning fluid shall not be allowed to enter inside the sensor's case.

We recommend that it should be used the recommended mounting PAD dimensions for the land pattern.

#### 7. Precautions

- (1) Handling
  - Only air can be used as pressure media on the product directly. It is prohibited to use pressure media including corrosive 1) gases (e.g. organic solvents gases, sulfur dioxide and hydrogen sulfide gases), fluid and any other foreign materials.
  - 2) The products are not water proof. The product shall be kept dry in use excluding the sensor port.
  - 3) The product shall not be used under dew-condensing conditions. Frozen fluid on sensor chips may cause fluctuation of sensor output and other troubles.
  - The product shall be used within rated pressure. Usage at pressure out of the range may cause breakage. 4)
  - The product may be damaged by static electricity. Charged materials (e.g. a workbench and a floor) and workers should pro-5) vide measures against static electricity, including ground connection.
  - 6) The product shall not be dropped and handled roughly.
  - The product shall not be used under dusty or damp condition. 7)
  - Do not wash the print circuit board after the pressure sensor is mounted using solvent. It may cause a mal-8) function.
  - Please connect the sensor terminals according to the connection diagram. 9)
  - 10) The product shall not be used under high-frequency vibration including ultrasonic wave.
  - This product uses the elastic adhesive for bonding the lid, so do not add excessive stress to the lid. 11)
  - If soldering is not fit, then this product may catch fire or get hot. 12)
  - There is a possibility that the peripheral circuit board or some electronic part generates heat while driving this 13) product. Please handle with care.
  - 14) Do not tear down this product.
  - Please do not use the sensor after following case; 15)
    - excessive shock added to the terminal of the sensor
      - the sensor lid decapped
      - the sensor dropped
  - 16) If you use other conditions described in this document, please check yourself in advance.

- (2) Environmental conditions for transport and storage
  - 1) The product shall not be kept with corrosive gases (e.g. organic solvents gases, sulfur dioxide and hydrogen sulfide gases).
  - 2) The products are not water proof. The product shall be kept dry during storage.
  - 3) The outer box strength may be degraded depending on the storage conditions. Please use the product in order.
  - 4) For this product, please keep away from direct sunlight or ultraviolet rays.
  - 5) The product shall be kept in appropriate conditions of temperature and humidity.
  - 6) The product shall not be kept under dusty or damp condition.

# 8. Warranty and Limited Warranty

#### (1) Definition

- The definition of terms used in these Terms and Conditions are as follows:
- 1) Usage conditions: Usage conditions, rating, performance, operating environment, handling instructions, cautions, prohibited use, etc. of *Omron products* described in specifications, documentations or manuals.
- Customer application: Application of Omron products by customers which include embedding and/or using Omron products in their parts/components, electronic substrates, devices, equipment or systems manufactured by customers.
- 3) *Fitness*: (a) performance, (b) non-infringement of third-party intellectual property, (c) compliance with laws and regulations and (d) conformity to various standards.

#### (2) Caution on Descriptions

Attention is required to the following points on descriptions in specifications.

- Rated values and performance values are the product of tests performed for separate single conditions, including but not limited to temperature and humidity. It is not intended to warrant rated values and performance values for multiple combined conditions.
- 2) Reference data are provided for reference only. *Omron* does NOT warrant that *Omron products* work properly at all time in the range of reference data.
- 3) Application examples are provided for reference only. *Omron* does NOT warrant the *Fitness* of *Omron* products under such application.
- 4) *Omron* may discontinue the production of *Omron products* or change the specifications of them for the purpose of improving such products or other reasons entirely at its own discretion.

#### (3) Precautions

Please be aware of and accept the following when you introduce or use Omron products:

- 1) Please use *Omron products* in compliance with *usage conditions* including rating and performance.
- 2) Please confirm *fitness* of *Omron products* in your application and use your own judgment to determine the appropriateness of using them in such application. *Omron* shall not warrant the *fitness* of *Omron products* in customer application.
- 3) Please confirm that *Omron products* are properly wired and installed for their intended use in your overall system.
- 4) When using *Omron products*, please make sure to (i) maintain a margin of safety vis-à-vis the published rated and performance values, (ii) design to minimize risks to customer application in case of failure of *Omron products*, such as introducing redundancy, (iii) introduce system-wide safety measures to notify risks to users, and (iv) conduct regular maintenance on *Omron products* and *customer application*.
- 5) *Omron products* are designed and manufactured as general-purpose products for use in general industrial products. They are not intended to be used in the following applications. If you are using *Omron products* in the following applications, *Omron* shall not provide any warranty for such *Omron products*.
  - (a) Applications with stringent safety requirements, including but not limited to nuclear power control equipment, combustion equipment, aerospace equipment, railway equipment, elevator/lift equipment, amusement park equipment, medical equipment, safety devices and other applications that could cause danger/harm to people's body and life.
  - (b) Applications that require high reliability, including but not limited to supply systems for gas, water and electricity, etc., 24 hour continuous operating systems, financial settlement systems and other applications that handle rights and property.
  - (c) Applications under severe condition or in severe environment, including but not limited to outdoor equipment, equipment exposed to chemical contamination, equipment exposed to electromagnetic interference and equipment exposed to vibration and shocks
  - (d) Applications under conditions and environment not described in specification

- 6) In addition to the applications listed from (a) to (d) above, *Omron products* are not intended for use in automotive applications (including two wheel vehicles). Please do NOT use *Omron products* for automotive applications. Please contact *Omron* sales staff for products for automotive use.
- (4) Warranty Terms and Conditions

The terms and conditions for warranty of *Omron products* are as follows:

- 1) Warranty period: One year after the purchase.
- 2) Coverage: *Omron* will provide free replacement of the malfunctioning Omron products with the same number of replacement/alternative products
- 3) Exceptions: *Omron* will not cover *Omron products* under its warranty if the cause of the malfunction falls under any of the following.
  - (a) Usage in a manner other than the original intended use for the *Omron product*.
  - (b) Usage outside of the *usage conditions*.
  - (c) Cause which could not have been foreseen with the level of science and technology at the time of shipping from *Omron*.
  - (d) Causes originating from other than *Omron* or *Omron products* (including force majeure such as but not limited to natural disasters).
- (5) Limitation of Liability

The warranty set out in these Terms and Conditions is the whole and sole liability for *Omron products*. There are no other warranties, expressed or implied. *Omron* and the distributors of *Omron products* are not liable for any damages which may arise from or be related to *Omron products*.

(6) Export Controls

Customers of *Omron products* shall comply with all applicable laws and regulations of other relevant countries with regard to security export control, when exporting *Omron products* and/or technical documents or providing such products and/or documents to a non-resident. *Omron* may not provide customers with *Omron products* and/or technical documents should they fail to comply with such laws and regulations.

(Intentionally left blank)

# **Mouser Electronics**

Authorized Distributor

Click to View Pricing, Inventory, Delivery & Lifecycle Information:

Omron: 2SMPB-02E