


HANDHELD DIGITAL MANOMETER

PG-100B

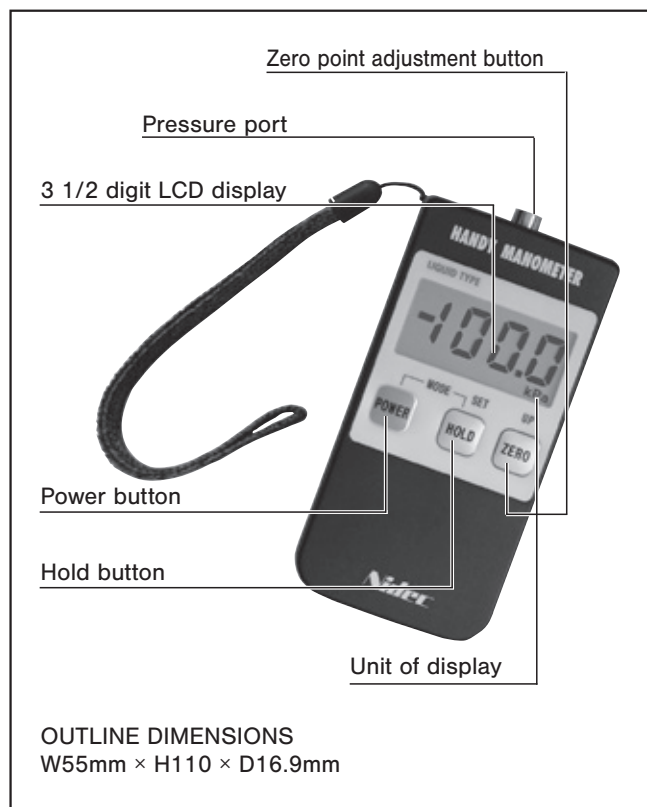

FEATURES

- **New lineup of PG-100 series for measuring gas and liquid pressure**
- **Capable of measuring Absolute pressure (PG-100B-102A)**
- **Excellent stability**
High precision semiconductor chip combined with temperature compensation circuit guarantee excellent stability.
- **Long battery life**
Lasts more than 1000hrs with two AAA dry batteries.
- **Automatic power off function**
- **Easy, one-handed operation**
- **Easy-to-read large LCD display**
- **Pressure unit selectable type also available (PG-100B-****-W).**

MODEL NUMBER DESIGNATION

P G - 1 0 0 B - 1 0 2 R - M X2 T							
Series name			Rated pressure range			Traceability system chart	
			Pressure reference			Blank : Not attached T : Traceability system chart	
102R : - 100 ~ 100 kPa Gauge(Compound)						Inspection report / Calibration Certificate	
103R : - 100 ~ 1000 kPa Gauge(Compound)						Blank : Not attached X1 : Inspection report	
102A : 0 ~ 100 kPa abs						X2 : Inspection report and Calibration certificate	
						Unit of display	
						Blank : kPa M : MPa H : mmHg W : Selectable(bar, psi, inch Hg, mmHg, kPa, MPa according to the pressure range) ※	

※ : 103R range products do not correspond to Unit mmHg of Pressure unit selectable W type.
(Refer to the Pressure unit selectable W type below.)

Pressure unit selectable W type

Pressure range	Unit selectable W type						
	kPa	Mpa	mmHg	in.Hg	mmAg	psi	bar
102R	○	○	○	○	—	○	○
103R	○	○	—	○	—	○	○
102A	○	○	○	○	—	○	○

※ " — " is not supported as a display unit.

PG-100B

HANDHELD DIGITAL MANOMETER

LIST OF MODEL NUMBERS <For non-corrosive gas>

Pressure reference		Gauge(Compound)		Absolute
Rated pressure range (kPa)		-100 ~ 100	-100 ~ 1000	0 ~ 100 (abs)
kPa	Product only	PG-100B-102R	PG-100B-103R	PG-100B-102A
	Inspection report	PG-100B-102R-X1	PG-100B-103R-X1	PG-100B-102A-X1
	Inspection report and Traceability system chart	PG-100B-102R-X1T	PG-100B-103R-X1T	PG-100B-102A-X1T
	Inspection report and Calibration certificate	PG-100B-102R-X2	PG-100B-103R-X2	PG-100B-102A-X2
	Traceability system chart	PG-100B-102R-T	PG-100B-103R-T	PG-100B-102A-T
	Inspection report,Calibration certificate and Traceability system chart	PG-100B-102R-X2T	PG-100B-103R-X2T	PG-100B-102A-X2T
MPa	Product only		PG-100B-103R-M	
	Inspection report		PG-100B-103R-M-X1	
	Inspection report and Traceability system chart		PG-100B-103R-M-X1T	
	Inspection report and Calibration certificate		PG-100B-103R-M-X2	
	Traceability system chart		PG-100B-103R-M-T	
	Inspection report,Calibration certificate and Traceability system chart		PG-100B-103R-M-X2T	
mmHg	Product only	PG-100B-102R-H		
	Inspection report	PG-100B-102R-H-X1		
	Inspection report and Traceability system chart	PG-100B-102R-H-X1T		
	Inspection report and Calibration certificate	PG-100B-102R-H-X2		
	Traceability system chart	PG-100B-102R-H-T		
	Inspection report,Calibration certificate and Traceability system chart	PG-100B-102R-H-X2T		
Selectable	Product only	PG-100B-102R-W	PG-100B-103R-W	PG-100B-102A-W
	Inspection report	PG-100B-102R-W-X1	PG-100B-103R-W-X1	PG-100B-102A-W-X1
	Inspection report and Traceability system chart	PG-100B-102R-W-X1T	PG-100B-103R-W-X1T	PG-100B-102A-W-X1T
	Inspection report and Calibration certificate	PG-100B-102R-W-X2	PG-100B-103R-W-X2	PG-100B-102A-W-X2
	Traceability system chart	PG-100B-102R-W-T	PG-100B-103R-W-T	PG-100B-102A-W-T
	Inspection report,Calibration certificate and Traceability system chart	PG-100B-102R-W-X2T	PG-100B-103R-W-X2T	PG-100B-102A-W-X2T

PG-100B

HANDHELD DIGITAL MANOMETER

STANDARD SPECIFICATIONS

〈kPa version〉

● Unless otherwise specified, the specs are defined at an ambient temperature of 25 ± 5 °C.

Item		PG-100B		
General specifications	Pressure reference	Gauge		Absolute
	Model number	102R	103R	102A
	Rated pressure range kPa	- 100 ~ 100	- 100 ~ 1000	0 ~ 100 kPa abs
	Maximum pressure kPa	200	2000	200 kPa abs
	Break-down pressure kPa	300	3000	300 kPa abs
	Operating temp. range °C	0 ~ 50		
	Compensated temp. range °C	0 ~ 50		
	Operating humidity % RH	15 ~ 85 (No condensation)		
	Storage temp. °C	- 20 ~ 70 (Atmospheric pressure, humidity 65 %RH maximum)		
	Pressure medium	Gases/liquids compatible with SUS316L		
	Pressure port	M5 female		
	Net weight g	Approx. 100		
	Power	AAA dry battery DC 1.5 V × 2 Battery life 1000 h minimum		
Display	No. of digits	3 1/2		
	Display element	LCD		
	Rated display range	- 100.0 ~ 100.0	- 100 ~ 1000 - 100 ~ 1.000 (MPa)	00.0 ~ 100.0
	Display cycle	Approx. 4 times/s		
	Integrated accuracy	± 0.5 %F.S. ± 2 digits (at 25 °C ± 5 °C)		
		± 1.0 %F.S. ± 2 digits (at 25 °C ± 25 °C)		± 2.0 %F.S. ± 2 digits (at 25 °C ± 25 °C)
	Resolution	1 digit		
Analog output	Power supply (External supply)	5 $\pm$ 0.5 V DC 5 mA maximum		
	Output voltage	0 ~ ± 1.000 V ※ Proportionate to display value		
	Output accuracy / Resolution	± 10 mV / 1mV		
	Output resistance	Approx. 10 k Ω		
	Response	Approx. 10 ms		
	Additional function	Auto power off, Display hold, Battery replacement display(LOBAT), Zero point adjustment		
	Accessories	Fitting (half union for 6mm OD tube), 2 AAA batteries, strap, protective cover		
	Option (Sold seperately)	PG-100B soft carrying case		

PG-100B

HANDHELD DIGITAL MANOMETER

STANDARD SPECIFICATIONS

〈Non SI unit version〉

● Unless otherwise specified, the specs are defined at an ambient temperature of 25 ± 5 °C.

Item		PG-100B
General specifications	Pressure reference	Gauge
	Model number(mmHg display : compound)	102R-H
	Rated pressure range kPa (mmHg)	- 100 ~ 100 (- 750 ~ 750)
	Maximum pressure kPa (mmHg)	200 (1500)
	Break-down pressure kPa (mmHg)	300 (2250)
	Operating temp. range °C	0 ~ 50
	Compensated temp. range °C	0 ~ 50
	Operating humidity % RH	35 ~ 85 (No condensation)
	Storage temp. °C	- 20 ~ 70 (Atmospheric pressure, humidity 65 %RH maximum)
	Pressure medium	Gases/liquids compatible with SUS316L
	Pressure port	M5 female
	Net weight g	Approx. 100
	Power	AAA dry battery DC 1.5 V × 2 Battery life 1000 h minimum
Display	No. of digits	3 1/2
	Display element	LCD
	Rated display range(mmHg display)	- 750 ~ 750
	Display cycle	Approx. 4 times/s
	Integrated accuracy	± 0.5 %F.S. ± 2 digits (at 25 °C ± 5 °C)
		± 1.0 %F.S. ± 2 digits (at 25 °C ± 25 °C)
	Resolution	1 digit
Analog output	Power supply (External supply)	5 ± 0.5 V DC 5 mA maximum
	Output voltage	$0 \sim \pm 1.000$ V ※ Proportionate to display value
	Output accuracy / Resolution	± 10 mV / 1 mV
	Output resistance	Approx. 10 kΩ
	Response	Approx. 10 ms
	Additional function	Auto power off , Display hold, Battery replacement display(LOBAT), Zero point adjustment
	Accessories	Fitting (half union for 6mm OD tube), 2 AAA batteries, strap, protective cover
	Option (Sold seperately)	PG-100B soft carrying case

PG-100B


HANDHELD DIGITAL MANOMETER

ENVIRONMENTAL CHARACTERISTICS

Test item	Test conditions (At 25 ± 5 °C)	Permissible change
Vibration	Amplitude 1.5 mm P-P, 10 ~ 55 Hz, 3 directions for 2 hours each (packed)	Indicating accuracy: ± 1 %F.S. maximum
Shock	98.1 m/s ² , 3 directions for 3 times each (packed)	
Pressure cycling	0 ~ Rated pressure, 10 ⁶ cycles	
Moisture resistance	40 °C, 90 ~ 95 %RH, 240 hrs.	

OUTLINE DIMENSIONS

Unless otherwise specified, tolerance : ± 0.5 (Unit: mm)

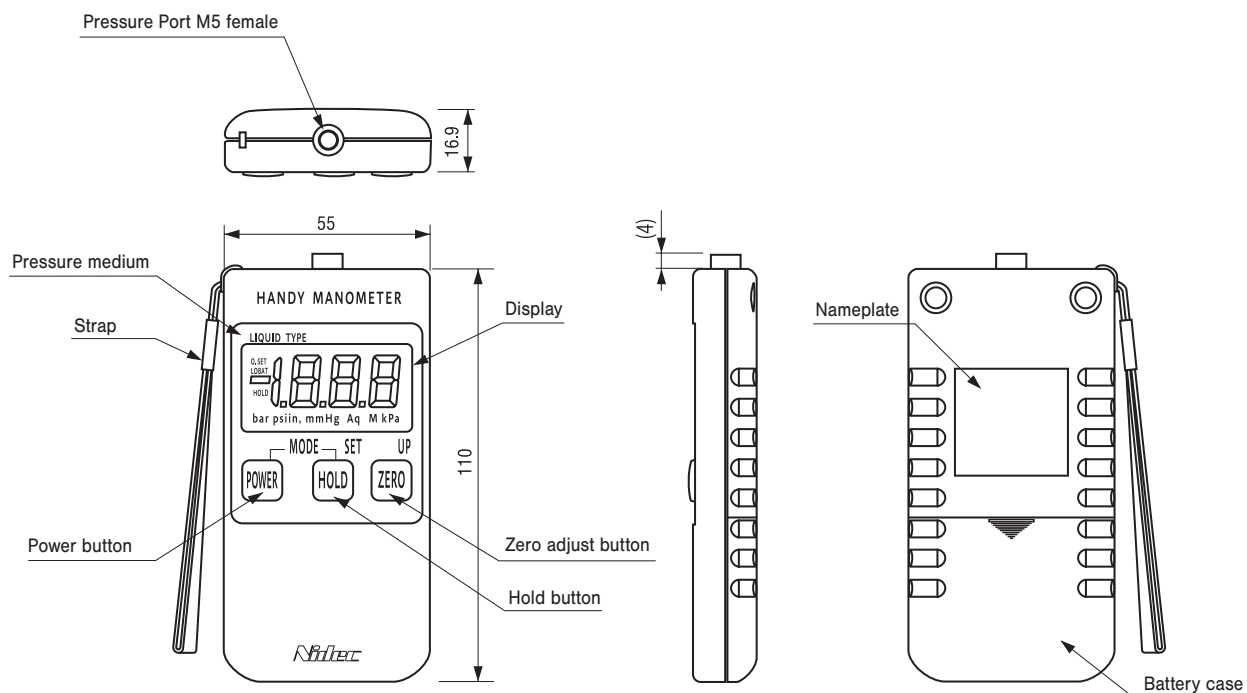

OPTION

The soft carrying case for PG-100B– Order item: PG-100 soft carrying case (Useful for when carrying out and keeping.)



Mouser Electronics

Authorized Distributor

Click to View Pricing, Inventory, Delivery & Lifecycle Information:

[Nidec:](#)

[PG-100B-102A](#) [PG-100B-102A-W](#) [PG-100B-102R](#) [PG-100B-102R-H](#) [PG-100B-102R-W](#) [PG-100B-103R](#) [PG-100B-103R-M](#) [PG-100B-103R-W](#)