

Intel® Modular Server

Spares/Parts List and Configuration Guide

A reference guide to assist customers in ordering the necessary components to configure the Intel Modular Server



Revision 2.0

December, 2009

Enterprise Platforms and Services Marketing

1. Table of Contents

1.	TABLE OF CONTENTS	2
2.	REVISION HISTORY	3
3.	INTEL MODULAR SERVER CONFIGURATION CHART	4
4.	PRODUCTION ORDER CODES	5
5.	MFS5000SI – BOXED PROCESSOR ORDER CODES	7
6.	MFS5000SI – TRAY PROCESSOR ORDER CODES	8
7.	MFS5520VI – BOXED PROCESSOR ORDER CODES	9
8.	MFS5520VI – TRAY PROCESSOR ORDER CODES	9

Revision History

May '06	Rev 0.9	Alpha, Beta, Silver Release
Dec '07	Rev 1.0	Production Release
Jan '08	Rev 1.1	Added note of dual SCM support
Feb '08	Rev 1.2	Corrected processor listing from E5420 to E5430
Mar '08	Rev 1.3	Added North American power supply cord
Mar '08	Rev 1.4	Added LV processors supported
Sep '08	Rev 1.5	Added MFSYS35, MFHDDBAY35, FXX10DVCARBLK, Notes of MFSYS25 conversion to MFSYS35, Notes of Dual-SCM support, Updated processor listing
Jan '09	Rev 1.6	Added MFSLUNKEY, MFS5520VIBSPP, MFS5520VISPP & other minor edits
Mar '09	Rev 1.7	Added product names to Order Code description, added MFS5520VI & MFS5520VIB, added new boxed and tray processors, removed MFBEZEL, removed MFS5520VIBSPP & MFS5520VISPP
Apr '09	Rev 1.8	Updated all processor offerings
Sep '09	Rev 1.9	Updated MFSYS25 & AXXPUSU. Added AXXTM3SATA and MFSLUNCOPY products
Dec '09	Rev 2.0	Updated MFSYS35, MFS5000SI and MFS5000SIB MM#'s

INFORMATION IN THIS DOCUMENT IS PROVIDED IN CONNECTION WITH INTEL® PRODUCTS. NO LICENSE, EXPRESS OR IMPLIED, BY ESTOPPEL OR OTHERWISE, TO ANY INTELLECTUAL PROPERTY RIGHTS IS GRANTED BY THIS DOCUMENT. EXCEPT AS PROVIDED IN INTEL'S TERMS AND CONDITIONS OF SALE FOR SUCH PRODUCTS, INTEL ASSUMES NO LIABILITY WHATSOEVER, AND INTEL DISCLAIMS ANY EXPRESS OR IMPLIED WARRANTY, RELATING TO SALE AND/OR USE OF INTEL PRODUCTS INCLUDING LIABILITY OR WARRANTIES RELATING TO FITNESS FOR A PARTICULAR PURPOSE, MERCHANTABILITY, OR INFRINGEMENT OF ANY PATENT, COPYRIGHT OR OTHER INTELLECTUAL PROPERTY RIGHT.

Intel products are not intended for use in medical, life saving, life sustaining applications. Intel may make changes to specifications and product descriptions at any time, without notice.


Intel server boards, server chassis, and processors may contain design defects or errors known as errata, which may cause the product to deviate from published specifications. Current characterized errata are available on request.

Intel, Intel Xeon, Pentium, and the Intel logo are trademarks or registered trademarks of Intel Corporation or its subsidiaries in the United States and other countries.

*Other names and brands may be claimed as the property of others.

Copyright © 2009, Intel Corporation

The Intel® Modular Server Configuration Chart

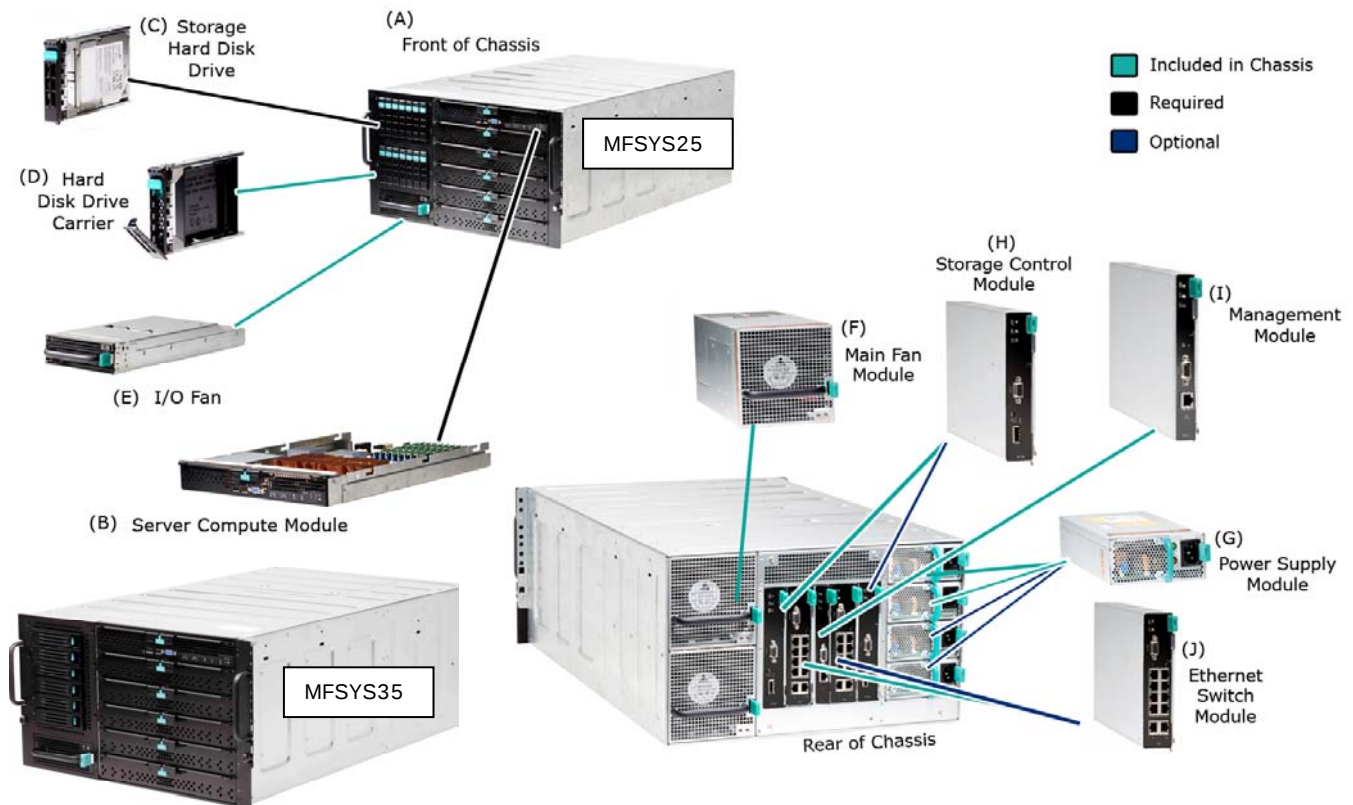

- | | |
|--|--|
| <p>A) Chassis</p> <ul style="list-style-type: none"> – Up to 6 Server Compute Modules <p>B) Server Compute Module: Required</p> <ul style="list-style-type: none"> – Model MFS5000SI or MFS5520VI – Supports multi-core Intel® Xeon® Processors – Up to 8 FB-DIMMs or 12 DDR3 DIMMs – Supports Optional Dual Gigabit Mezzanine expansion card <p>C) Storage Hard Disk Drive: Required</p> <ul style="list-style-type: none"> – Up to fourteen 2.5" SAS drives on MFSYS25 – Up to six 3.5" SAS or SATA drives on MFSYS35 <p>D) Hard Disk Drive Carrier:</p> <ul style="list-style-type: none"> – 14 are included in MFSYS25 – 6 are included in MFSYS35 <p>E) Hot Swappable I/O Fan Module: Included</p> <ul style="list-style-type: none"> – New I/O Fan (MM# 899168) required if MFSYS25 is converted to MFSYS35 using MFHddbAY35 | <p>F) Hot Swappable Main Fan Module: Included</p> <p>G) Power Supply Module: 2 Included, 2 Optional</p> <ul style="list-style-type: none"> – N + 1 Redundancy <p>H) Storage Control Module: 1 Included, 1 Optional</p> <ul style="list-style-type: none"> – Up to 2 Storage Control Modules for redundancy – Dual SCM support for MFSYS35 available <p>I) Management Module: Included</p> <p>J) Ethernet Switch Module: 1 Included, 1 Optional</p> <ul style="list-style-type: none"> – Up to 2 Ethernet Switch Modules – Each module features 10/100/1000GbE Full Duplex Ports |
|--|--|

** Power Supply Notes

- A minimum of one 1000-Watt power supply is required to turn on a compute module
- One power supply will support 1 compute module plus all other modules in the system
- Two power supplies will support up to 3 compute modules (in any slot) plus all other modules in the system
- Three power supplies will support up to 6 compute modules (in any slot) plus all other modules in the system
- Any additional power supplies above minimum required (based on configuration) provides redundancy

Production Product Order Codes

System and Servers

Product Code	MM	Description
MFSYS25	902318*	Intel® Modular Server System MFSYS25 , chassis with integrated 2.5" shared HDD bay. Contains 5 server blanks, 14 2.5" HDD carriers, main and IO fans, 2 power supplies (2 PSU fans), 1 GbE switch (and 1 blank), 1 storage module with battery backup (and 1 blank), and 1 management module. It will not include any hard drives, compute modules or power cords. *Contains new I/O fan and power supplies. Please see Product Change Notification #108518 & 109329
MFSYS35	902319*	Intel® Modular Server System MFSYS35 , chassis with integrated 3.5" shared HDD bay. Contains 5 server blanks, 6 3.5" HDD carriers, main and IO fans, 2 power supplies (2 PSU fans), 1 GbE switch (and 1 blank), 1 storage module with battery backup (and 1 blank), and 1 management module. It will not include any hard drives, compute modules or power cords. *Contains new power supplies
MFS5000SIB	900410	Intel® Compute Module MFS5000SI (bulk pack) , server board in a diskless compute module enclosure. It will not include CPU, heat sinks or memory. <i>**Bulk packs are still ordered as individual units and therefore qty's of 3 must be ordered.</i>
MFS5000SI	900409	Intel® Compute Module MFS5000SI , server board in a diskless compute module enclosure. It will not include CPU, heat sinks or memory.
MFS5520VIB	901699	Intel® Compute Module MFS5520VI (bulk pack) , server board in a diskless compute module enclosure. It will include two passive heatsinks but not include CPUs or memory. <i>**Bulk packs are still ordered as individual units and therefore qty's of 3 must be ordered.</i>
MFS5520VI	901369	Intel® Compute Module MFS5520VI , server board in a diskless compute module enclosure. It will include two passive heatsinks but not include CPUs or memory.

Optional Accessories

Product Code	MM	Description
AXXSCM3S	891831	Intel® Storage Controller , SAS storage module (including battery backup) * Dual-SCM support for MFSYS35 available with FW release 2.7.
AXXSW1GB	891842	Intel® Gigabit Ethernet Switch , GB ethernet switch module
AXXPSU	902463	1000Watt Power Supply Module
AXXGBIOMEZ	891844	(Bulk pack) Dual Gigabit Ethernet I/O Expansion Mezzanine Card for MFS5000SI <i>**Bulk packs are still ordered as individual units and therefore qty's of 3 must be ordered.</i>
AXXGBIOMEZV	901362	(Bulk pack) Dual Gigabit Ethernet I/O Expansion Mezzanine Card for MFS5520VI <i>**Bulk packs are still ordered as individual units and therefore qty's of 3 must be ordered.</i>
AXXMFRAIL	893313	Tool-less Rail kit
AXXTM3SATA	903639	(Bulk pack) 2.5" SATA to SAS Converter Board <i>**Bulk packs are still ordered as individual units and therefore qty's of 5 must be ordered.</i>
MFSLUNKEY	901238	Shared LUN Paper Pack ID Key
MFSLUNCOPY	903085	LUN Copier Paper Pack ID Key

Optional Spares

Product Code	MM	Description
MFSCMBBU	892207	Storage Battery back-up spare
MFHddbAY25	892137	2.5" HDD Bay Module. Kit includes interposer & storage backplane, bezel with 8 screws. No HDD carriers
MFHddbAY35	892139	3.5" HDD Bay Module. Kit includes interposer & storage backplane, bezel with 8 screws. No HDD carriers. To use MFHddbAY35 in MFSYS25, new MFIOFAN is required if not using MFSYS25 TA# D91400-008 or greater.
MFPSUFAN	892195	Blank Power Supply Fan module
MFMAINFAN	892170	Main Fan module
MFIOFAN	899168	IO Fan module. When using MFHddbAY35 in MFSYS25, MM# 899168 is required if not using MFSYS25 with TA# D91400-006 or greater.
MFmidPLANE	899916	Midplane for MFSYS25 / MFSYS35 chassis which includes SD Flash
MFCMM	891834	Intel® Management Module MFCMM , management module for MFSYS25 / MFSYS35
FXX25HDDCAR	881681	2.5" hard drive carrier blank – spare. As used on other EPSD systems. MOQ: 10
FPWRCABLENA	879287	Power Cord – North American
FXX10DVCARBLK	880265	3.5" hard drive carrier blank – spare. As used on other EPSD systems. MOQ: 10

Supported Boxed Processors for MFS5000SI

The Intel Modular Server System uses standard 1U heatsinks found in the active boxed processors

Product Code	MM	SL	Description
BX805565110A	892147	SLAGE	1.60GHz 1066MHz 4MB Dual-Core Intel® Xeon® Processor 5110
BX805565120A	892150	SLAGD	1.86GHz 1066MHz 4MB Dual-Core Intel® Xeon® Processor 5120
BX805565130A	892166	SLAGC	2.00GHz 1333MHz 4MB Dual-Core Intel® Xeon® Processor 5130
BX805565140A	892167	SLAGB	2.33GHz 1333MHz 4MB Dual-Core Intel® Xeon® Processor 5140
BX805565150A	892171	SLAGA	2.66GHz 1333MHz 4MB Dual-Core Intel® Xeon® Processor 5150
BX805565160A	892194	SLAG9	3.00GHz 1333MHz 4MB Dual-Core Intel® Xeon® Processor 5160
BX80563E5310A	892333	SLAEM	1.60GHz 1066MHz 8MB Quad-Core Intel® Xeon® Processor E5310
BX80563E5320A	892331	SLAEL	1.86GHz 1066MHz 8MB Quad-Core Intel® Xeon® Processor E5320
BX80563E5335A	892329	SLAEK	2.00GHz 1333MHz 8MB Quad-Core Intel® Xeon® Processor E5335
BX80563E5345A	892328	SLAEJ	2.33GHz 1333MHz 8MB Quad-Core Intel® Xeon® Processor E5345
BX80574E5405A	894832	SLAP2	2.00GHz 1333MHz 12MB Quad-Core Intel® Xeon® Processor E5405
BX80574E5410A	894829	SLANW	2.33GHz 1333MHz 12MB Quad-Core Intel® Xeon® Processor E5410
BX80574E5420A	894828	SLANV	2.50GHz 1333MHz 12MB Quad-Core Intel® Xeon® Processor E5420
BX80574E5430A	894825	SLANU	2.66GHz 1333MHz 12MB Quad-Core Intel® Xeon® Processor E5430
BX80574E5440A	894823	SLANS	2.83GHz 1333MHz 12MB Quad-Core Intel® Xeon® Processor E5440
BX80574E5450A	894821	SLANQ	3.00GHz 1333MHz 12MB Quad-Core Intel® Xeon® Processor E5450
BX80574L5410A	894836	SLAP4	2.33GHz LV 1333MHz 12MB Quad-Core Intel® Xeon® Processor L5410
BX80574L5420A	894833	SLARP	2.5GHz LV 1333MHz 12MB Quad-Core Intel® Xeon® Processor L5420

Supported Tray Processors for MFS5000SI

Product Code	MM	SL	Description
HH80556KH0254M	891733	SLAGE	1.60GHz 1066MHz 4MB Dual-Core Intel® Xeon® Processor 5110
HH80556KH0364M	891732	SLAGD	1.86GHz 1066MHz 4MB Dual-Core Intel® Xeon® Processor 5120
HH80556KJ0414M	891731	SLAGC	2.00GHz 1333MHz 4MB Dual-Core Intel® Xeon® Processor 5130
HH80556KJ0534M	891730	SLAGB	2.33GHz 1333MHz 4MB Dual-Core Intel® Xeon® Processor 5140
HH80556KJ0674M	891708	SLAGA	2.66GHz 1333MHz 4MB Dual-Core Intel® Xeon® Processor 5150
HH80556KJ0804M	891706	SLAG9	3.00GHz 1333MHz 4MB Dual-Core Intel® Xeon® Processor 5160
AT80573KJ0936M	898612	SLBAS	3.33GHz 1333MHz 6MB Dual-Core Intel® Xeon® Processor X5260
HH80563QH0258M	891121	SLAEM	1.60GHz 1066MHz 8MB Quad-Core Intel® Xeon® Processor E5310
HH80563QH0368M	891118	SLAEL	1.86GHz 1066MHz 8MB Quad-Core Intel® Xeon® Processor E5320
HH80563QJ0538M	891115	SLAEJ	2.33GHz 1333MHz 8MB Quad-Core Intel® Xeon® Processor E5345
AT80574KJ041N	898600	SLBBP	2.00GHz 1333MHz 12MB Quad-Core Intel® Xeon® Processor E5405
AT80574KJ053N	898580	SLBBC	2.33GHz 1333MHz 12MB Quad-Core Intel® Xeon® Processor E5410
AT80574KJ060N	898596	SLBBL	2.50GHz 1333MHz 12MB Quad-Core Intel® Xeon® Processor E5420
AT80574KJ067N	898594	SLBBK	2.66GHz 1333MHz 12MB Quad-Core Intel® Xeon® Processor E5430
AT80574KJ073N	898592	SLBBJ	2.83GHz 1333MHz 12MB Quad-Core Intel® Xeon® Processor E5440
AT80574KJ080N	898599	SLBBM	3.00GHz 1333MHz 12MB Quad-Core Intel® Xeon® Processor E5450
HH80563JH0258M	891119	SLAEQ	1.60GHz LV 1066MHz 8MB Quad-Core Intel® Xeon® Processor L5310
HH80563JH0368M	891120	SLAEP	1.86GHz LV 1066MHz 8MB Quad-Core Intel® Xeon® Processor L5320
AT80574JJ053N	898603	SLBBS	2.33GHz LV 1333MHz 12MB Quad-Core Intel® Xeon® Processor L5410
AT80574JJ060N	898602	SLBBR	2.5GHz LV 1333MHz 12MB Quad-Core Intel® Xeon® Processor L5420
AT80574JJ067N	898601	SLBBQ	2.66GHz LV 1333MHz 12MB Quad-Core Intel® Xeon® Processor L5430

Supported Boxed Processors for MFS5520VI

Product Code	MM	SL	Description
BX80602X5570	901025	SLBF3	2.93GHz 1333MHz 8MB Quad-Core Intel® Xeon® Processor X5570
BX80602X5560	901026	SLBF4	2.8GHz 1333MHz 8MB Quad-Core Intel® Xeon® Processor X5560
BX80602X5550	901027	SLBF5	2.66GHz 1333MHz 8MB Quad-Core Intel® Xeon® Processor X5550
BX80602E5540	901028	SLBF6	2.53GHz 1066MHz 8MB Quad-Core Intel® Xeon® Processor E5540
BX80602E5530	901029	SLBF7	2.4GHz 1066MHz 8MB Quad-Core Intel® Xeon® Processor E5530
BX80602E5520	901030	SLBFD	2.26GHz 1066MHz 8MB Quad-Core Intel® Xeon® Processor E5520
BX80602E5506	901031	SLBF8	2.13GHz 800MHz 4MB Quad-Core Intel® Xeon® Processor E5506
BX80602E5504	901032	SLBF9	2GHz 800MHz 4MB Quad-Core Intel® Xeon® Processor E5504
BX80602E5502	901022	SLBEZ	1.86GHz 800MHz 4MB Dual-Core Intel® Xeon® Processor E5502

Supported Tray Processors for MFS5520VI

Product Code	MM	SL	Description
AT80602000765AA	900835	SLBF3	2.93GHz 1333MHz 8MB Quad-Core Intel® Xeon® Processor X5570
AT80602000768AA	900836	SLBF4	2.8GHz 1333MHz 8MB Quad-Core Intel® Xeon® Processor X5560
AT80602000771AA	900837	SLBF5	2.66GHz 1333MHz 8MB Quad-Core Intel® Xeon® Processor X5550
AT80602000789AA	900838	SLBF6	2.53GHz 1066MHz 8MB Quad-Core Intel® Xeon® Processor E5540
AT80602000792AA	900839	SLBF7	2.4GHz 1066MHz 8MB Quad-Core Intel® Xeon® Processor E5530
AT80602002091AA	900840	SLBFD	2.26GHz 1066MHz 8MB Quad-Core Intel® Xeon® Processor E5520
AT80602000798AA	900841	SLBF8	2.13GHz 800MHz 4MB Quad-Core Intel® Xeon® Processor E5506
AT80602000801AA	900842	SLBF9	2GHz 800MHz 4MB Quad-Core Intel® Xeon® Processor E5504
AT80602000804AA	900400	SLBEZ	1.86GHz 800MHz 4MB Dual-Core Intel® Xeon® Processor E5502
AT80602000810AA	900843	SLBFA	2.26GHz 1066MHz 8MB Quad-Core Intel® Xeon® Processor L5520
AT80602002712AA	900833	SLBFH	2.13GHz 800MHz 4MB Quad-Core Intel® Xeon® Processor L5506