



Date Issued :	April 05, 2023	PCN Number :	513032
Reason for Change :	Change to Product		
Description of Change :	The change is at the customer request due to a problem that coupling nut is falling out from the shell. - Spring ring 1203180090 dimension change to 0.9x0.9 - shell 1203180450 added dimension 45 for edge - nut 1203180089 changed tolerance for dim 1 to -0.2		
Reason for Short Notice :	Corrective Actions		
Assessment of Change :	First Article Inspection		
Planned Implementation Date :	August 25, 2023		
Sample Availability Date:	July 19, 2023		
Internal Molex Qualification Date :	July 19, 2023		
Last date to request Samples by Customer :	July 24, 2023		
Traceability Code Markings / Date :	No special marking on the product or packaging		

Before Picture

Changing dimensions of spring ring

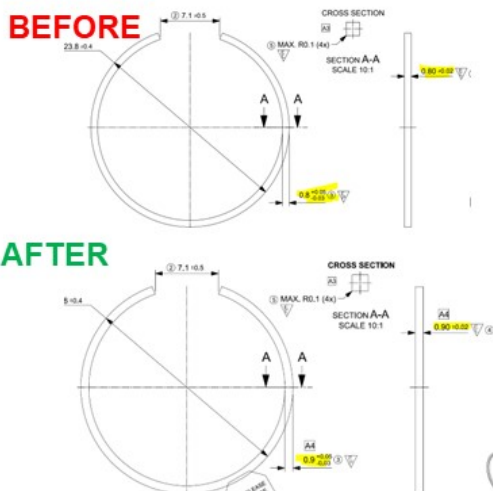


Adding dimension for edge

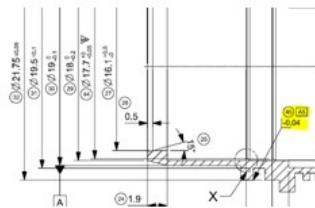


Changing tolerance

BEFORE

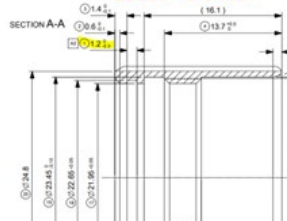

AFTER

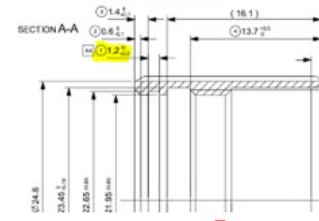**molex**

1

Molex Confidential Information
 © 2016 Molex – All Rights Reserved. Unauthorized Reproduction/Distribution is Prohibited.

Overview

- The change is at the customer request due to a problem that coupling nut is falling out from the shell.
 - Spring ring 1203180090, dimension change to 0.9x0.9
 - shell 1203180450, added dimension 45 for edge
 - nut 1203180089, changed tolerance for dim 1 to -0.2
- Product Impact
 - Increasing the strength of the product.
- Part Number Impact
 - 1203180090
 - 1203180089
 - 1203180450

RELEASED

You may address inquiries regarding this PCN by clicking on the below link
mailto:pcn_coordinator@molex.com?subject=PCN_Notification:513032
or contact your Local Sales Engineer.

Note: While responding, please retain " PCN Notification : **PCN Notification: 513032** " in the e-mail Subject line for faster response.

Molex, LLC
2222 Wellington Court
Lisle, IL 60532
TEL (800) 786-6539
www.molex.com