## 3RA2125-4AA26-0AP6

**Data sheet** 



FUSELESS MOTOR STARTER DIRECT START 600V AC SZ S0 11-16A 220/240V AC 50/60HZ SCREW CONNECTION FOR SCREW MOUNTING OR 35 MM RAIL-MOUNTING TYPE OF COORDINATION 2 IQ = 150 KA ALSO FULFILLS TYPE OF COORDINATION 1 1NO+1NC (MSP) 1NO+1NC (CONTACTOR)

product brand name	SIRIUS
product designation	non-fused motor starter 3RA2
design of the product	direct starter
manufacturer's article number	direction
of the supplied contactor	3RT2026-1AP60
of the supplied circuit-breakers	3RV2021-4AA15
of the supplied link module	3RA2921-1AA00
General technical data	<u>5.0 <b>4.5</b> 1.0 1.0 1</u>
size of the circuit-breaker	S0
size of load feeder	S0
product extension auxiliary switch	Yes
insulation voltage with degree of pollution 3 at AC rated value	690 V
degree of pollution	3
surge voltage resistance rated value	6 kV
shock resistance according to IEC 60068-2-27	6g / 11 ms
mechanical service life (operating cycles) of contactor typical	10 000 000
type of assignment	2
Weight	0.76 kg
Ambient conditions	
ambient temperature	
during operation	-20 +60 °C
during storage	-50 +80 °C
during transport	-55 +80 °C
Main circuit	
number of poles for main current circuit	3
design of the switching contact	electromechanical
adjustable current response value current of the current- dependent overload release	11 16 A
operating voltage	
rated value	690 V
<ul> <li>at AC-3 rated value maximum</li> </ul>	690 V
operating frequency rated value	50 60 Hz
operational current at AC-3 at 400 V rated value	15.5 A
operating power at AC-3	
• at 400 V rated value	7 500 W
• at 500 V rated value	7 500 W
Control circuit/ Control	
control supply voltage at AC	
at 50 Hz rated value	220 V
at 50 Hz rated value	176 242 V

a at 60 Hz rated value	240 V
at 60 Hz rated value	
• at 60 Hz rated value	192 264 V
apparent holding power of magnet coil at AC	9.4 VA
inductive power factor with the holding power of the coil	0.28
Auxiliary circuit	
number of NC contacts for auxiliary contacts	2
number of NO contacts for auxiliary contacts	2
Protective and monitoring functions	01.400.40
trip class	CLASS 10
design of the overload release	thermal (bimetallic)
response value current of instantaneous short-circuit trip unit	208 A
UL/CSA ratings	
full-load current (FLA) for 3-phase AC motor	
• at 480 V rated value	15.2 A
at 600 V rated value	12.2 A
yielded mechanical performance [hp]	
for single-phase AC motor	
— at 110/120 V rated value	1 hp
— at 230 V rated value	2 hp
• for 3-phase AC motor	
— at 200/208 V rated value	3 hp
— at 220/230 V rated value	5 hp
— at 460/480 V rated value	10 hp
— at 575/600 V rated value	10 hp
Short-circuit protection	
product function short circuit protection	Yes
design of the short-circuit trip	magnetic
conditional short-circuit current (Iq)	
<ul> <li>at 400 V according to IEC 60947-4-1 rated value</li> </ul>	153 000 A
at 500 V according to IEC 60947-4-1 rated value	100 000 A
Installation/ mounting/ dimensions	
mounting position	vertical
	Snap-mounted to DIN rail or screw-mounted with additional push-in lug
mounting position fastening method height	Snap-mounted to DIN rail or screw-mounted with additional push-in lug 193.1 mm
mounting position fastening method	Snap-mounted to DIN rail or screw-mounted with additional push-in lug 193.1 mm 45 mm
mounting position fastening method height width depth	Snap-mounted to DIN rail or screw-mounted with additional push-in lug 193.1 mm
mounting position fastening method height width depth required spacing	Snap-mounted to DIN rail or screw-mounted with additional push-in lug 193.1 mm 45 mm
mounting position fastening method height width depth required spacing • for grounded parts	Snap-mounted to DIN rail or screw-mounted with additional push-in lug 193.1 mm 45 mm 97.1 mm
mounting position fastening method height width depth required spacing • for grounded parts — forwards	Snap-mounted to DIN rail or screw-mounted with additional push-in lug 193.1 mm 45 mm 97.1 mm
mounting position fastening method height width depth required spacing  • for grounded parts — forwards — backwards	Snap-mounted to DIN rail or screw-mounted with additional push-in lug 193.1 mm 45 mm 97.1 mm 10 mm 0 mm
mounting position fastening method height width depth required spacing • for grounded parts — forwards — backwards — upwards	Snap-mounted to DIN rail or screw-mounted with additional push-in lug 193.1 mm 45 mm 97.1 mm  10 mm 0 mm 30 mm
mounting position fastening method height width depth required spacing • for grounded parts — forwards — backwards — upwards — at the side	Snap-mounted to DIN rail or screw-mounted with additional push-in lug 193.1 mm 45 mm 97.1 mm  10 mm 0 mm 30 mm 9 mm
mounting position fastening method height width depth required spacing • for grounded parts — forwards — backwards — upwards — at the side — downwards	Snap-mounted to DIN rail or screw-mounted with additional push-in lug 193.1 mm 45 mm 97.1 mm  10 mm 0 mm 30 mm
mounting position fastening method height width depth required spacing • for grounded parts — forwards — backwards — upwards — at the side — downwards • for live parts	Snap-mounted to DIN rail or screw-mounted with additional push-in lug 193.1 mm 45 mm 97.1 mm  10 mm 0 mm 30 mm 9 mm 10 mm
mounting position fastening method height width depth required spacing • for grounded parts — forwards — backwards — upwards — at the side — downwards • for live parts — forwards	Snap-mounted to DIN rail or screw-mounted with additional push-in lug 193.1 mm 45 mm 97.1 mm  10 mm 0 mm 30 mm 9 mm 10 mm
mounting position fastening method height width depth required spacing • for grounded parts — forwards — backwards — upwards — at the side — downwards • for live parts — forwards — backwards — backwards	Snap-mounted to DIN rail or screw-mounted with additional push-in lug 193.1 mm 45 mm 97.1 mm  10 mm 0 mm 30 mm 9 mm 10 mm 10 mm
mounting position fastening method height width depth required spacing • for grounded parts — forwards — backwards — upwards — at the side — downwards • for live parts — forwards — backwards — upwards — upwards — upwards — upwards	Snap-mounted to DIN rail or screw-mounted with additional push-in lug 193.1 mm 45 mm 97.1 mm  10 mm 0 mm 30 mm 10 mm 10 mm 10 mm
mounting position fastening method height width depth required spacing • for grounded parts — forwards — backwards — upwards — at the side — downwards • for live parts — forwards — backwards — upwards — downwards • for live parts — forwards — backwards — backwards — backwards — upwards — upwards — downwards	Snap-mounted to DIN rail or screw-mounted with additional push-in lug 193.1 mm 45 mm 97.1 mm  10 mm 0 mm 30 mm 9 mm 10 mm 10 mm
mounting position fastening method height width depth required spacing • for grounded parts — forwards — backwards — upwards — at the side — downwards • for live parts — backwards — backwards — upwards — at the side — downwards — forwards — backwards — backwards — backwards — upwards — downwards — at the side	Snap-mounted to DIN rail or screw-mounted with additional push-in lug 193.1 mm 45 mm 97.1 mm  10 mm 0 mm 30 mm 10 mm 10 mm 10 mm
mounting position fastening method height width depth required spacing • for grounded parts — forwards — backwards — upwards — at the side — downwards • for live parts — forwards — backwards — upwards — downwards • for live parts — forwards — backwards — backwards — backwards — upwards — upwards — downwards	Snap-mounted to DIN rail or screw-mounted with additional push-in lug 193.1 mm 45 mm 97.1 mm  10 mm 0 mm 30 mm 9 mm 10 mm 10 mm 0 mm 10 mm
mounting position fastening method height width depth required spacing • for grounded parts — forwards — backwards — upwards — at the side — downwards • for live parts — backwards — backwards — upwards — at the side — downwards — forwards — backwards — backwards — backwards — upwards — downwards — at the side	Snap-mounted to DIN rail or screw-mounted with additional push-in lug 193.1 mm 45 mm 97.1 mm  10 mm 0 mm 30 mm 9 mm 10 mm 10 mm 0 mm 10 mm
mounting position fastening method height width depth required spacing • for grounded parts — forwards — backwards — upwards — at the side — downwards • for live parts — forwards — backwards — at the side — downwards • for live parts — forwards — backwards — backwards — backwards — upwards — at the side  Connections/ Terminals	Snap-mounted to DIN rail or screw-mounted with additional push-in lug 193.1 mm 45 mm 97.1 mm  10 mm 0 mm 30 mm 9 mm 10 mm 10 mm 0 mm 9 mm 10 mm 9 mm 10 mm 9 mm
mounting position fastening method height width depth required spacing	Snap-mounted to DIN rail or screw-mounted with additional push-in lug 193.1 mm 45 mm 97.1 mm  10 mm 0 mm 30 mm 10 mm 10 mm 10 mm 0 mm 30 mm 9 mm 10 mm 30 mm 9 mm
mounting position fastening method height width depth required spacing • for grounded parts — forwards — backwards — upwards — at the side — downwards • for live parts — forwards — backwards — upwards — at the side — downwards — to parts — forwards — backwards — upwards — at the side  Connections/ Terminals  type of electrical connection for main current circuit type of connectable conductor cross-sections for main contacts stranded connectable conductor cross-section for main contacts finely	Snap-mounted to DIN rail or screw-mounted with additional push-in lug 193.1 mm 45 mm 97.1 mm  10 mm 0 mm 30 mm 9 mm 10 mm 0 mm 30 mm 9 mm 10 mm screw-type terminals 1 10 mm², 2x (2.5 6 mm²)
mounting position fastening method height width depth required spacing	Snap-mounted to DIN rail or screw-mounted with additional push-in lug 193.1 mm 45 mm 97.1 mm  10 mm 0 mm 30 mm 9 mm 10 mm 0 mm 30 mm 9 mm 10 mm screw-type terminals 1 10 mm², 2x (2.5 6 mm²)
mounting position fastening method height width depth required spacing • for grounded parts — forwards — backwards — upwards — at the side — downwards • for live parts — forwards — backwards — upwards — at the side Connections/ Terminals  type of electrical connection for main current circuit type of connectable conductor cross-sections for main contacts stranded connectable conductor cross-section for main contacts finely stranded with core end processing  Safety related data proportion of dangerous failures with high demand rate according to SN 31920  B10 value with high demand rate according to SN 31920	Snap-mounted to DIN rail or screw-mounted with additional push-in lug 193.1 mm 45 mm 97.1 mm  10 mm 0 mm 30 mm 9 mm 10 mm 10 mm 0 mm 30 mm 10 mm screw-type terminals 1 10 mm², 2x (2.5 6 mm²) 1 6 mm²
mounting position fastening method height width depth required spacing  • for grounded parts — forwards — backwards — upwards — at the side — downwards  • for live parts — forwards — backwards — upwards — a the side — downwards — to parts — forwards — backwards — upwards — at the side  Connections/ Terminals  type of electrical connection for main current circuit type of connectable conductor cross-sections for main contacts stranded connectable conductor cross-section for main contacts finely stranded with core end processing  Safety related data proportion of dangerous failures with high demand rate according to SN 31920	Snap-mounted to DIN rail or screw-mounted with additional push-in lug 193.1 mm 45 mm 97.1 mm  10 mm 0 mm 30 mm 9 mm 10 mm 10 mm 0 mm 30 mm 10 mm 10 mm 10 mm 10 mm 10 mm 10 mm

### Approvals Certificates

### **General Product Approval**

For use in hazardous locations

**Test Certificates** 











Type Test Certificates/Test Report

**Test Certificates** 

Marine / Shipping

Special Test Certificate











Marine / Shipping

other

Railway

**Environment** 





Confirmation

Special Test Certificate

Environmental Confirmations

#### **Further information**

Information on the packaging

https://support.industry.siemens.com/cs/ww/en/view/109813875

Information- and Downloadcenter (Catalogs, Brochures,...)

https://www.siemens.com/ic10

Industry Mall (Online ordering system)

 $\underline{https://mall.industry.siemens.com/mall/en/en/Catalog/product?mlfb=3RA2125-4AA26-0AP6}$ 

Cax online generator

http://support.automation.siemens.com/WW/CAXorder/default.aspx?lang=en&mlfb=3RA2125-4AA26-0AP6

Service&Support (Manuals, Certificates, Characteristics, FAQs,...)

https://support.industry.siemens.com/cs/ww/en/ps/3RA2125-4AA26-0AP6

Image database (product images, 2D dimension drawings, 3D models, device circuit diagrams, EPLAN macros, ...)


 $\underline{\text{http://www.automation.siemens.com/bilddb/cax\_de.aspx?mlfb=3RA2125-4AA26-0AP6\&lang=endown.siemens.com/bilddb/cax\_de.aspx?mlfb=3RA2125-4AA26-0AP6\&lang=endown.siemens.com/bilddb/cax\_de.aspx?mlfb=3RA2125-4AA26-0AP6\&lang=endown.siemens.com/bilddb/cax\_de.aspx?mlfb=3RA2125-4AA26-0AP6\&lang=endown.siemens.com/bilddb/cax\_de.aspx?mlfb=3RA2125-4AA26-0AP6\&lang=endown.siemens.com/bilddb/cax\_de.aspx?mlfb=3RA2125-4AA26-0AP6\&lang=endown.siemens.com/bilddb/cax\_de.aspx?mlfb=3RA2125-4AA26-0AP6\&lang=endown.siemens.com/bilddb/cax\_de.aspx?mlfb=3RA2125-4AA26-0AP6\&lang=endown.siemens.com/bilddb/cax\_de.aspx?mlfb=3RA2125-4AA26-0AP6\&lang=endown.siemens.com/bilddb/cax\_de.aspx?mlfb=3RA2125-4AA26-0AP6\&lang=endown.siemens.com/bilddb/cax\_de.aspx.siemens.com/bilddb/cax_de.aspx.siemens.com/bilddb/cax_de.aspx.siemens.com/bilddb/cax_de.aspx.siemens.com/bilddb/cax_de.aspx.siemens.com/bilddb/cax_de.aspx.siemens.com/bilddb/cax_de.aspx.siemens.com/bil$ 


Characteristic: Tripping characteristics,  $I^2t$ , Let-through current


https://support.industry.siemens.com/cs/ww/en/ps/3RA2125-4AA26-0AP6/char

Further characteristics (e.g. electrical endurance, switching frequency)


http://www.automation.siemens.com/bilddb/index.aspx?view=Search&mlfb=3RA2125-4AA26-0AP6&objecttype=14&gridview=view1

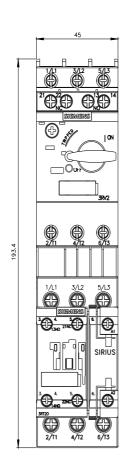

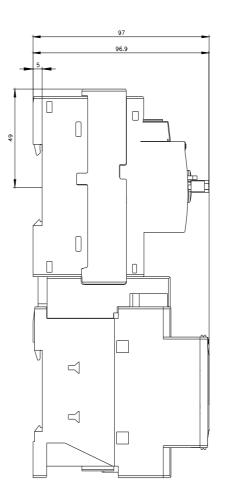

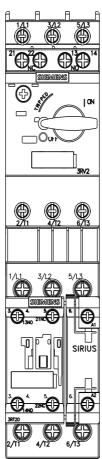

last modified: 12/15/2020 🖸

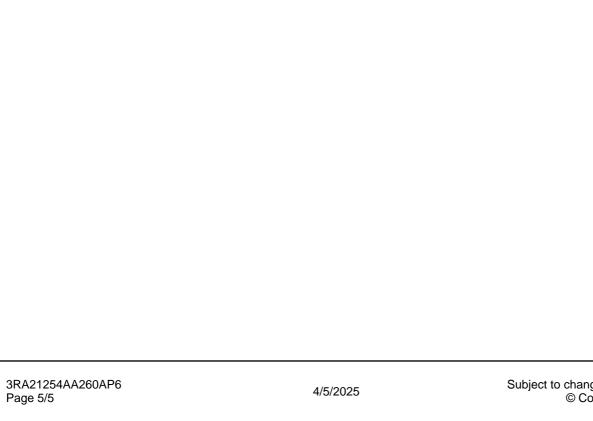

# **Mouser Electronics**

**Authorized Distributor** 

Click to View Pricing, Inventory, Delivery & Lifecycle Information:

Siemens:

3RA21254AA260AP6