

General Specifications

Motor Type: DC Brushless Motor

Motor Protection: Auto Restart/Polarity Protection

Motor withstands reverse connection for positive and negative leads.

Insulation Resistance:

10M Ω or over with a DC500V Megger

Dielectric Withstand Voltage:

AC 700V 1s or 500V 1min


Allowable Ambient Temperature Range:

-10°C ~ +70°C (Operating)

-40°C ~ +70°C (Storage)

(non-condensing environment)

Characteristics Curves

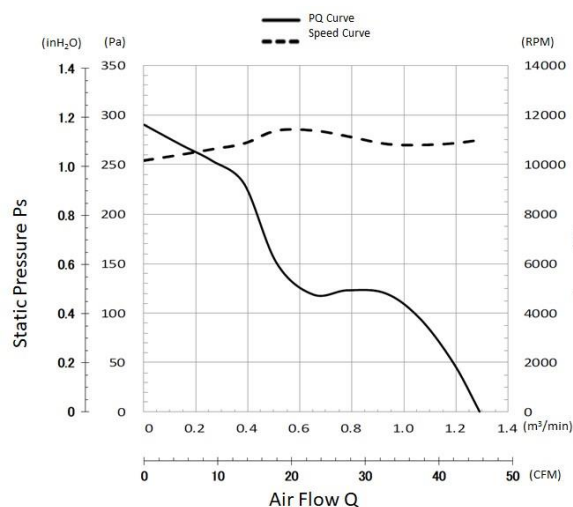

PWM Benefits & Applications

PWM Benefits

- Increased Life Expectancy
- Energy Saving
- Lower Vibration
- Lower Noise
- Current Spike Prevention

PWM Applications

- Routers
- Switches
- Storage
- Data Centers
- Optical Repeaters
- Broadcast Equipment
- Inverters
- UPS
- Battery Chargers
- Fuel Cells
- Industrial Power Supplies
- Welders
- Plasma Cutters
- Instrumentation
- Test Equipment
- Enclosures and more

- Customized fan performances at multiple operating points.
- Peak efficiency resulting in lower total ownership costs.
- Cost effective and better reliability.

Life Expectancy L10

60°C 40,000 Hours

Specifications


MODEL	Rated	Operating	Current		InputPower		Speed	Max.		Max. Static		Noise	Mass
	Voltage	Voltage	Avg	Max	Avg	Max		Air Flow		Pressure			
	(V)	(V)	(A) ^{*1}	(A) ^{*1}	(W) ^{*1}	(W) ^{*1}	(min ⁻¹) ^{*1}	(CFM) ^{*1}	(m³/min) ^{*1}	(inH ₂ O) ^{*1}	(Pa) ^{*1}	(dB) ^{*1}	(g)
	06025DA-12R-AU-02	12	7.0 ~ 13.2	0.67	0.87	8.04	10.44	11000	45.6	1.29	1.17	290	52.0

*1: Maximum Values in Free Air

PWM Specifications

PWM Control


● Connection

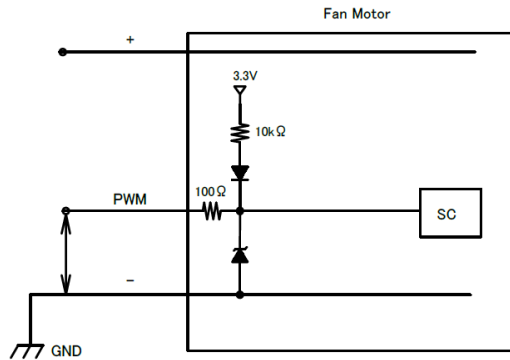

1. PWM Control

V_{st} = Low Level (0V~0.4V)	→ Stop (On Duty 0%)
V_{st} = High Level (4.5V~5.0V)	→ Full Speed (On Duty 100%)
V_{st} = Open	→ Full Speed


2. PWM Duty & PWM Input Pulse

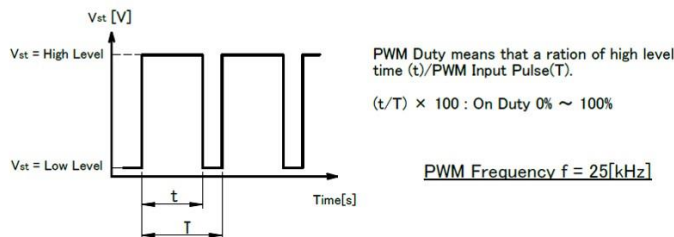


TACHO Specifications

TACHO SIGNAL

1. OUTPUT CIRCUIT : OPEN DRAIN
2. SPECIFICATION
 $T_a = 25^\circ\text{C}$
 Absolute Maximum Ratings at $T_a = 25^\circ\text{C}$
 $V_{DS} \text{ max} : +15\text{V}$
 $I_D \text{ max} : 5\text{mA}$ [$V_{DS}(\text{sat}) \text{ max} = 1.0\text{V}$]

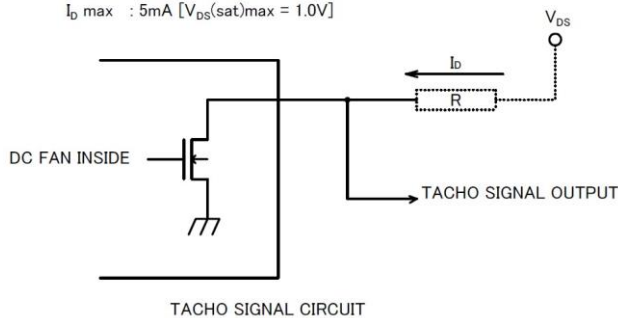

PWM Characteristics Curve

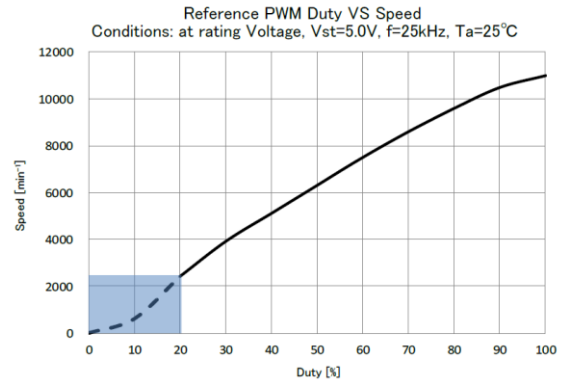


3. The condition for PWM control are as follows.


- When you use this under PWM control, always be sure the motor's operation under practical mounting state.
 Fan motor may not start up caused by PWM control at very low speed condition.
- To run at Rating Voltage.
- Please use the start with Duty 20% or more at 25kHz.
 [At rated voltage input, Ambient temperature 25°C]

3. OUTPUT WAVEFORM) : AT RATED VOLTAGE OUTPUT SIGNAL VOLTAGE

3-1 Case-1

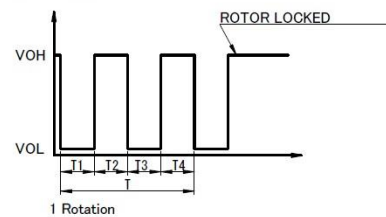

3-2 Case-2

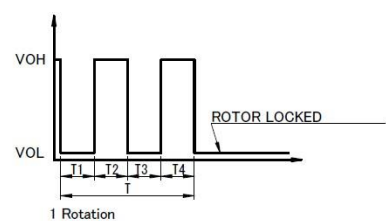


- 1) When the rotor is locked at VOH position of signal, signal keeps VOH position.
- 2) When the rotor is locked at VOL position of signal, signal keeps VOL position.
- 3) $T = T_1 + T_2 + T_3 + T_4 = 60^\circ / m = 1 \text{ rotation}$

$$m : \text{min}^{-1}$$

$$\text{Tach Duty Cycle} = 50\% \pm 10\%$$

Panel Cut-Outs

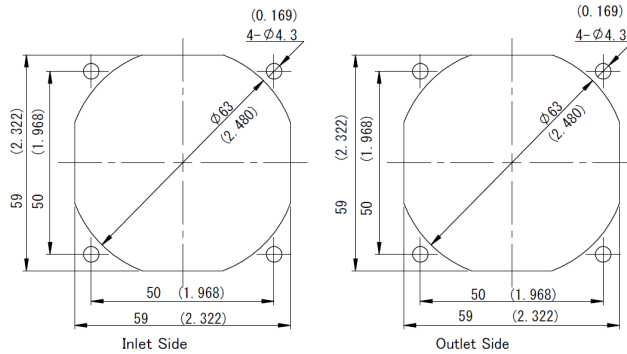

Unit: mm (inch)

Materials

Casing : Plastic (Black UL94V-0)

Impeller : Plastic (Black UL94V-0)


Bearing : Ball Bearing

Lead Wire : UL3443 AWG26

(+) : Red (-) : Black


PWM: Brown Tach: White

Outline

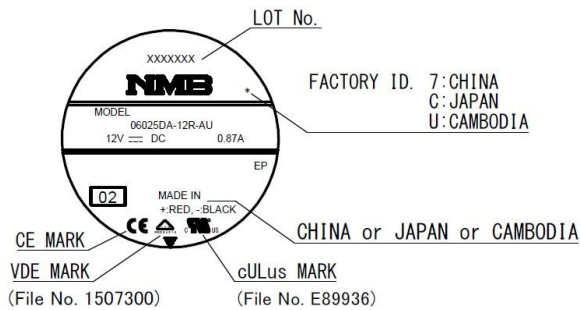


RIB TYPE

THROUGH HOLE

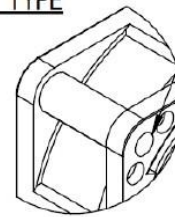

NO SOLDER

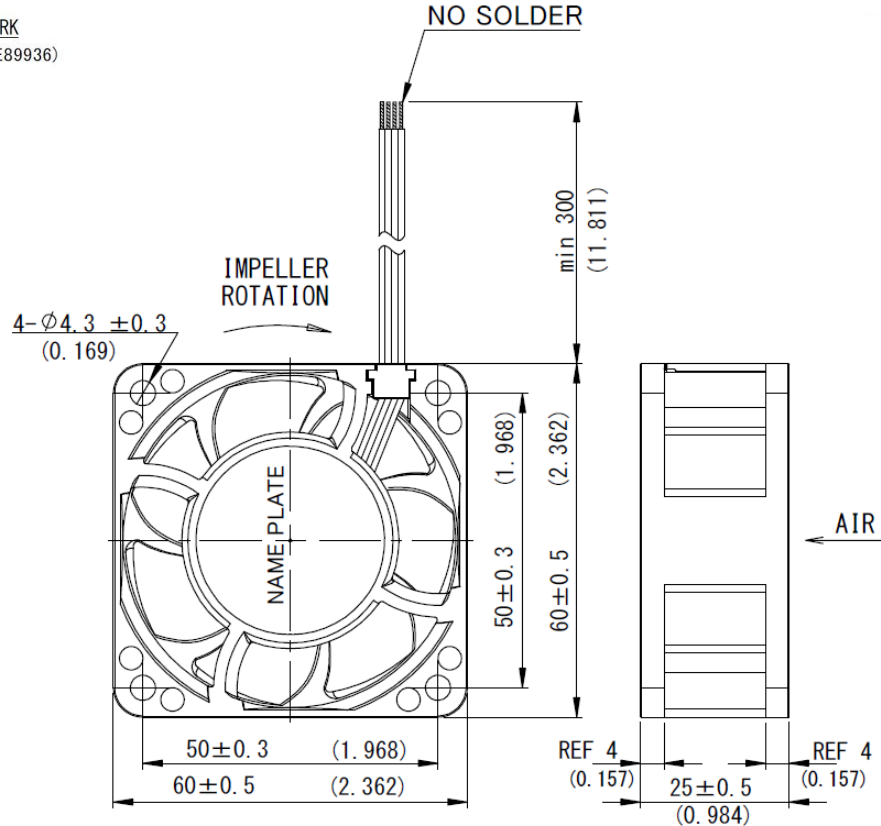

Unit: mm (inch)

Mouser Electronics

Authorized Distributor

Click to View Pricing, Inventory, Delivery & Lifecycle Information:

[NMB Technologies:](#)

[06025DA-12R-AU-02](#)