

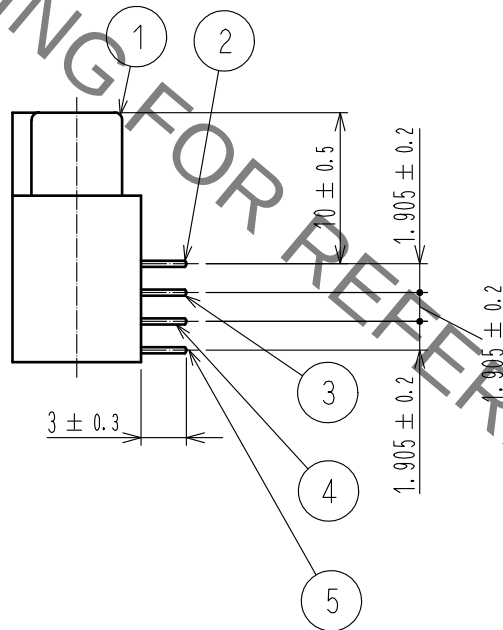
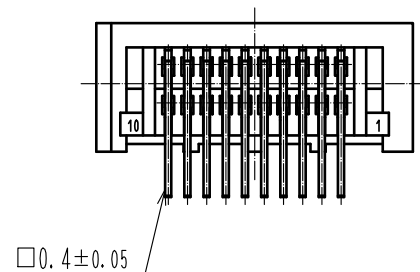
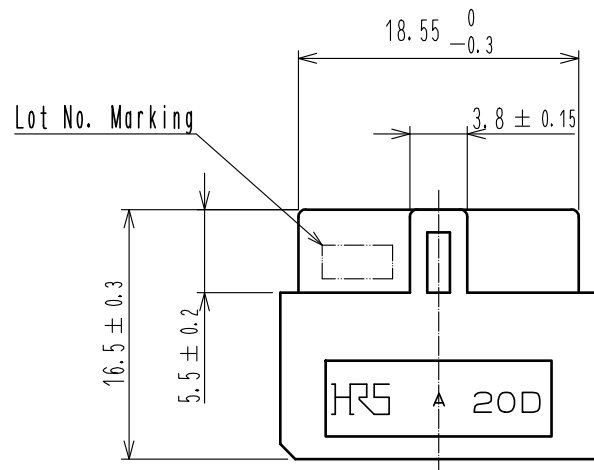


Jan.1.2022 Copyright 2022 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.

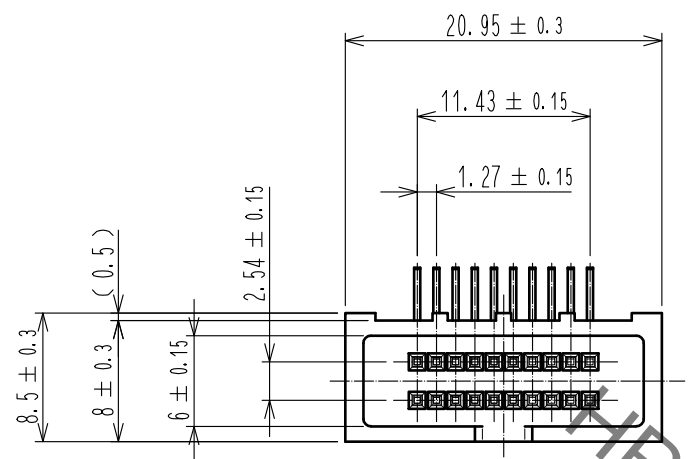

Recommended PC board hole pattern (mounting side)

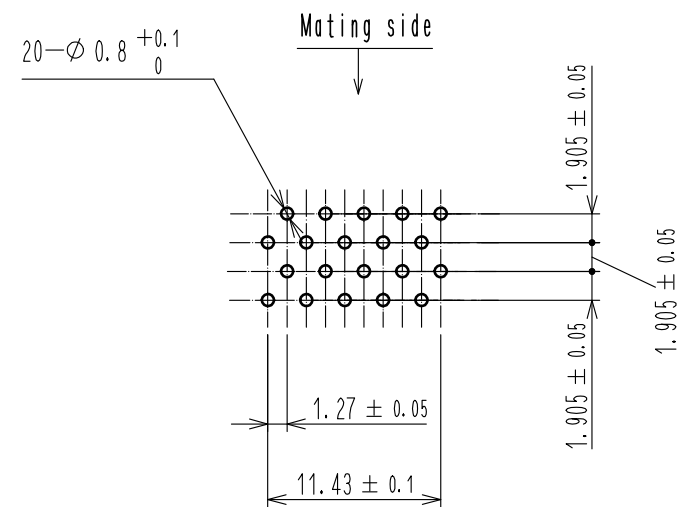

Notes 1 The dimensions in parentheses are for reference.

3	PHOSPHOR BRONZE	Contact area : Gold 0.2μm min.	5	PHOSPHOR BRONZE	Contact area : Gold 0.2μm min.
		Dip area : TIN-Plating 2μm min.			Dip area : TIN-Plating 2μm min.
		Under plating : Nickel 2.5μm min.			Under plating : Nickel 2.5μm min.
2	PHOSPHOR BRONZE	Contact area : Gold 0.2μm min.	4	PHOSPHOR BRONZE	Contact area : Gold 0.2μm min.
		Dip area : TIN-Plating 2μm min.			Dip area : TIN-Plating 2μm min.
1	PBT	Under plating : Nickel 2.5μm min.			Under plating : Nickel 2.5μm min.
		BLACK UL94V-0			
NO.	MATERIAL	FINISH . REMARKS	NO.	MATERIAL	FINISH . REMARKS
UNITS mm		SCALE 2 : 1	COUNT		DESCRIPTION OF REVISIONS
					DESIGNED
					CHECKED
					DATE
HRS HIROSE ELECTRIC CO., LTD.		APPROVED : HT. YAMAGUCHI	18.06.25	DRAWING NO. EDC-019014-71-21	
		CHECKED : HT. YAMAGUCHI	18.06.25	PART NO. HIF6A-20DA-1.27DS(71)	
		DESIGNED : TY. EDAGAWA	18.06.25	CODE NO. CL631-0001-0-71	
		DRAWN : MK. OKI	18.06.21		

Mouser Electronics

Authorized Distributor

Click to View Pricing, Inventory, Delivery & Lifecycle Information:

[Hirose Electric:](#)

[HIF6A-20DA-1.27DS\(71\)](#)