## Honeywell

# **CSCA-A Series**

## Hall-Effect Based Open-Loop Current Sensors



### **DESCRIPTION**

The CSCA-A Series of open-loop current sensors are based on the principles of the Hall-effect wherein a Hall-effect device (HED) produces an output voltage linearly related to the amplitude and phase of a magnetic field applied to it.

Current flowing through a primary conductor generates a rotating magnetic field around the conductor. This field is collector by a core of magnetically sensitive material and

concentrated in the gap in this core. The HED is located in this core gap. Therefore, the HED output is directly proportional to the amplitude and phase of the primary current.

The HED output is trimmed for gain and offset calibration such that the CSCA-A Series sensor provides a predefined output sensitivity versus primary current.

### **FEATURES**

- Measures ac, dc and impulse currents
- Competitive cost/performance ratio
- Low power consumption
- Compact size
- High level of electrical isolation between primary and secondary circuits
- Large primary aperture
- RoHs compliant
- CE, UL approvals (pending)

### POTENTIAL APPLICATIONS

- Variable speed drives
- Ground fault detectors
- Current feedback control systems
- Robotics
- UPS and telecommunication power supplies
- Welding power supplies
- Automotive Battery management systems
- Watt meters

## **CSCA-A Series**

SPECIFICATIONS (all specifications are at ±15 Vdc supply and 25 °C [77 °F] ambient temperature unless otherwise specificed)

Characteristic	Symbol	Parameter
Nominal current	I <sub>PN</sub>	See product selection guide
Peak measuring range (ac peak)	I <sub>PK</sub>	See product selection guide
Nominal output voltage at I <sub>PN</sub>	V <sub>SN</sub>	4 V ± 1 %
Supply voltage	V <sub>cc</sub>	±15 Vdc ± 5 %
Supply current	I <sub>cc</sub>	17 mA typ.
Accuracy at I <sub>PN</sub> <sup>1</sup>	Χ	$\leq$ ±2 % of I <sub>PN</sub>
Linearity <sup>2</sup>	Eı	< ±1 %
Zero current offset	Vo	≤ ±20 mV
Residual offset after I <sub>PN</sub>	$V_{OR}$	≤ ±20 mV
Thermal drift of offset	V <sub>OT</sub>	$\leq$ ±3 mV/°C @ I <sub>PN</sub> = 50 A
		$\leq$ ±1.5 mV/°C @ I <sub>PN</sub> = 100 A to 600 A
Thermal drift of gain	V <sub>ST</sub>	$\leq \pm 4 \text{ mV/}^{\circ}\text{C}$
Response time <sup>3</sup>	t <sub>R</sub>	3 μs to 7 μs
di/dt accuracy followed	di/dt	≥ 50A/µs
Bandwidth	f	dc to 50 kHz
Isolation voltage	$V_D$	3 kV, 50 Hz, 60 sec
Rated insulation voltage	VI	849 V reinforced
Output resistance	Rs	≥ 10 kOhm
Ambient operating temperature	T <sub>A</sub>	-10 °C to 80 °C [14 °F to 176 °F]
Ambient storage temperature	Ts	-25 °C to 85 °C [-13 °F to 185 °F]


### NOTES:

 $<sup>^1</sup>$  For  $I_P > I_{PN}$  then X is the same percentage value but of  $I_P$   $^2$  Independent linearity per the Instrument Society of America

<sup>&</sup>lt;sup>4</sup> Appropriate specification items defined using the guidance of EN50178

## Hall-Effect Based Open Loop Current Sensors

MOUNTING DIMENSIONS (For reference only. mm)

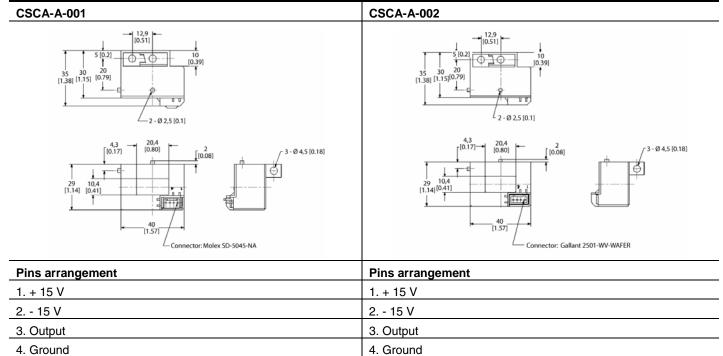

### **ORDER GUIDE**

Catalog listing	Description
CSCA0050A000B15B01	Hall-effect based, open-loop current sensor, Molex-type connector, 50 A rms nominal, ±150 A range
CSCA0100A000B15B01	Hall-effect based, open-loop current sensor, Molex-type connector, 100 A rms nominal, ±300 A range
CSCA0200A000B15B01	Hall-effect based, open-loop current sensor, Molex-type connector, 200 A rms nominal, ±600 A range
CSCA0300A000B15B01	Hall-effect based, open-loop current sensor, Molex-type connector, 300 A rms nominal, ±900 A range
CSCA0400A000B15B01	Hall-effect based, open-loop current sensor, Molex-type connector, 400 A rms nominal, ±900 A range
CSCA0500A000B15B01	Hall-effect based, open-loop current sensor, Molex-type connector, 500 A rms nominal, ±900 A range
CSCA0600A000B15B01	Hall-effect based, open-loop current sensor, Molex-type connector, 600 A rms nominal, ±900 A range
CSCA0050A000B15B02	Hall-effect based, open-loop current sensor, Gallant connector, 50 A rms nominal, ±150 A range
CSCA0100A000B15B02	Hall-effect based, open-loop current sensor, Gallant connector, 100 A rms nominal, ±300 A range
CSCA0200A000B15B02	Hall-effect based, open-loop current sensor, Gallant connector, 200 A rms nominal, ±600 A range
CSCA0300A000B15B02	Hall-effect based, open-loop current sensor, Gallant connector, 300 A rms nominal, ±900 A range
CSCA0400A000B15B02	Hall-effect based, open-loop current sensor, Gallant connector, 400 A rms nominal, ±900 A range
CSCA0500A000B15B02	Hall-effect based, open-loop current sensor, Gallant connector, 500 A rms nominal, ±900 A range
CSCA0600A000B15B02	Hall-effect based, open-loop current sensor, Gallant connector, 600 A rms nominal, ±900 A range

### **A** WARNING

### **PERSONAL INJURY**

DO NOT USE these products as safety or emergency stop devices or in any other application where failure of the product could result in personal injury.

Failure to comply with these instructions could result in death or serious injury.

### WARRANTY/REMEDY

Honeywell warrants goods of its manufacture as being free of defective materials and faulty workmanship. Honeywell's standard product warranty applies unless agreed to otherwise by Honeywell in writing; please refer to your order acknowledgement or consult your local sales office for specific warranty details. If warranted goods are returned to Honeywell during the period of coverage, Honeywell will repair or replace, at its option, without charge those items it finds defective. The foregoing is buyer's sole remedy and is in lieu of all other warranties, expressed or implied, including those of merchantability and fitness for a particular purpose. In no event shall Honeywell be liable for consequential, special, or indirect damages.

While we provide application assistance personally, through our literature and the Honeywell web site, it is up to the customer to determine the suitability of the product in the application.

Specifications may change without notice. The information we supply is believed to be accurate and reliable as of this printing. However, we assume no responsibility for its use.



### WARNING

### MISUSE OF DOCUMENTATION

- The information presented in this product sheet is for reference only. Do not use this document as a product installation guide.
- Complete installation, operation, and maintenance information is provided in the instructions supplied with each product.

Failure to comply with these instructions could result in death or serious injury.

### **SALES AND SERVICE**

Honeywell serves its customers through a worldwide network of sales offices, representatives and distributors. For application assistance, current specifications, pricing or name of the nearest Authorized Distributor, contact your local sales office or:

E-mail: info.sc@honeywell.com

Internet: www.honeywell.com/sensing

### Phone and Fax:

Asia Pacific +65 6355-2828

+65 6445-3033 Fax

Europe +44 (0) 1698 481481

+44 (0) 1698 481676 Fax

Latin America +1-305-805-8188

+1-305-883-8257 Fax USA/Canada +1-800-537-6945

+1-815-235-6847

+1-815-235-6545 Fax

**Sensing and Control** 

Honeywell 1985 Douglas Drive North Golden Valley, Minnesota 55422 www.honeywell.com/sensing

Honeywell

## **Mouser Electronics**

**Authorized Distributor** 

Click to View Pricing, Inventory, Delivery & Lifecycle Information:

## Honeywell:

<u>CSCA0050A000B15B01</u> <u>CSCA0050A000B15B02</u> <u>CSCA0100A000B15B02</u> <u>CSCA0200A000B15B02</u> <u>CSCA0300A000B15B02</u> <u>CSCA0400A000B15B02</u> <u>CSCA0500A000B15B02</u> <u>CSCA0600A000B15B02</u>