

Features

- Halogen Free. "Green" Device (Note 1)
- Lead Free Finish/RoHS Compliant(Note 2) ("P" Suffix Designates Compliant. See Ordering Information)
- Epoxy Meets UL 94 V-0 Flammability Rating
- Moisture Sensitivity Level 1

Maximum Ratings

- Operating Junction Temperature Range: -55°C to + 125°C(52AFL-510AFL)
- Operating Junction Temperature Range: -55°C to + 175°C(5150AFL-5200AFL)
- Storage Temperature Range: -55°C to +150°C
- Typical Thermal Resistance: 6°C/W Junction to Case
- Typical Thermal Resistance: 18°C/W Junction to Lead
- Typical Thermal Resistance: 61°C/W Junction to Ambient

MCC Part Number	Device Marking	Maximum Recurrent Peak Reverse Voltage	Maximum RMS Voltage	Maximum DC Blocking Voltage
SK52AFL	SK52	20V	14V	20V
SK53AFL	SK53	30V	21V	30V
SK54AFL	SK54	40V	28V	40V
SK55AFL	SK55	50V	35V	50V
SK56AFL	SK56	60V	42V	60V
SK58AFL	SK58	80V	56V	80V
SK510AFL	SK510	100V	70V	100V
SK5150AFL	SK5150	150V	105V	150V
SK5200AFL	SK5200	200V	140V	200V

Electrical Characteristics @ 25°C Unless Otherwise Specified


Average Forward Current	I _{F(AV)}	5.0A	See Fig.1		
Peak Forward Surge Current	I _{FSM}	100A	8.3ms,Half Sine		
Maximum Instantaneous Forward Voltage SK52AFL-SK54AFL SK55AFL-SK56AFL SK58AFL-SK510AFL SK5150AFL SK5200AFL	V _F	0.55V 0.70V 0.85V 0.87V 0.90V	I _{FM} =5.0A; T _J =25°C		
Maximum DC Reverse Current at Rated DC Blocking Voltage SK52AFL-SK58AFL SK58AFL-SK5200AFL	I _R	0.1mA 10mA 0.01mA 1mA	T _J =25°C T _J =100°C T _J =25°C T _J =100°C		
Typical Junction Capacitance SK52AFL-SK54AFL SK55AFL-SK56AFL SK58AFL-SK510AFL SK5150AFL SK5200AFL	CJ	300pF 210pF 170pF 150pF 110pF	Measured at 1.0MHz, V _R =4.0V		

Note :

1. Halogen free "Green" products are defined as those which contain <900ppm bromine, <900ppm chlorine (<1500ppm total Br + Cl) and <1000ppm antimony compounds.

2. High Temperature Solder Exemption Applied, see EU Directive Annex 7a


5 Amp Schottky Rectifiers 20 to 200 Volts

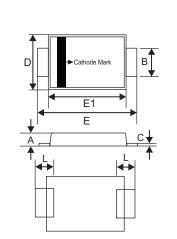

DO-221AC(SMA-FL)


DIMENSIONS						
DIM	INCHES		MM		NOTE	
	MIN	MAX	MIN	MAX	NOTE	
Α	0.035	0.049	0.90	1.25		
В	0.049	0.065	1.25	1.65		
С	0.004	0.016	0.10	0.40		
D	0.089	0.116	2.25	2.95		
E	0.173	0.220	4.40	5.60		
E1	0.126	0.181	3.20	4.60		
L	0.020	0.059	0.50	1.50		


Suggested Solder Pad Layout

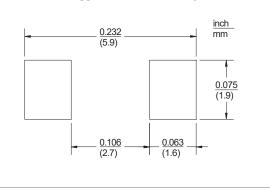



Curve Characteristics

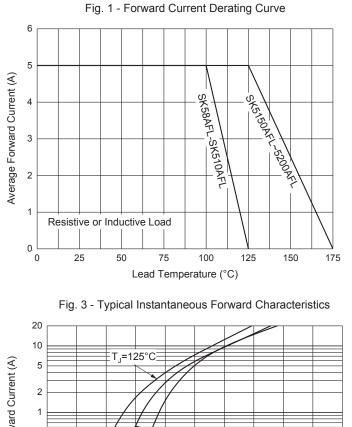

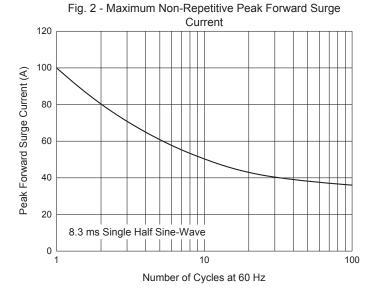

Characteristics Fig. 4 - Typical Instantaneous Forward Characteristics

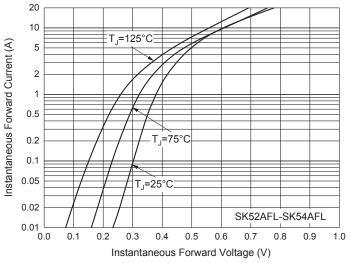
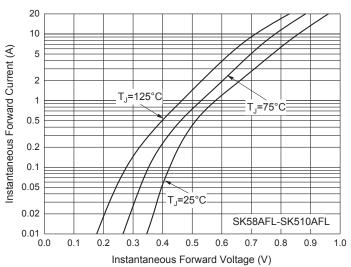


Fig. 5 - Typical Instantaneous Forward Characteristics




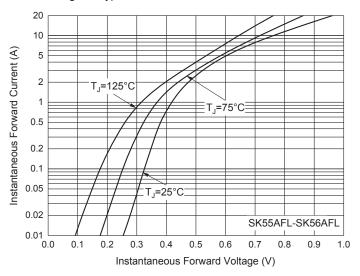


Fig. 6 - Typical Instantaneous Forward Characteristics





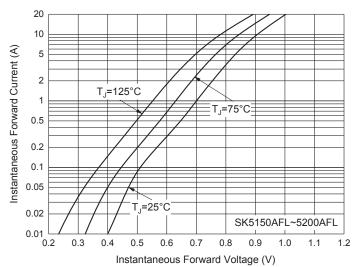

Curve Characteristics

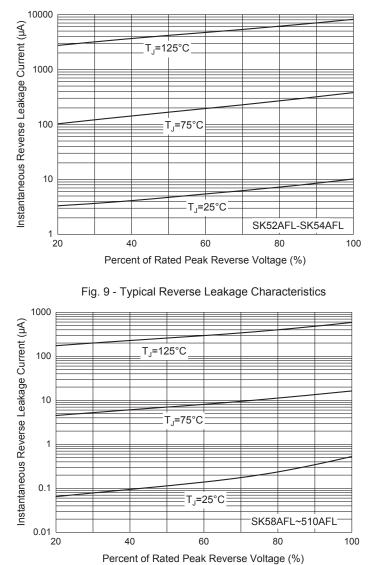


Fig. 7 - Typical Reverse Leakage Characteristics


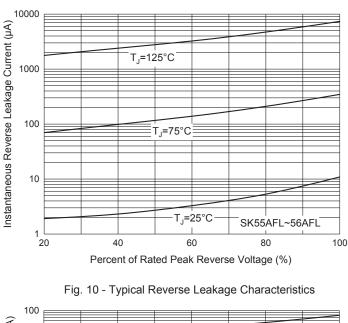


Fig. 8 - Typical Reverse Leakage Characteristics



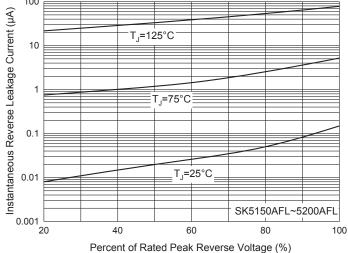

Ordering Information

Device	Packing	
Part Number-TP	Tape&Reel: 10Kpcs/Reel	

IMPORTANT NOTICE

Micro Commercial Components Corp. reserves the right to make changes without further notice to any product herein to make corrections, modifications, enhancements, improvements, or other changes. *Micro Commercial Components Corp*. does not assume any liability arising out of the application or use of any product described herein; neither does it convey any license under its patent rights, nor the rights of others. The user of products in such applications shall assume all risks of such use and will agree to hold *Micro Commercial Components Corp*. and all the companies whose products are represented on our website, harmless against all damages. *Micro Commercial Components Corp*. products are sold subject to the general terms and conditions of commercial sale, as published at

https://www.mccsemi.com/Home/TermsAndConditions.

LIFE SUPPORT

MCC's products are not authorized for use as critical components in life support devices or systems without the express written approval of Micro Commercial Components Corporation.

CUSTOMER AWARENESS

Counterfeiting of semiconductor parts is a growing problem in the industry. Micro Commercial Components (MCC) is taking strong measures to protect ourselves and our customers from the proliferation of counterfeit parts. MCC strongly encourages customers to purchase MCC parts either directly from MCC or from Authorized MCC Distributors who are listed by country on our web page cited below. Products customers buy either from MCC directly or from Authorized MCC Distributors are genuine parts, have full traceability, meet MCC's quality standards for handling and storage. **MCC will not provide any warranty coverage or other assistance for parts bought from Unauthorized Sources**. MCC is committed to combat this global problem and encourage our customers to do their part in stopping this practice by buying direct or from authorized distributors.

Mouser Electronics

Authorized Distributor

Click to View Pricing, Inventory, Delivery & Lifecycle Information:

Micro Commercial Components (MCC): SK5150AFL-TP_SK5200AFL-TP_SK53AFL-TP_SK55AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58AFL-TP_SK58A