Half-pitch Board-to-Board Connectors

XH3

Screw Mount Eliminated to Save Space. Adjustable Stacking Space of 12 to 20 mm Adds Greater Flexibility.

- The stacking space can be adjusted from 12 to 20 mm in 1-mm increments.
- A pitch of 1.27 mm for high-density mounting in double-row arrangements.
- A quadruple-row staggered arrangement (1.27 x 1.905 mm) for board connection.
- All models incorporate fastening pins to secure the terminals, thus preventing floating or falling over during soldering.
- Leaf contact construction enables smooth mating and resistance to bending.
- Space saving mating length of 3.1 mm.
- Press fitting assures long-term contact quality. The gold/palladium plating has been improved for better contact reliability.
- The XH3 conforms to UL standards (file No. E103202).
- Not mated with XH2 and XH4 Half-pitch Connectors.

RoHS Compliant

■ Terminology

Standard

To vertically connect the printed-wiring board, connect the socket straight terminal connector to the mother board (main board) side and connect the plug right-angle terminal connector to the daughter board (sub board) side.

Reverse

To vertically connect the printed-wiring board, connect the plug straight terminal connector to the mother board (main board) side and connect the socket right-angle terminal connector to the daughter board (sub board) side.

Stacking

Connects the printed-wiring boards parallel to each other. The distance between the boards here is called "stacking height".


Horizontal


Connect the printed-wiring boards horizontally.

Leaf contact construction

In this structure, contacts are protected by the housing.

Mating figure of the XH3A/XH3B

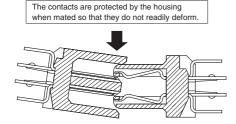

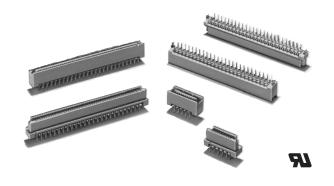

Ordering Information

■ Ratings and Characteristics


Rated current	0.5 A
Rated voltage	125 VAC
Contact resistance (See note.)	30 m Ω max. (20 mV max., 100 mA max.)
Insulation resistance	1,000 MΩ min. (at 500 VDC)
Dielectric strength	650 VAC for 1 min (leakage current: 1 mA max.)
Total insertion force	0.78 N max. per contact
Total removal force	0.10 N min. per contact
Insertion durability	400 times
Ambient operating temperature	Operating: -55 to 105°C (with no icing)

Note: The contact resistance is for the XH3A-□□41 combined with the XH3B-□□41.

■ Materials and Finish

Item	Type	Plug	Socket	
Housing		PBT resin with glass (UL94V-0)/gray		
Locator		PBT resin with glass (UL94V-0)/gray		
Contacts	Mating end	Phosphor bronze/ nickel base, gold/ palladium plating	Phosphor bronze/ nickel base, gold/ palladium plating	
	Terminal	Phosphor bronze/ nickel base, tin plating	Phosphor bronze/ nickel base, tin plating	
Fastening pins		Phosphor bronze/tin plating		


XH3A Plug, Straight DIP Terminals

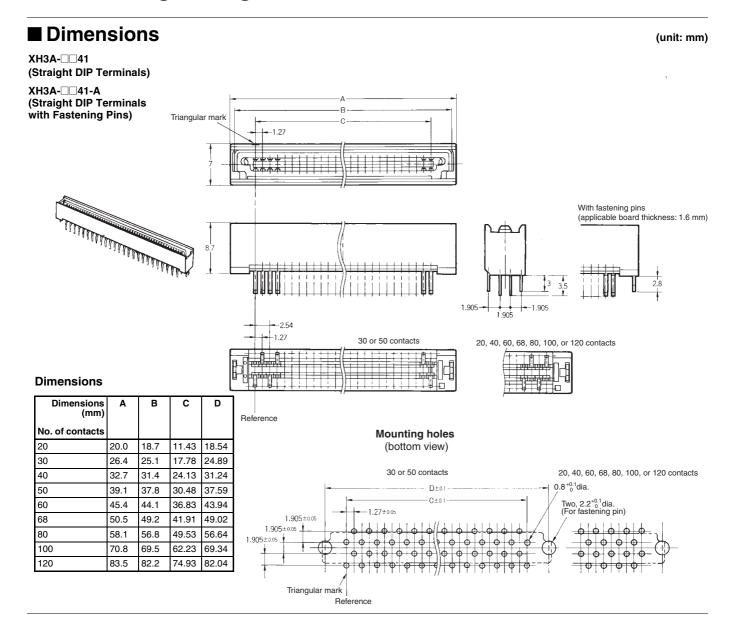

■ Ordering Information

Model No. of contacts	Plug/Straight DIP Terminals	Plug/Straight DIP Terminals with fastening pins (See note.)
20	XH3A-2041	XH3A-2041-A
30	XH3A-3041	XH3A-3041-A
40	XH3A-4041	XH3A-4041-A
50	XH3A-5041	XH3A-5041-A
60	XH3A-6041	XH3A-6041-A
68	XH3A-6841	XH3A-6841-A
80	XH3A-8041	XH3A-8041-A
100	XH3A-0141	XH3A-0141-A
120	XH3A-0241	XH3A-0241-A

XH3A Plug, Straight DIP Terminals Stacking Space Adjustable in Increments of 2 or 4 mm

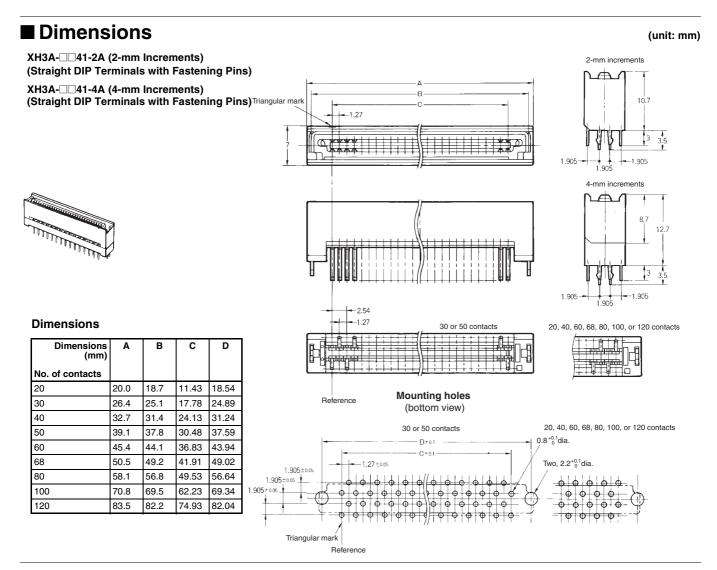


■ Ordering Information

Model No. of contacts	Plug/Straight DIP Terminals with fastening pins (2-mm Increments) (See note.)	Plug/Straight DIP Terminals with fastening pins (4-mm Increments) (See note.)
20	XH3A-2041-2A	XH3A-2041-4A
30	XH3A-3041-2A	XH3A-3041-4A
40	XH3A-4041-2A	XH3A-4041-4A
50	XH3A-5041-2A	XH3A-5041-4A
60	XH3A-6041-2A	XH3A-6041-4A
68	XH3A-6841-2A	XH3A-6841-4A
80	XH3A-8041-2A	XH3A-8041-4A
100	XH3A-0141-2A	XH3A-0141-4A
120	XH3A-0241-2A	XH3A-0241-4A

XH3A Plug, Right-angle DIP Terminals




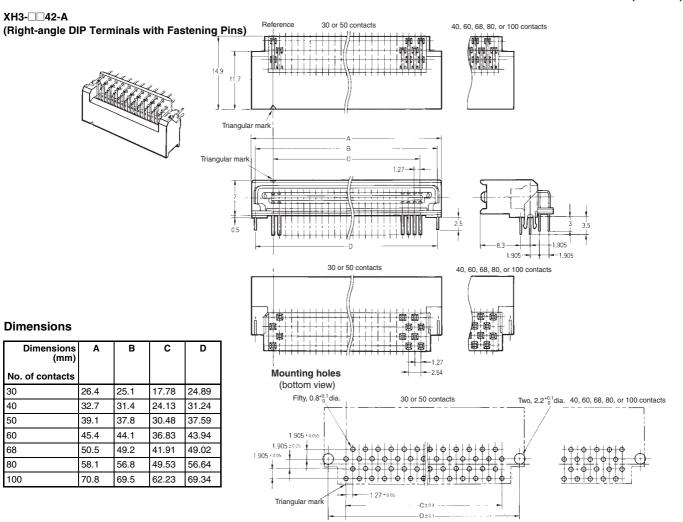

■ Ordering Information

Model	Plug/Right-angle DIP Terminals with fastening pins (See note.)	
No. of contacts		
30	XH3A-3042-A	
40	XH3A-4042-A	
50	XH3A-5042-A	
60	XH3A-6042-A	
68	XH3A-6842-A	
80	XH3A-8042-A	
100	XH3A-0142-A	


XH3B Socket, Straight DIP Terminals

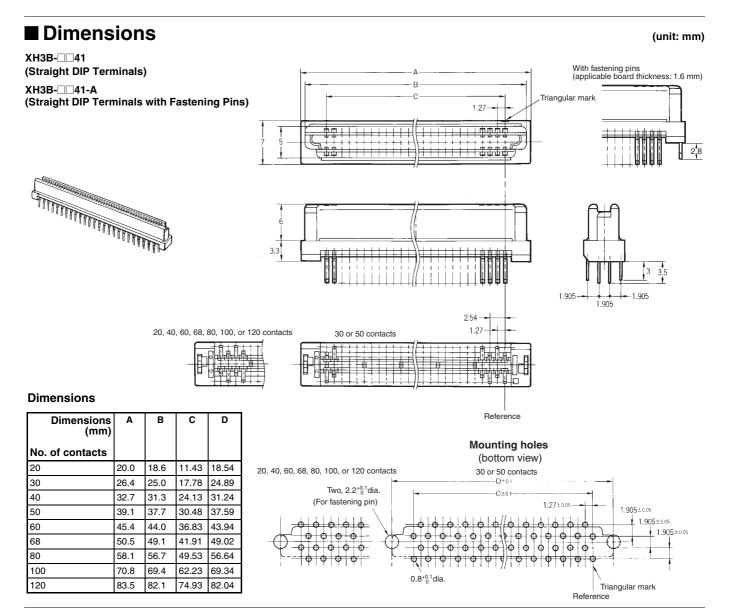

■ Ordering Information

Model	Socket/Straight DIP Terminals	Socket/Straight DIP Terminals with fastening pins (See note.)
No. of contacts		3, 1,111
20	XH3B-2041	XH3B-2041-A
30	XH3B-3041	XH3B-3041-A
40	XH3B-4041	XH3B-4041-A
50	XH3B-5041	XH3B-5041-A
60	XH3B-6041	XH3B-6041-A
68	XH3B-6841	XH3B-6841-A
80	XH3B-8041	XH3B-8041-A
100	XH3B-0141	XH3B-0141-A
120	XH3B-0241	XH3B-0241-A


XH3B Socket, Straight DIP Terminals Stacking Space Adjustable in Increments of 1, 3, and 4 mm

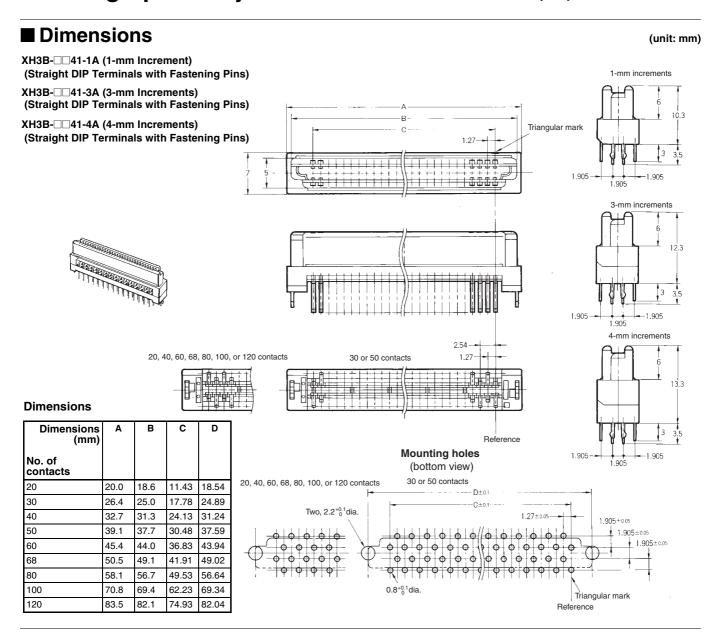

■ Ordering Information

Model No. of contacts	Socket/Straight DIP Terminals with fastening pins (1-mm increment) (See note.)	Socket/Straight DIP Terminals with fastening pins (3-mm increments) (See note.)	Socket/Straight DIP Terminals with fastening pins (4-mm increments) (See note.)
20	XH3B-2041-1A	XH3B-2041-3A	XH3B-2041-4A
30	XH3B-3041-1A	XH3B-3041-3A	XH3B-3041-4A
40	XH3B-4041-1A	XH3B-4041-3A	XH3B-4041-4A
50	XH3B-5041-1A	XH3B-5041-3A	XH3B-5041-4A
60	XH3B-6041-1A	XH3B-6041-3A	XH3B-6041-4A
68	XH3B-6841-1A	XH3B-6841-3A	XH3B-6841-4A
80	XH3B-8041-1A	XH3B-8041-3A	XH3B-8041-4A
100	XH3B-0141-1A	XH3B-0141-3A	XH3B-0141-4A
120	XH3B-0241-1A	XH3B-0241-3A	XH3B-0241-4A

XH3B Socket, Right-angle DIP Terminals

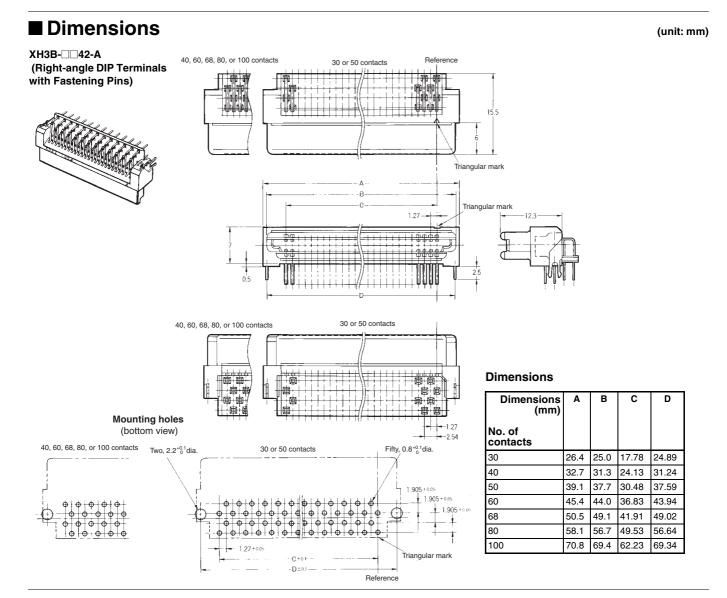


■ Ordering Information

Model	Plug/Right-angle DIP Terminals with fastening pins (See note.)	
No. of contacts	Model	
30	XH3B-3042-A	
40	XH3B-4042-A	
50	XH3B-5042-A	
60	XH3B-6042-A	
68	XH3B-6842-A	
80	XH3B-8042-A	
100	XH3B-0142-A	

■ Mating Diagram

(unit: mm)

Vertical/Horizontal/Stacking

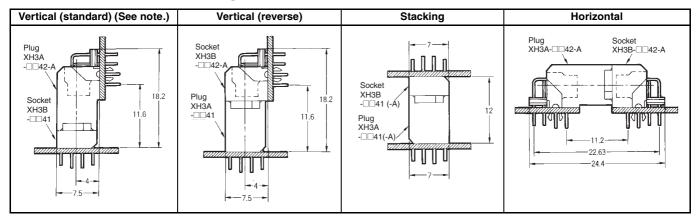

Note: The function of the standard and reverse models is the same as that of the standard XC5 DIN Connectors.

Stacking Space Adjustable Models


Stacking space	12 mm	13 mm	14 mm	15 mm	16 mm
Mating diagram	Socket XH3B-□□41 (-A) PCB 12 Plug XH3A-□□41(-A)	XH3B	XH3B-□□41(-A) -7- 14 14 -7- XH3A-□□41-2A	XH3B-□41-1A -7- 15 XH3A-□41-2A	XH3B
Stacking space	17 mm	18 mm	19 mm	20 mm	
Mating diagram	XH3B-□□41-1A 17 17 17 XH3A-□□41-4A	XH3B-□□41-4A -7- 18 18 18 XH3A-□□41-2A	XH3B-□□41-3A → 7 → 19 19 19 XH3A-□□41-4A	XH3B-□□41-4A 20 20 XH3A-□□41-4A	

Combinations

Plug	Socket	XH3B-□□41 XH3B-□□41-A	1-mm increment XH3B-□□41-1A	3-mm increments XH3B-□□41-3A	4-mm increments XH3B-□□41-4A
XH3A-□□41, XH3A-□□41-A		12 mm	13 mm	(15 mm) (See note.)	(16 mm) (See note.)
2-mm increment XH3A-□□41-2A		14 mm	15 mm	(17 mm) (See note.)	18 mm
4-mm increment XH3A-□□41-4A		16 mm	17 mm	19 mm	20 mm

Note: Combinations marked with parentheses must be avoided if possible.

■ Contact Numbers

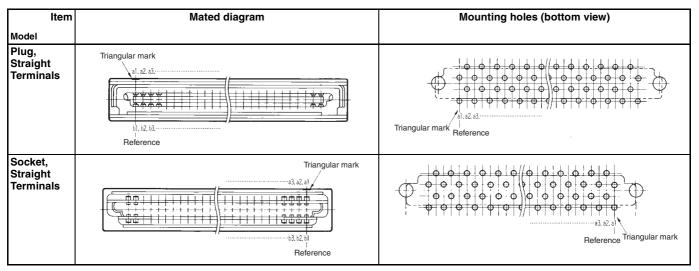

- Contact numbers are not printed on the connectors. Use the triangular mark (▼) as a guide when designing and mounting to boards.
- On the mating side, the row of terminals on the triangular mark side are called row a, and the row on the other side is called row b. The numbers are in the order shown.
- The triangular marks on the plug and socket must be aligned when mated. The contact numbers on both sides must match.

■ Precautions

Correct Use

Mating Compatibility

XH3 Half-pitch Connectors do not mate with XH2 or XH4 Half-pitch Connectors.


Special Finish for Preventing Flux Rise

XH3 Connectors (i.e., Straight Terminals and standard size, 1-, and 2-mm increments) have a special finish that prevents flux rise. (The Connectors are designed for automated soldering. Brush coating flux from the back of the board applies too much flux and may nullify the special finish. Never use this method to apply flux.)

Soldering

Automated soldering

Use tape to mask the Right-angle Terminal Connector prior to automated soldering.



Automated Soldering Conditions (Jet Flow)

- 1. Soldering temperature: 250±5°C
- Continuous soldering time: Within 5 s (Be sure to wash the board after continuous soldering is completed.)

Application examples provided in this document are for reference only. In actual application Consult your OMRON representative before using the product under conditions which are systems, aviation systems, vehicles, combustion systems, medical equipment, amusement influence on lives and property if used improperly. Make sure that the ratings and perfequipment, and be sure to provide the system or equipment with double safety mechanisms.	not described in the manual or applying the product to nuclear control systems, railroad t machines, safety equipment, and other systems or equipment that may have a serious formance characteristics of the product provide a margin of safety for the system or
	Note: Do not use this document to operate the Unit.

Mouser Electronics

Authorized Distributor

Click to View Pricing, Inventory, Delivery & Lifecycle Information:

Omron:

XH3B-3042-A XH3B-3041-4A XH3B-2041-A