
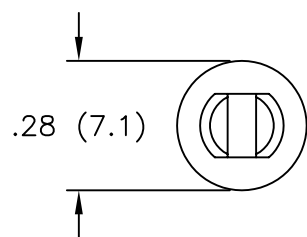


TO SNAP-LOCK IN A $.156 \pm .003$
(4.00 ± 0.08) DIA. HOLE, IN A
.062 (1.57) NOM. THK. BOARD/CHASSIS
(BOTH ENDS)

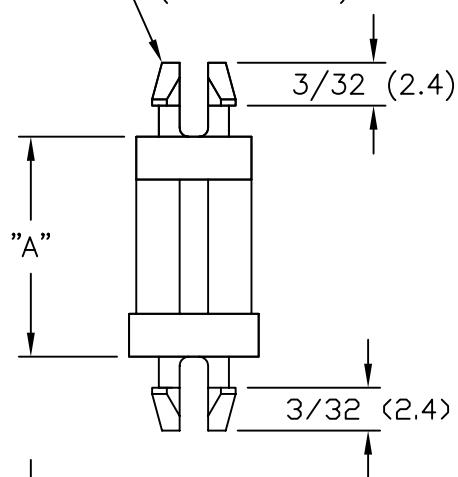

NOTES:

1. MATERIAL: NYLON 6/6 (RMS-01).
FLAME RETARDANT: NYLON (RMS-19),
AVAILABLE BY SPECIAL ORDER ONLY.
2. COLOR: NATURAL.

PART NO.	"A"
SP1-3-01	$\pm .015$ (± 0.4)
SP1-4-01	3/16 (4.8)
SP1-6-01	1/4 (6.4)
SP1-8-01	3/8 (9.5)
SP1-10-01	1/2 (12.7)
SP1-12-01	5/8 (15.9)
SP1-14-01	3/4 (19.1)
SP1-16-01	7/8 (22.2)
	1 (25.4)

TITLE: SUPPORT POST, TYPE 1					DWG IN IN (MM)	
TOLERANCES UNLESS NOTED .XX= $\pm .010$.XXX= $\pm .005$ FRAC= $\pm 1/64$ ANG= $\pm 1^\circ$	FILE # SP1	DWN: P.B.	APP:	FINAL		
	MAT'L: SEE NOTES	DT: 03-11-94	DT:			
	RE: RICHCO, INC.	RICHCO INC. PO BOX 804238, CHICAGO, 60680 (773) 539-4060		PART #	PRINT TYPE	
				SEE TABLE	CA	

B	CHANGED FILE NO. AND TITLE BLOCK	SM 02.04.02
A	DIM'S 3/32 (2.4) ADDED, DIM'S .16 (4.1) REMOVED, .062 IN NOTE 4 WAS 1/16	PB 083094
REV	DESCRIPTION	ENGR DATE

Mouser Electronics

Authorized Distributor

Click to View Pricing, Inventory, Delivery & Lifecycle Information:

Essentra:

[SP1-6-01](#) [SP1-16-01](#) [SP1-4-01](#) [SP1-10-01](#) [SP1-12-01](#) [SP1-14-01](#) [SP1-3-01](#) [SP1-8-01](#)