

**MODEL:** CPT-1775-3TH | **DESCRIPTION:** PIEZO BUZZER TRANSDUCER**FEATURES**

- no driving circuit
- piezo
- through hole

**SPECIFICATIONS**


parameter	conditions/description	min	typ	max	units
rated voltage	Vp-p 		3		Vp-p
operating voltage		2		30	Vp-p
current consumption	at rated voltage, 4,000 Hz, ½ duty square wave			7	mA
rated frequency			4,000		Hz
sound pressure level	at 10 cm, rated voltage, 4,000 Hz, ½ duty square wave	75			dB
electrostatic capacitance	at 100 Hz/1 V	9,100	14,000	18,900	pF
dimensions	Ø17.0 x 7.5				mm
weight			1.5		g
material	PBT (black)				
terminal	pin (tin plating)				
operating temperature		-35		90	°C
storage temperature		-40		90	°C
washable	no				
RoHS	yes				

Notes: 1. All specifications measured at +5~+35°C, humidity at 45~85%, under 86~106 kPa pressure, unless otherwise noted.

SOLDERABILITY


parameter	conditions/description	min	typ	max	units
hand soldering	for max 3 seconds	330		360	°C
wave soldering ²	see recommended wave soldering profile		250		°C

Notes: 2. Not to exceed 1 wave soldering cycle.

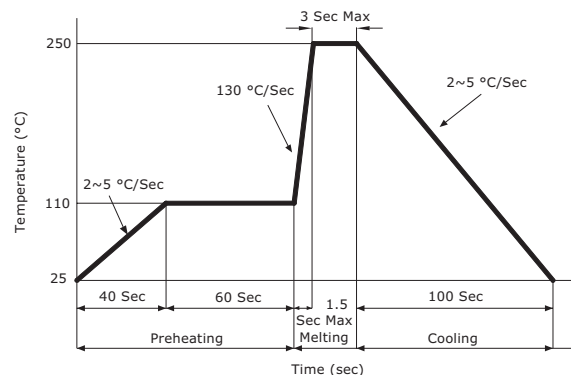


MECHANICAL DRAWING

units: mm
tolerance: ± 0.5 mm

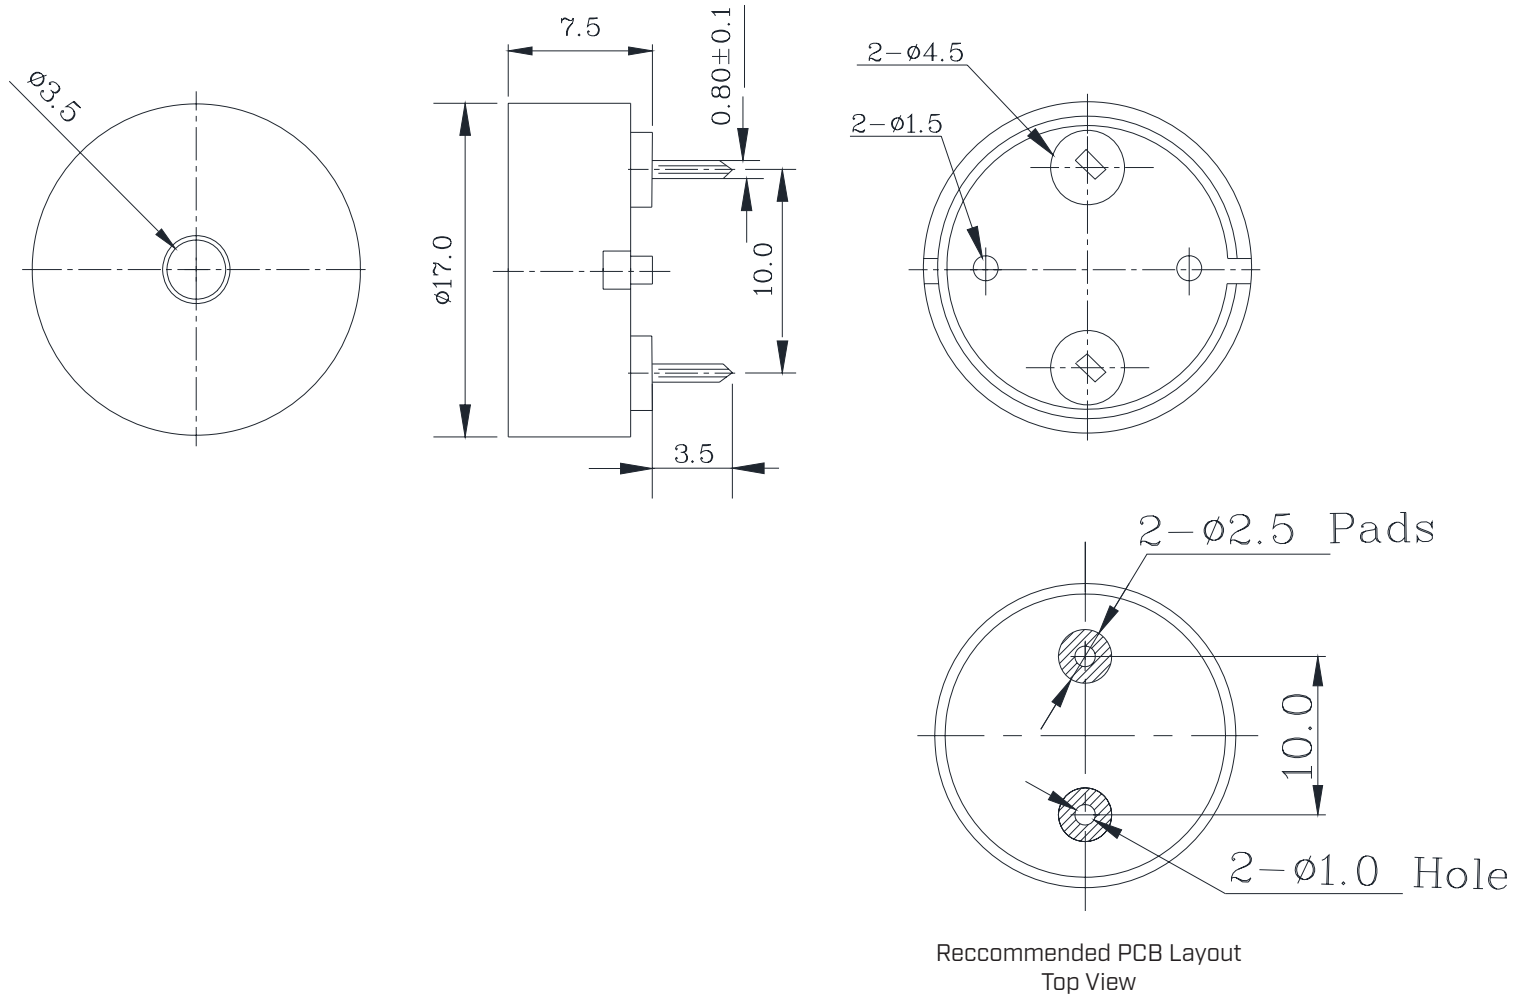

FREQUENCY RESPONSE CURVE

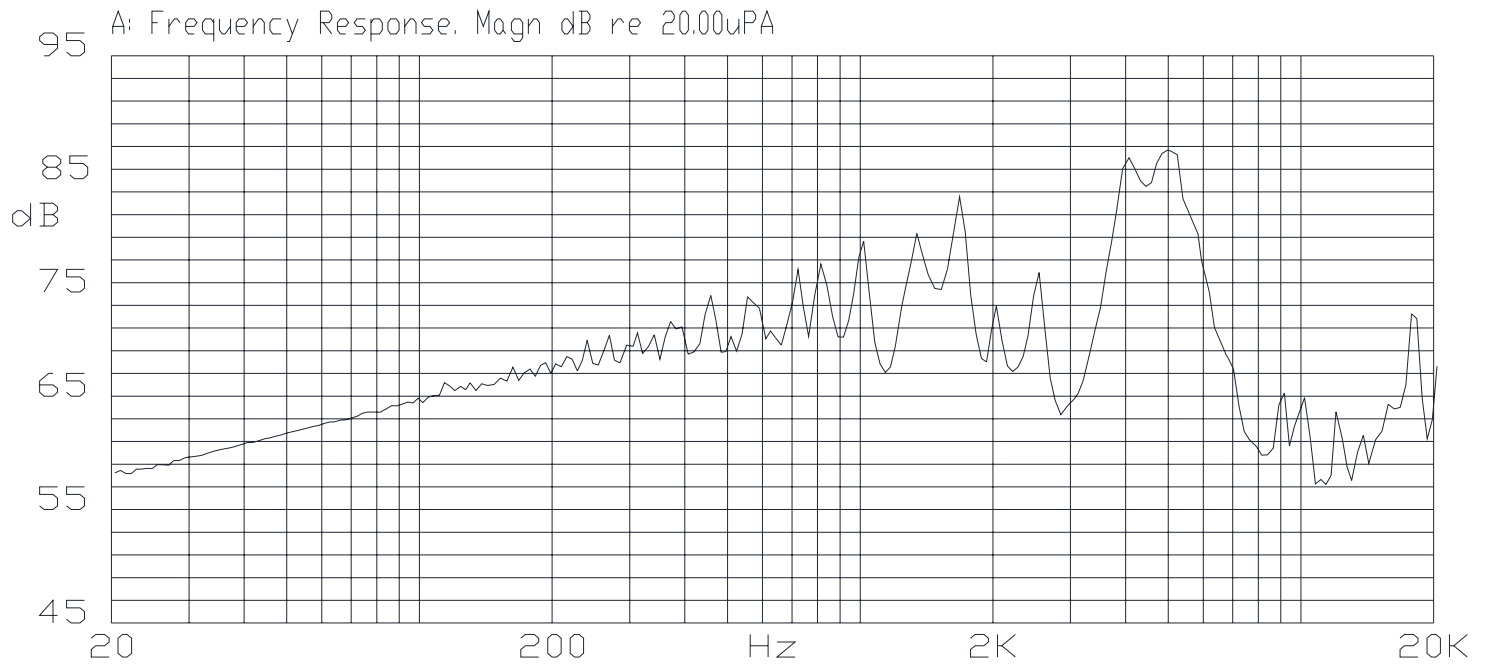

REVISION HISTORY

rev.	description	date
1.0	initial release	07/22/2025

The revision history provided is for informational purposes only and is believed to be accurate.



Same Sky offers a one (1) year limited warranty. Complete warranty information is listed on our website.

Same Sky reserves the right to make changes to the product at any time without notice. Information provided by Same Sky is believed to be accurate and reliable. However, no responsibility is assumed by Same Sky for its use, nor for any infringements of patents or other rights of third parties which may result from its use.

Same Sky products are not authorized or warranted for use as critical components in equipment that requires an extremely high level of reliability. A critical component is any component of a life support device or system whose failure to perform can be reasonably expected to cause the failure of the life support device or system, or to affect its safety or effectiveness.

sameskydevices.com