
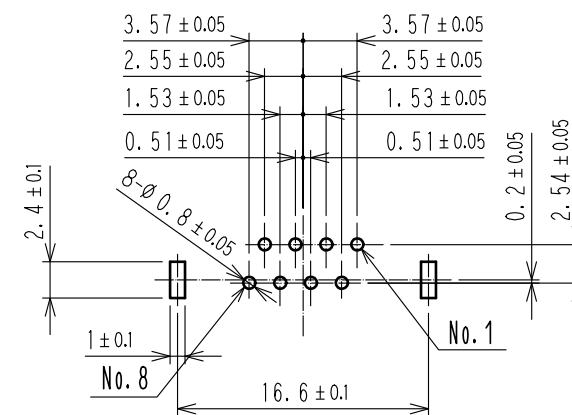
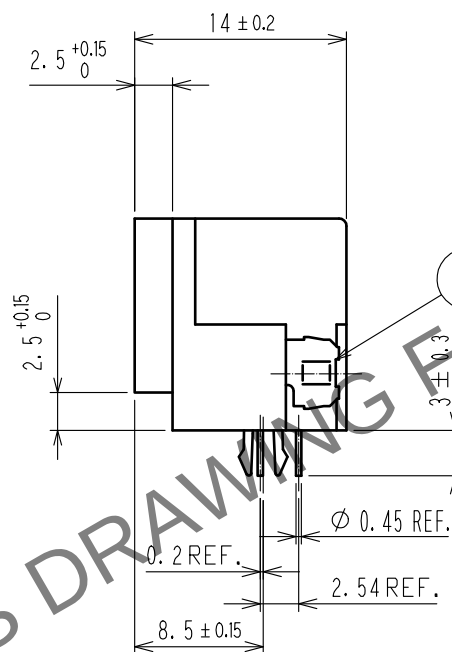


Oct.1.2025 Copyright 2025 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.



A-A


RECOMMENDED PC BOARD HOLE PATTERN (MOUNTING SIDE)
(APPLICABLE THICKNESS OF PC BOARD $t=1.6$)

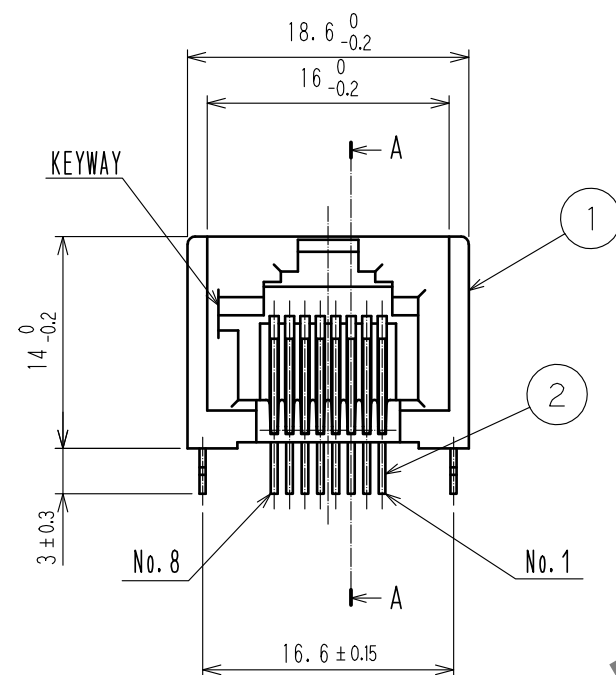

1 FCC plug dimension

Note 1 Do not mate with the plug nonconforming to FCC standard.
Take extra care to the contact location shown in the figure.

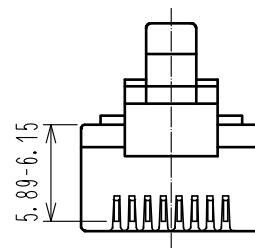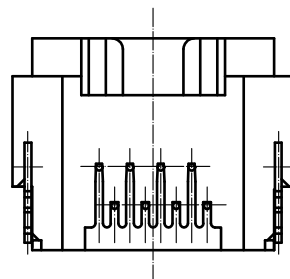

				3	PHOSPHOR BRONZE	TIN REFLOW PLATING 1 μm MIN.			
				2	PHOSPHOR BRONZE	CONTACT AREA : GOLD PLATING 1.27 μm MIN. LEAD AREA : GOLD PLATING 0.03 μm MIN. UNDER PLATING : NICKEL PLATING 1.27 μm MIN.			
1	PBT	GRAY, UL94V-0							
NO.	MATERIAL	FINISH, REMARKS			NO.	MATERIAL	FINISH, REMARKS		
UNITS mm		SCALE 2 : 1		COUNT	DESCRIPTION OF REVISIONS		DESIGNED	CHECKED	DATE
 HIROSE ELECTRIC CO., LTD.		APPROVED : MN. KENJO			20211126	DRAWING NO. EDC-026382-60-00			
		CHECKED : KG. OKITA			20211125	PART NO. TM5RJ3-88(60)			
		DESIGNED : MO. SHIMOYAMA			20211125	CODE NO. CL0222-1465-3-60			
		DRAWN : MO. SHIMOYAMA			20211125				
									