

Test Report



Report No. A225036410210100302R1

Page 1 of 5

Company Name
Shown on Report GLOBAL CONNECTOR TECHNOLOGY LTD

Address UNIT B, 8/F, HANG CHEONG FACTORY BUILDING, 1 WING MING STREET, CHEUNG SHA WAN, KOWLOON, HK

The following sample(s) and sample information was/were submitted and identified by/on the behalf of the client

Sample Name RP SMA Bulkhead Jack with O-ring, PCB mount, Right angle
Part number RFPC-SMA43-FN
Sample Receiving State Normal
Sample Received Date May 28, 2025
Testing Period May 28, 2025-Jun. 16, 2025

Test Requested

No.	Test Item
1	IP6X

Test Result(s): Please see the following pages.

Approved by Tim Sun

Date Jun. 18, 2025



Tim Sun
Approved Signatory

No. R2082A65A2

Centre Testing International Group Co., Ltd. Hongwei Industrial Zone, Bao'an 70 District, Shenzhen, Guangdong, China

Test Report

Report No. A225036410210100302R1

Page 2 of 5

Tested Sample(s)

Sample No.	Sample Name	Quantity
A2250364102101003	RP SMA Bulkhead Jack with O-ring, PCB mount, Right angle	1pc

Sample Photo(s)



A2250364102101003

Test Report

Report No. A225036410210100302R1

Page 3 of 5

Test Item: IP6X**1. Test Equipment**

Equipment Name	Model
1mm Test Probe	SHQG-D1N
Dust Tester	JX1102A

2. Environmental Conditions

Temperature: 23.2°C; Humidity: 55%RH

3. Test Standard: IEC 60529:2013**4. Test Condition**

Use a test probe with a diameter of 1mm to probe the gap part of the sample with a force of 1N.

Put the sample in a negative pressure state, the pumping rate is 40-60 times the volume of the shell per hour, and the pressure difference between the pressure in the shell and the atmospheric pressure is less than 2kPa, and the test is continuously performed for 2h in the dust-proof test box.

5. Test Result(s)


Sample No.	Criterion	Test result (Visual inspection)	Conclusion
A2250364102101003	The test probe cannot enter the inside of the sample, and the inside of the sample is dustless.	The test probe cannot enter the inside of the sample, and the inside of the sample is dustless.	Pass

Test Report

Report No. A225036410210100302R1

Page 4 of 5

Test Photo(s)

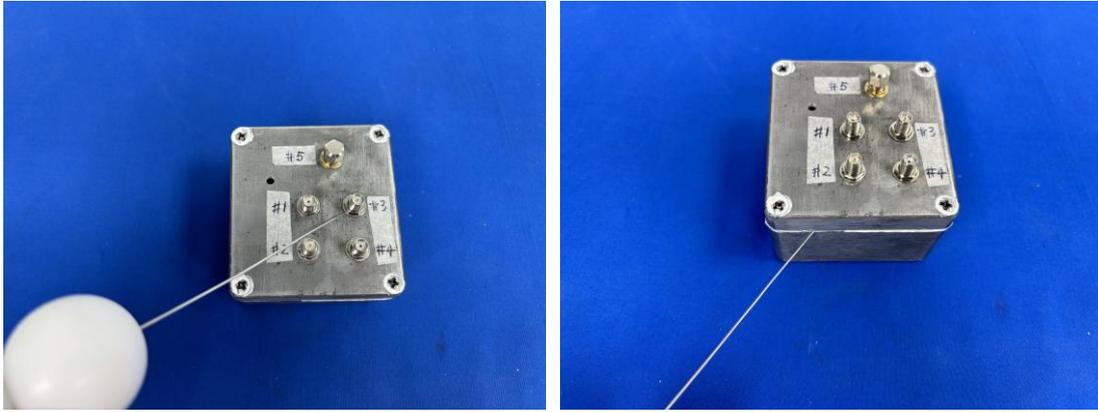

Sample Photo(s) after the test



A2250364102101003

Remark: The testing data and result(s) in this report is(are) just for scientific research, education, internal quality control and product development etc.

华测检测
CALIP 001 / 2011

Test Report

Report No. A225036410210100302R1

Page 5 of 5

Note: This testing report added “Part number” based on the original report of No. A225036410210100302. This testing report displaces the original one which was invalid since the date of this testing report released.

Statement:

- 1.This report is considered invalid without approved signature, special seal and the seal on the perforation;
- 2.Company Name and Address shown on Report, the sample(s) and sample Information was/were provided by the applicant who should be responsible for the authenticity which CTI hasn't verified;
- 3.The result(s) shown in this report refer(s) only to the sample(s) tested;
- 4.Without written approval of CTI, this report can't be reproduced except in full;
- 5.In case of any discrepancy between the English version and Chinese version of the testing reports(if generated), the Chinese version shall prevail.

*** End of Report ***

